

# On the status of plane and solid angles in the International System of Units (SI)

M.I. Kalinin

## Abstract

The article analyzes the arguments that became the basis for declaring in 1995, at the 20th General Conference on Weights and Measures that the plane and solid angles are dimensionless derived quantities in the International System of Units. The inconsistency of these arguments is shown. It is found that a solid angle is a derived quantity of a plane angle and its unit, the steradian, is a non-coherent derived unit of the radian.

## 1 The 1995 reform of the SI

In 1960, the 11th General Conference on Weights and Measures (CGPM), in its Resolution 12 [1], adopted the International System of Units (SI). It included three classes of units: base units, derived units, and supplementary units. The class of base units included the units of length, mass, time, electric current, thermodynamic temperature, and luminous intensity. The class of derived units contained 29 units. The class of supplementary units contained a unit of plane angle – the radian, and a unit of solid angle – the steradian. In 1971, the unit of the amount of substance, the mole, was added to the base units.

In the framework of the SI it is considered that the base quantities have independent dimensions, that is, none of the base units can be obtained from the others. Derived units are obtained from the base ones applying the rules of algebraic multiplication, division and exponentiation. Supplementary quantities (the plane and solid angles) also had dimensions independent of other quantities, and their units were not generated from the base ones.

In 1995, the 20th CGPM adopted Resolution 8 [2], which eliminated the class of the SI supplementary units, and angles (plane and solid) were declared as dimensionless derived quantities. A plane angle was defined as a ratio of two quantities having the same dimension of length. A solid angle was defined as a ratio of an area to the square of a length. As a result of these definitions of angles, their units also became dimensionless. Since 1995 the unit of plane angle is defined as the dimensionless number “one”, equal to the ratio of a meter to a meter, and the unit of solid angle is also dimensionless number “one”, equal to the ratio of a squared meter to a squared meter. The names radian and steradian can be applied (but not necessarily) for the convenience of distinguishing the dimensionless derived units of the plane and solid angles.

What was the reason for such a radical revision made at the 20th CGPM? And to what extent was it justified? Why were these two dimensional quantities of different kinds declared dimensionless? One of the principal initiators of this reform was the International Committee for Weights and Measures (CIPM), based on Recommendation U1 of the Consultative Committee for Units (CCU) [4]. CIPM Recommendation 1 of 1980 presented the driving motives [5]:

**“CIPM, 1980: Recommendation 1**

The Comité International des Poids et Mesures (CIPM),

**taking into consideration** Resolution 3 adopted by ISO/TC 12 in 1978 and Recommendation U1 (1980) adopted by the Comité Consultatif des Unités at its 7th meeting

**considering**

- that the units radian and steradian are usually introduced into expressions for units when there is need for clarification, especially in photometry where the steradian plays an important role in distinguishing between units corresponding to different quantities,
- that in the equations used one generally expresses plane angle as the ratio of two lengths and solid angle as the ratio between an area and the square of a length, and consequently that these quantities are treated as dimensionless quantities,
- that the study of the formalisms in use in the scientific field shows that none exists which is at the same time coherent and convenient and in which the quantities plane angle and solid angle might be considered as base quantities,

**considering also**

- that the interpretation given by the CIPM in 1969 for the class of supplementary units introduced in Resolution 12 of the 11th Conférence Générale des Poids et mesures (CGPM) in 1960 allows the freedom of treating the radian and the steradian as SI base units,
- that such a possibility compromises the internal coherence of the SI based on only seven base units,

**decides to** interpret the class of supplementary units in the International System as a class of dimensionless derived units for which the CGPM allows the freedom of using or not using them in expressions for SI derived units.”

Thus, at present, the radian and steradian are defined in the SI [3] as follows:

$$1 \text{ rad} = 1 \text{ m/m}, \quad 1 \text{ sr} = 1 \text{ m}^2/\text{m}^2. \quad (1)$$

To measure the value of a plane angle, another unit is also used – a degree. The degree is not an SI unit, but is allowed to be used on a par with the radian. And in the SI brochure [3] it is defined by the expression

$$1^\circ = (\pi/180) \text{ rad.}$$

It follows that the degree also turns out to be a dimensionless number.

As a result of the 1995 reform, there were numerous discrepancies, inconsistencies, and contradictions in the wordings of the SI.

The first discrepancy concerns the relation between the kinds of the plane and solid angles. In the SI, quantities of the same kind have identical dimensions, the same units of measurement. They can be compared by size, and can be added and subtracted<sup>1</sup>. Quantities of different dimensions cannot be compared by size, added or subtracted.

The plane angle and the solid angle are qualitatively different quantities. The plane angle is a two-dimensional geometric object on a plane, and the solid angle is a three-dimensional geometric object in a three-dimensional space. They are quantities of different kinds. Comparing the plane angle and the solid angle by size is just like comparing the length and the area. Therefore, the plane angle and the solid angle have different dimensions.

The transfer of the radian and steradian to the class of dimensionless derived units resulted in appearing the section “Units for dimensionless quantities, also called quantities of dimension one” in the SI Brochure [3]. The dimensionless quantities are in fact divided into three classes there. The first class includes dimensionless quantities that are obtained as a result of certain combinations of dimensional physical quantities. The unit of such a dimensionless quantity is the number one, which is called “*a dimensionless derived unit*”. It is not clear which base units this number, one, is produced from. The Brochure does not specify it.

The second class of dimensionless quantities given in the SI Brochure is the numbers that represent counting of objects: a number of molecules, a degree of degeneracy of the quantum level, and so on. The unit of these dimensionless quantities is also the dimensionless number one. However, this dimensionless number one is no longer a derived unit in the SI Brochure, but instead is treated as “*a further base unit*” [3]. Somehow, the words from Recommendation 1 of the CIPM of 1980 about the need to adhere to a rigid scheme with seven base units in SI were forgotten.

And finally, the third class of dimensionless quantities are the plane angle and the solid angle mentioned above. The following is said about them: “In a few cases, however, a special name is given to the unit one, in order to facilitate the identification of the quantity under consideration. This is the case with the radian and the steradian. The radian and the steradian have been identified by the CGPM as special names for the coherent derived unit one, to be used to express values of the plane angle and the solid angle, respectively, and are therefore included in Table 3<sup>2</sup>”.

---

<sup>1</sup>This circumstance provides an additional effective way to control the correctness of mathematical calculations. If the dimensions of individual terms in the equation under consideration turn out to be different, then somewhere earlier there was an error in the mathematical transformations.

<sup>2</sup>Coherent derived units with special names and symbols in the SI.

What is this non-dimensional number one, which is marked with two different names to distinguish what values it refers to? Indeed there are two different units of measurement of these quantities after all. Such interpretation of this text of the SI Brochure is in complete agreement with the fact that the plane and solid angles are quantities of different kinds and are measured in different units. There was no need to define them as dimensionless quantities, immediately introducing different units of their measurement, and without giving a practical definition for these units at that.

The definitions of the radian and the steradian as derived units in the SI Brochure [3] also have some internal contradiction. According to the definitions given there, the two derived units, the radian and the steradian, are expressed in terms of one base unit meter by the relations (1). If the usual rules of mathematics are applied in these formulas, then the meter is reduced in the numerator and denominator. As a consequence, the definitions of angle units will have no base units at all. And if an equation has no quantity, then nothing in this equation depends on the missing quantity.

As a result, the expressions (1) will not contain any of the seven base units of the SI. Therefore, they cannot be derived from these seven base units. That is, the derived units, the radian and the steradian, are determined neither through the base unit meter, nor through other base SI units. And this contradicts the basic concept of the coherent SI system, according to which all derived units are determined coherently through the base ones. So the assumption that the radian and the steradian (1) are derived from current base SI units contradicts itself.

Another problem connected with the change in the status of angles in the SI adopted in 1995 is the practical realization of the radian and the steradian based on their current definitions. It is still impossible to reproduce the radian and the steradian value in terms of the unit of length using only the definition of (1). An angle of 1 radian, obtained through dividing 1 meter by 1 meter cannot be drawn. There are no other definitions of the units of angles in the SI brochure.

In practice, the radian is determined using an old well-proved method, by constructing the central angle subtended by an arc that is equal in length to the radius. Another method is dividing the total plane angle into  $2\pi$  equal parts, where  $\pi$  is the known dimensionless irrational number. The unit of the degree is not so difficult to determine, it is an angle obtained by dividing the total plane angle into 360 equal parts. And the expression of 1 radian in degrees is:  $1 \text{ rad} = 57.2957795^\circ$ . It is these units which serve to measure of plane angles. But to measure an angle with a dimensionless number “one” is not possible. A dimensionless number is a mathematical concept, an abstraction.

We note here that in the draft of 9th edition of the SI Brochure, prepared for the 26 CGPM [6], an attempt was made to take this circumstance into account. The definitions of the radian and the steradian in that draft (Table 4. The 22 SI units with special names and symbols) remained the same as in the 8th edition - dimensionless number one. But the explanatory footnotes to these units are very different.

In the 8th edition of the SI Brochure in the footnote (b), relating to the radian and the steradian in Table 3 [3, P. 118], the following is written:

- (b) The radian and steradian are special names for the number one that may be used to convey information about the quantity concerned. In practice the symbols rad and

sr are used where appropriate, but the symbol for the derived unit one is generally omitted in specifying the values of dimensionless quantities.

In the draft of the 9th edition of the SI Brochure the footnotes (b) and (c), relating to the radian and the steradian in Table 4, [6, P. 21] define these units as follows:

- (b) The radian is the coherent unit for plane angle. One radian is the angle subtended at the centre of a circle by an arc that is equal in length to the radius. It is also the unit for phase angle. For periodic phenomena, the phase angle increases by  $2\pi$  rad in one period. The radian was formerly an SI supplementary unit, but this category was abolished in 1995.
- (c) The steradian is the coherent unit for solid angle. One steradian is the solid angle subtended at the centre of a sphere by an area of the surface that is equal to the squared radius. Like the radian, the steradian was formerly an SI supplementary unit.

These definitions clearly indicate that radians and steradians are not a dimensionless number one, but plane and solid angles of certain sizes.

Let us analyze the considerations underlying the 1995 SI reform. It can be seen from CIPM 1980 Recommendation 1 text that the main reasons for declaring angles as dimensionless derived quantities were:

1. The assertion that plane angle is expressed as the ratio of two lengths and solid angle is expressed as the ratio between an area and the square of the length.
2. The assertion that there are no formalisms containing plane and solid angles as base quantities, that are at the same time convenient and coherent, and that the present SI structure with seven base units is in fact the only possible coherent system.

Let us consider these assertions in more detail.

## **2 Analysis of justifications for transferring angles into the class of dimensionless derived quantities**

The first assertion is the only basis for transferring plane and solid angles into a class of dimensionless quantities. The second assertion serves to justify the declaration of both these angles as derived quantities. Let us consider the above stated assertions more closely.

In the second statement, it is not clear which scientific formalisms were studied and how. Why did the authors of the resolution consider the possibility of simultaneously assigning plane and solid angles to either base quantities or derived ones? And why is the structure with seven base quantities (and their units) considered the only possible? After all, there had been an experience of changing the structure of the SI by that time already. In 1971, there was a precedent of expanding a list of base units from six to seven units, when the amount-of-substance unit was introduced into the SI as the base one, and

not derived. And this neither caused any inconvenience of work, nor broke the coherence of the system of units. In the work [7], for example, a variant with eight base units is suggested, which in addition to the list of seven base units also included the radian.

The first statement is a bit inaccurate and needs to be considered more closely. We start with the plane angle. Let us try to examine what the formula, connecting an angle and two lengths expresses. To this end, we solve the problem of determining the length  $l$  of an arc of radius  $r$ , bounded by the central angle  $\varphi$ . Figure 1 shows the arc and the corresponding central angle. To solve this problem, the arc is supplemented to a circle of the same radius.

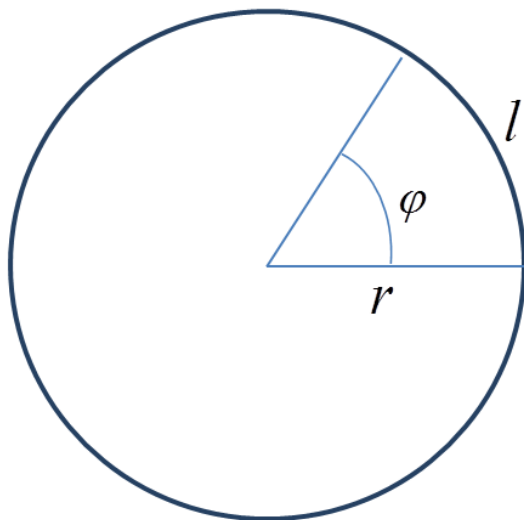


Figure 1: In addition to calculating an arc length of radius  $r$ , bounded by an angle  $\varphi$

It is can easily be seen that the ratio of the length  $l$  of the arc to the length of the entire circle  $2\pi r$  is equal to the ratio of the angle value  $\varphi$  to the total plane angle value, which we denote by  $\Phi$ . We can write this equation as

$$\frac{\varphi}{\Phi} = \frac{l}{2\pi r}. \quad (2)$$

In metrology, there is a special form of writing any quantity, proposed by Maxwell [8],  $\varphi = \{\varphi\}[\varphi]$ . Here  $[\varphi]$  is the unit of measurement for  $\varphi$ , and  $\{\varphi\}$  is the numerical value (dimensionless number) of  $\varphi$  measured in units of  $[\varphi]$ . Using this form of recording angles in the left-hand side of the equation (2), we can rewrite it as

$$\frac{\{\varphi\}[\varphi]}{\{\Phi\}[\varphi]} = \frac{l}{2\pi r}.$$

Here the units  $[\varphi]$  in the left-hand side of the equation are simplified leaving the ratio of the two dimensionless numbers. Rewriting the resulting equality, we shall have an expression for  $\{\varphi\}$

$$\{\varphi\} = \frac{\{\Phi\}}{2\pi} \cdot \frac{l}{r}. \quad (3)$$

Depending on the choice of the unit  $[\varphi]$ , the ratio will have a different form. If we measure angles in degrees, then  $[\varphi] = 1^\circ$ . In this case, the dimensionless number  $\{\Phi\}$  is equal to 360, and the formula (3) takes the form

$$\{\varphi\} = \frac{180}{\pi} \cdot \frac{l}{r}. \quad (4)$$

This coefficient  $180/\pi$  arises in mathematical calculations related to the angles and functions of them, violating the compactness of mathematical formulas. And performing many calculations, it will repeatedly occur making them too immense and cumbersome.

Mathematicians have devised a unit of measurement which simplifies formulas containing angles. If we choose such a unit of plane angle, which when using makes the dimensionless number  $\{\Phi\}$  equal to  $2\pi$ , then the expression (3) has this compact form<sup>3</sup>

$$\{\varphi\} = \frac{l}{r}. \quad (5)$$

The corresponding plane angle unit, ensuring the equality  $\{\Phi\} = 2\pi$ , is called the radian (symbol “rad”). And the radian itself is determined based on the condition that the total plane angle is equal to

$$\Phi = 2\pi \text{ rad}. \quad (6)$$

The expression (5) shows that the ratio of the two lengths determines not the quantity angle  $\varphi$ , but only its numerical value, measured in radians. This value  $\{\varphi\}$  is indeed a dimensionless number by definition. But, contrary to the statement in CIPM Recommendation 1 (1980), the expression (5) does not produce any restrictions on the dimension of the angle itself. As well as no other expressions are available, leading to a conclusion that the angles are dimensionless. So it is only needed to deduce and employ mathematical formulas correctly.

These arguments are also true for the solid angle  $\omega$ , for which it is easy to derive an expression similar to the relation (3) for a plane angle

$$\{\omega\} = \frac{\{\Omega\}}{4\pi} \cdot \frac{S}{r^2}, \quad (7)$$

where  $\{\omega\}$  – the numerical value of the solid angle under consideration in units of  $[\omega]$ ,  $\{\Omega\}$  – the numerical value of the full solid angle in the same units,  $S$  – the area of surface bounded by the solid angle  $\omega$  on a sphere of radius  $r$  centered at the angle vertex.

The unit of solid angle steradian (symbol “sr”) is chosen, by analogy with the unit of plane angle, so that the expression for the numerical value of the angle  $\{\omega\}$  has a compact form of a ratio of the area  $S$  to the squared radius  $r$ .

$$\{\omega\} = S/r^2 \quad \text{in the unit steradian}. \quad (8)$$

So the ratio of an area to the squared length determines not the solid angle  $\omega$  itself, but its numerical value  $\{\omega\}$ , measured in steradians. The steradian can be defined similarly to the radian by setting the value of the total solid angle

$$\Omega = 4\pi \text{ sr}. \quad (9)$$

---

<sup>3</sup>Formulas of the form (4) and (5) are given in the Mathematical Encyclopedia [9, p.15] in the article “Circle” to express the length of the arc through the radius and angle.

Neither physicists nor mathematicians are accustomed to use in mathematical calculations with angles the metrological notation of the form  $\varphi = \{\varphi\}[\varphi]$ . They just write  $\varphi$ , as in the argument of trigonometric functions, where this is really an angle, and in formulas of the form  $l = \varphi r$ , where they actually mean the numerical value  $\{\varphi\}$  of the angle  $\varphi$ , measured in radians. This is due to the fact that mathematicians work only in a radian measure, which is also typical for physicists in their theoretical calculations. And in that case the space of plane angle values can be one-to-one connected with the space of real (dimensionless) numbers, and all mathematical calculations with angles can be made in the same way as with dimensionless numbers. It is really convenient. However, this does not mean that angles become dimensionless quantities. If the angle is measured in degrees, then both mathematicians and physicists write  $\{\varphi\}^\circ$ , if it is measured in grads, then they write  $\{\varphi\}$  grad. If the angle is measured in radians, then they just write  $\{\varphi\}$ . Such recording means that the angle under consideration is equal to  $\{\varphi\}$  radians.

Let us note one more consideration which is related to the effects of the general relativity theory (GR). In GR, space is non-Euclidean, it is curved. Many formulas of Euclidean geometry become incorrect. In particular, even the refined relations (3) and (7) for the dimensionless numerical values of the angles are incorrect. In curved space, the length of the arc  $l(r, \varphi)$  will no longer be a linear function of the radius and the numerical value of the angle. But due to the fact that the GR space is locally flat, for small values of the radius  $r$  this deviation from linearity will be small. And the smaller the value of  $r$ , the more accurate are the expressions (3) and (7). In the limit  $r \rightarrow 0$ , these expressions become exact

$$\{\varphi\} = \lim_{r \rightarrow 0} \frac{\{\Phi\}}{2\pi} \frac{l}{r}, \quad \{\omega\} = \lim_{r \rightarrow 0} \frac{\{\Omega\}}{4\pi} \frac{S}{r^2}. \quad (10)$$

These expressions also indicate that the angles do not depend on the lengths. Moreover, definitions of the radian and the steradian in terms of the arc length and surface area in curved space become incorrect for finite values of  $r$ , while the ratios (6) and (9) do not depend on lengths at all.

In order to determine the status of plane and solid angles in the SI, it is necessary to investigate the geometric nature of these quantities and the relationship between them.

### 3 Analysis of the relationships between plane and solid angles and their units

First we shall consider the plane angle. It is defined as a geometric figure consisting of two different rays starting from a single point [10]. More specifically, the angle represents the entire area of the plane enclosed between these two rays. It is usually represented in the form shown in Figure 2. The rays OA and OB are called the sides of the angle, and their common origin O is called the vertex.

By definition, the sides of an angle are not finite segments of straight lines, but endless rays. They are depicted as finite segments of arbitrary length. The value of a plane angle is determined by the magnitude of the deviation of one ray from another when the vertex O is fixed. This deviation does not depend on the length of the sides of the angle. They can be increased, or reduced, or made of different lengths. The magnitude of deviation



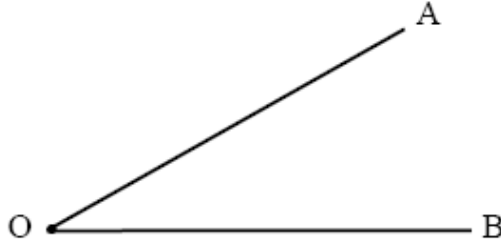


Figure 2: Plane angle

of the rays does not change in this case. And, therefore, the value of the angle does not change. In defining the angle no lengths are involved. Consequently, the value of the plane angle does not depend on the length, or any other SI quantities. This means that the value of a plane angle is not a derived quantity in the SI.

The feature of the plane angle to characterize the deviation of one ray from another is used in mathematics to build a polar coordinate system on a plane, as well as cylindrical, spherical, and other kinds of coordinate systems in three-dimensional space.

Let us now take the solid angle. In [10], the solid angle is defined as the part of space bounded by one cavity of a certain conical surface (see Figure 3). As in the case with the plane angle, the lengths of the rays that make up the conical surface of the solid angle are not limited. The spatial direction of these rays is of importance. In contrast to the plane angle, the solid angle cannot be defined on a plane. It is a three-dimensional object. The conical surface itself is a continuous closed set of rays emanating from the vertex of the solid angle.

It is almost obvious that the solid angle is formed from plane angles, like the area of any two-dimensional region in a plane is formed from straight line segments. To show this we construct Cartesian and spherical coordinate systems with their common origin at the vertex  $O$  of the solid angle, shown in Figure 3. Any point of three-dimensional space in the chosen coordinate system is represented by the vector  $\mathbf{r}$ , starting at the origin of coordinates and ending at this point. In the Cartesian coordinate system, the vector  $\mathbf{r}$  is defined by three coordinates  $(x, y, z)$ . In the spherical coordinate system, the same vector will be defined by the coordinates  $(r, \theta, \varphi)$ , where  $r$  is the length of the vector,  $\theta$  is the plane angle between the  $\mathbf{r}$  vector and the  $z$  axis,  $\varphi$  is the angle between the projected vector on the  $(x, y)$  plane and the  $x$  axis. The range of variables of the spherical coordinate system is defined by the expressions:  $0 \leq r < \infty$ ,  $0 \leq \varphi < \Phi$ ,  $0 \leq \theta \leq \Phi/2$ . Here we again use the notation  $\Phi$  for the value of a full plane angle.

The direction of any ray (if we just ignore its length) starting from the origin of coordinates is defined in the spherical coordinate system by two plane angles  $\theta$  and  $\varphi$ , as shown in Figure 3. For each value of the plane angle  $\varphi$ , the corresponding ray of the conical surface will form a certain plane angle  $\theta$  with the  $z$  axis. Changing the value of the angle  $\varphi$  from zero to  $\Phi$ , we get a set of plane angles that fill the entire solid angle under consideration. This process is completely analogous to the process of formation of

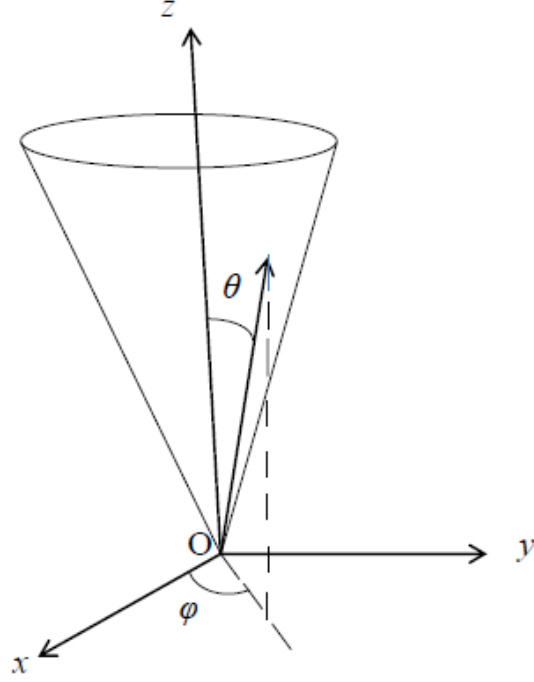


Figure 3: Solid angle and spherical coordinate system

a flat two-dimensional region by a set of straight line segments. This means that the solid angle is a derived quantity in the SI formed by plane angles, just as the area is a derived quantity formed by lengths. It follows thence that the coherent unit of the solid angle in the SI is  $\text{rad}^2$ . Further, the connection between it and the unit of solid angle steradian is described.

The whole set of directions of the rays defining the conical surface of the solid angle will be determined by the function  $\theta(\varphi)$ . The value of the solid angle  $\omega$  is obtained by integrating this function over the angle  $\varphi$  in the entire interval of its change

$$\omega = \int_0^{\Phi} \theta(\varphi) d\varphi.$$

Using this formula, we can find the value of the total solid angle. Let our function  $\theta(\varphi)$  be a constant  $\theta$ . The corresponding solid angle is a region of space inside a circular cone. The integral in the previous formula gives the value of the solid angle  $\omega = \Phi\theta$ . At  $\theta = 0$  (the conical surface degenerates into the axis  $Oz$ ), the corresponding solid angle will be zero. The total solid angle  $\Omega$  is obtained at the maximum value of the angle  $\theta = \Phi/2$

$$\Omega = \Phi^2/2. \quad (11)$$

The total solid angle in the SI coherent unit  $\text{rad}^2$  is

$$\Omega = 2\pi^2 \text{ rad}^2. \quad (12)$$

Comparing this expression with the formula (9), we obtain

$$1 \text{ sr} = (\pi/2) \text{ rad}^2. \quad (13)$$

This means that the steradian and the radian cannot be simultaneously equal to the dimensionless number one. Furthermore, this equality means that the steradian is not a coherent unit in the SI.

The SI definition of candela adopted as far back as 1948 was replaced in 1979 with a new definition, in which the unit of solid angle, the steradian, was included. At that time, the steradian belonged to the class of additional units, the status of which caused discussions. In 1995, the steradian was declared as a coherent dimensionless derived unit of solid angle. In spite of the transformation of the steradian, the candela remained in the list of the base SI units. It follows from the previous analysis, that the definition of candela contains an incoherent derived SI unit – the steradian.

In the draft of 9th edition of the SI Brochure, six base units are defined through a set of defining constants [6, P. 13-17], but the definition of the candela contains, in addition to the defining constants, also the derived unit – the steradian

$$1 \text{ cd} = 2,614830 \cdot 10^{10} \cdot (\Delta\nu_{Cs})^2 h K_{\text{cd}} \text{ sr}^{-1}, \quad (14)$$

where  $h$ ,  $\Delta\nu_{Cs}$ , and  $K_{\text{cd}}$  are defining constants for the base SI units, having the fixed values. In that draft the steradian is assumed to be equal to a dimensionless number one for that expression, and an expression that does not contain the steradian is obtained for candela

$$1 \text{ cd} = 2,614830 \cdot 10^{10} \cdot (\Delta\nu_{Cs})^2 h K_{\text{cd}} \quad (\text{in the New SI}). \quad (15)$$

These results produce a lot of questions. Does this candela correspond to its 1979 definition? Can we continue to consider the candela as a base and coherent SI unit? What about redefinitions of the base units, which include the candela defined in this way? Is the current list of base SI units complete? These questions require the thorough investigation.

## 4 Conclusion

The findings of the studies carried out in this paper are as follows.

1. The reasoning given in CIPM Recommendation 1 (1980) for transferring the plane and solid angles into the class of dimensionless derived quantities is unfounded.
2. The plane and solid angles are quantities of different kinds, having different geometric dimensions. And, consequently, they have different units of measurement, that do not coincide with the dimensionless number one.
3. The plane angle is a quantity independent of other SI quantities. It should be included, most likely, into the base quantities of the SI.
4. The units of the radian and the steradian can be determined by fixing the exact values of the total plane  $\Phi$  and solid  $\Omega$  angles:

- the radian is defined on the condition that the total plane angle is equal to  $\Phi = 2\pi$  rad,
  - the steradian is defined on the condition that the total solid angle is equal to  $\Omega = 4\pi$  sr.
5. The solid angle is a derived quantity in the SI. It is formed by a combination of plane angles. Its coherent unit is  $\text{rad}^2$ .
  6. The steradian is not a coherent SI unit. It is connected with the radian by the formula  $1 \text{ sr} = (\pi/2) \text{ rad}^2$ .
  7. In its current state, the International System of Units can hardly be considered as coherent and internally consistent system.
  8. Under these circumstances, the future revision of the SI, which is planned to be adopted at the 26th CGPM, seems to be untimely without first a thorough discussion of its current state.

## References

- [1] Resolution 12 of the 11th CGPM (1960).  
<https://www.bipm.org/en/CGPM/db/11/12/> .
- [2] Resolution 8 of the 20th CGPM (1995). <https://www.bipm.org/en/CGPM/db/20/8/>.
- [3] The International System of Units (SI-8). 8th edition, 2006.  
[https://www.bipm.org/utis/common/pdf/si\\_brochure\\_8\\_en.pdf](https://www.bipm.org/utis/common/pdf/si_brochure_8_en.pdf) .
- [4] 7<sup>e</sup> Session Comité Consultatif des Unités. 1980. Recommandation U 1. Unités supplémentaires radian et stéradian.  
<https://www.bipm.org/utis/common/pdf/CC/CCU/CCU7.pdf> .
- [5] CIPM, 1980: Recommendation 1. <https://www.bipm.org/en/CIPM/db/1980/1/> .
- [6] The International System of Units (SI) 9th ed. 2019 (Draft).  
<https://www.bipm.org/utis/en/pdf/si-revised-brochure/Draft-SI-Brochure-2018.pdf>
- [7] H. Wittmann. A New Approach to the Plane Angle. Metrologia, 1988, V. 25, No 4, P. 193-203.
- [8] J.C. Maxwell. Treatise on Electricity and Magnetism. Oxford, Oxford University Press, 1873.
- [9] Mathematical encyclopedia, Vol. 4. Moscow, Publishing house Sovetskaya encyclopedia, 1984, (in Russian).
- [10] Mathematical encyclopedia, Vol. 5. Moscow, Publishing house Sovetskaya encyclopedia, 1985, P. 326, (in Russian).