

Degrees of Freedom Analysis of Mechanisms using the New Zebra Crossing Method

Rajashekhar V S

Project Associate, Department of Aerospace Engineering, Indian Institute of Science - Bangalore, Karnata, India

Debasish Ghose

Professor, Department of Aerospace Engineering, Indian Institute of Science - Bangalore, Karnata, India

Abstract

Mobility, which is a basic property for a mechanism has to be analyzed to find the degrees of freedom. A quick method for calculation of degrees of freedom in a mechanism is proposed in this work. The mechanism is represented in a way that resembles a zebra crossing. An algorithm is proposed which is used to determine the mobility from the zebra crossing diagram. This algorithm takes into account the number of patches between the black patches, the number of joints attached to the fixed link and the number of loops in the mechanism. A number of cases have been discussed which fail to give the desired results using the widely used classical Kutzbach-Grubler formula.

Keywords: Mobility, Degrees of Freedom, Serial Mechanisms, Parallel Mechanism, Multiloop Mechanism, Planar Mechanism, Spatial Mechanism

1. Introduction

The degrees of freedom (DoF) or mobility calculation is an important property of mechanisms. It is defined by International Federation for the Promotion of Mechanism and Machine Science (IFToMM) as the number of independent coordinates needed to define the configuration of a kinematic chain or mechanism [1]. A literature review of the DoF works done in the past 150 years has been presented in [2]. The Chebychev-Grubler-Kutzbach criterion is widely used to determine the DoF of mechanisms. Many mechanisms do not obey the Chebychev-Grubler-Kutzbach criterion for calculating the DoF [3]. Quite often the classical quick formula fails to predict the correct number of DoF in modern mechanisms [4]. Therefore, there is a need to find a quick formula to find the DoF

of a mechanism that can be applied to modern multi-loop mechanisms, parallel manipulators, and other classical mechanisms which cannot otherwise be calculated using the existing quick methods.

The past two decades have seen mobility formulas being proposed for a particular family of mechanisms. It can be observed that the ways to determine the mobility of a mechanism can be broadly classified into three methods as mentioned in [5]. The most commonly used method is the quick formulas that takes into account the number of links, joints, loops and other parameters of the mechanism. The second method is finding the rank of the Jacobian matrix which gives the DoF of the mechanism. The third method is the usage of screw theory and other mathematical techniques. They fail to calculate the DoF of modern mechanisms such as the Cartesian Parallel Manipulator. A few of the works done in the past two decades are summerized here.

A formula [6] for DoF of parallel mechanisms and multiloop spatial mechanisms using vector algebra and theory of sets has been proposed. In [4] a method based on screw theory has been proposed to find the mobility of mechanisms. Lie algebra is used to determine the mobility criterion of parallel platforms in [7]. The mobility of spatial mechanisms is calculated by considering the polyhedral model [8]. Using the Jacobian matrices, the mobility of the parallel mechanisms can be found [9]. The DoF for complex spatial mechanisms is calculated by introducing a theory and the concept of configuration degrees of freedom [10]. Mobility of multi-loop mechanisms is found by a combination of bio-inspired cell division method and screw theories [11]. A mobility condition is obtained using Groebner basis which takes into account the dimensional and positional parameters of the links [12]. Similarly the effect of dimensions of links in a mechanism on the mobility is discussed in [13]. A constraint graph that allows representation of all the constraints which includes multiple joints is introduce in [14] from which the mobility can be determined. Mobility of overconstraint planar mechanisms are found faster and accurately in [15] by introducing new concepts and theories. The concept of generic mobility which takes into consideration the presence of link imperfection is introduced in [5]. The mobility in kinematic chains cannot be determined correctly using the velocity analysis but can be determined when combined with Lie algebra [16]. The dynamic models that were less used previously were used to establish the mobility criteria in multi-loop mechanisms [17]. A method to find the DoF of the mechanism by using the Macaulay matrices at a given configuration is proposed [18]. The deployable assembly mechanisms have modules that are identical. The concept of null space is used to find the mobility of such mechanisms [19]. Identification of redundant and passive mobilities using the intersection of screw manifolds in

parallel manipulators is proposed [20]. The complex ball mechanism is decomposed and analyzed using the screw system analysis [21]. A method for analyzing limited degrees of freedom parallel manipulators using geometric algebra is proposed in [22]. Mobility of overconstrained parallel mechanisms using Grassmann-Cayley algebra is given in [23]. The mobility of parallel manipulators can be calculated by analyzing the pattern of the transformation matrix [24]. Screw theory is used to find the mobility of single-loop mechanisms [25], parallel mechanisms [26], overconstrained parallel mechanisms [27], and spatial mechanisms [28]. The mobility of single-loop overconstrained mechanisms is calculated using Jacobian matrices [29]. The mobility is calculated by finding the rank of position and orientation characteristic equation of single loop mechanisms in [30].

It can be observed that many works have focused on screw theory [4, 20, 21, 25, 26, 27, 28] and on finding the rank of Jacobian matrices [9, 29] as a base for determining the DoF of mechanisms, while the quick methods have not received much attention in the past two decades. It can be noted that works have emerged taking into consideration the dimensions of the links [12, 13] for finding the DoF. The other areas of mathematics have been explored to find the DoF including vector algebra and theory of sets [6], Lie algebra [7, 16] and Grassmann-Cayley algebra [23]. Bio-inspired methods have also started to emerge [11].

The quick methods fail in certain cases where the mechanisms have loops. This failure of identifying the right degree of freedom is due to the inability to find the kinematically dependant loops in the mechanisms. A detailed explanation for this is given in [2]. Hence a detailed analysis is required for identifying the right degree of freedom. There are cases [31] where these methods also fail to give the right degree of freedom. The Zebra Crossing method (a quick method) proposed in this work provides the right degree of freedom even for mechanisms that get the wrong results using the formulas available in the literature.

2. The Zebra Crossing Algorithm

The zebra crossing algorithm helps in finding the degrees of freedom for a mechanism. The given mechanism is converted into a zebra crossing diagram consisting of black, white and grey patches. The degrees of freedom is found based on the number of loops in the mechanism and on counting the number of black, white, and grey patches. There are three formulas of which one is used to find the degrees of freedom of the mechanism.

2.1. The Zebra Crossing Diagram

The given mechanism is first converted into a Zebra Crossing diagram. The various elements of the Zebra Crossing diagram is shown in Figure 1. The link is represented as white patch as shown in Figure 1 (a). A one DoF joint is represented as a black patch in Figure 1 (b). A two DoF joint is represented as a black-grey-black patch as shown in Figure 1 (c). A three DoF joint is represented by a black-grey-black-grey-black patch as shown in Figure 1 (d). A binary link is represented by a black-white-black patch as shown in Figure 1 (e). The ternary and quaternary links are shown in Figure 1 (f) and (g).

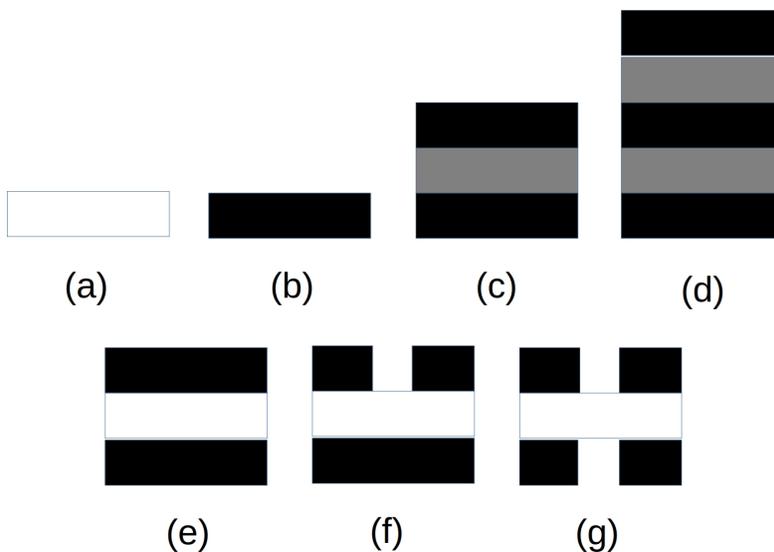


Figure 1: The elements of the Zebra Crossing diagram (a) A link (b) A 1-DoF joint (c) A 2-DoF joint (d) A 3-DoF joint (e) A binary link (f) A ternary link (g) A quaternary link

2.2. Analogy between mechanisms, graphs and zebra crossing algorithm

In [32], graph theory is used as a tool to represent mechanisms. A comparison is made here between the various parameters of a mechanism, graph theory, and the proposed Zebra Crossing method. The links in the mechanism is equivalent to the vertices of the graph and white patch in the zebra crossing. The joints in the mechanism is equivalent to the edges in the graph and black patch in the zebra crossing. The other parameters comparing the mechanism with the graph theory

and zebra crossing are listed in Table 1.

Table 1: A analogy between mechanisms, graphs, and zebra crossing method

Mechanism	Graph Theory	Zebra Crossing Method
Links	Vertices	White patch
Joints	Edges	Black Patch
Number of links having "i" joints	Number of vertices of degree "i"	Number of white patches connected to "i" black patches
Number of joints on link "i"	Degree of vertex "i"	Number of black patches connected to "i" white patches
Loops=Joints - Links + 1	Loops=Edges - Vertices + 1	Loops=Total Black Patches - Total White Patches + 1
Isomorphic mechanisms	Isomorphic graphs	Isomorphic zebra crossing

In [32], although graph theory is used in enumeration of the mechanisms, their degrees of freedom is calculated using the Kutzbach-Grubler formula. It can be seen that the number of loops are calculated by forming similar formulas from links and joints in graph theory and zebra crossing algorithm.

2.3. The zebra crossing algorithm

The zebra crossing algorithm is summerized in Figure 2. The algorithm is explained as follows.

Step 1: Design a mechanism by sketching clearly its links and joints.

Step 2: Represent it using zebra crossing diagram. The black and grey patches are used to represent the joints. The white patch is used to represent the links.

Step 3: Count the number of black, grey and white patches in the zebra crossing. Use Equation 1 to find the total number of loops in the mechanism.

$$L = B - (W + G) + 1 \quad (1)$$

where,

L = Number of loops in the mechanism

B = Number of black patches

W = Number of white patches

G = Number of grey patches

Step 4: If the number of loops are 0, then it is a open loop mechanism. The degrees of freedom equal the number of black patches in the zebra crossing diagram.

$$M = B \quad (2)$$

Step 5: If the number of loops are more than 0, then it is a closed loop mechanism. Find whether the mechanism can have a configuration where its links and joints lie on a plane.

Step 6: If the mechanism can be placed on a plane in atleast one configuration and has black, grey, and white patches use Equation 3 below to find its degrees of freedom.

$$M = N_s - (4 \times L) - J_f + 1 \quad (3)$$

where,

M = Degrees of freedom of the mechanism

N_s = Number of patches between the black patches

L = Number of loops in the mechanism

J_f = Number of joints attached to the ground link

Step 7: If the mechanism cannot be placed on a plane and has black, grey and white patches or only black and grey patches / if the mechanism is spatial in nature, use the Equation 4 to find its degree of freedom. If it is a parallel manipulator, then the white platform is treated as link. When counting the number of white patches, this white patch is assigned a number which is one less than the number of legs in the parallel manipulator.

$$M = N_w - L - J_f + 1 \quad (4)$$

where,

M = Degrees of freedom of the mechanism

N_w = Number of white patches between the black patches

L = Number of loops in the mechanism

J_f = Number of joints attached to the ground link

By following the above steps, the degrees of freedom can be obtained. These steps are written in the form of an algorithm as follows.

Algorithm 1 Zebra Crossing Algorithm

- 1: Design a mechanism based on the requirement and marks its links and joints clearly.
 - 2: Convert it into the Zebra Crossing diagram.
 - 3: Calculate the number of loops using the formula: $L = B - (W + G) + 1$
 - 4: **if** $L = 0$ **then**
 - 5: $M = B$
 - 6: **else if** the mechanism can be arranged in a plane and has black, grey and white patches in the Zebra Crossing diagram **then**
 - 7: $M = N_s - (4 \times L) - J_f + 1$
 - 8: **else if** the mechanism can be arranged in a Plane and has only Black and White patches in the Zebra Crossing diagram **then**
 - 9: $M = N_w - L - J_f + 1$
 - 10: **else**
 - 11: the mechanism cannot be arranged in a Plane
 - 12: $M = N_w - L - J_f + 1$
 - 13: **end if**
-

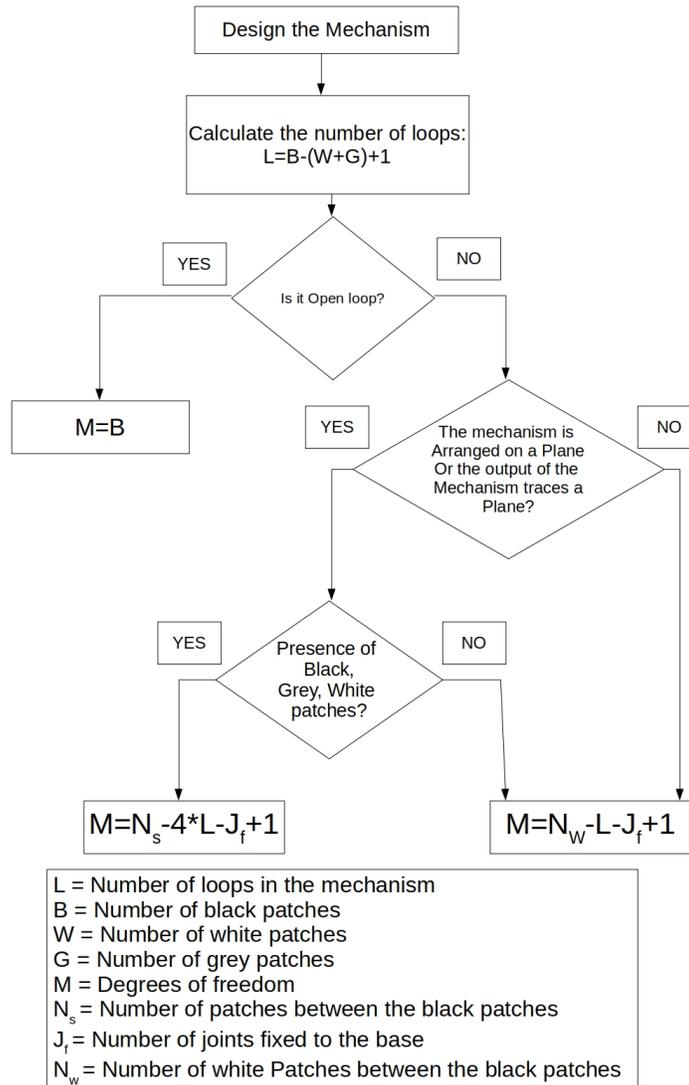


Figure 2: The zebra crossing algorithm

3. Examples

3.1. Open loop mechanisms

3.1.1. One DOF Helical Joint Mechanism

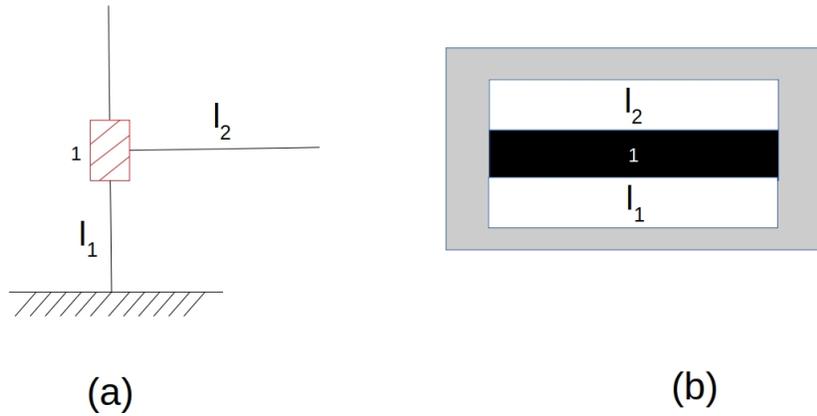


Figure 3: The zebra crossing algorithm applied to the one DOF helical joint mechanism (a) The one DOF helical joint mechanism (b) The zebra crossing diagram of the mechanism

One DOF helical joint mechanism is a simple mechanism with two links connected by a helical joint. This is shown in Figure 3 (a). The Zebra crossing diagram of the mechanism is drawn as follows. The joint attached to the ground link is represented as a black patch (1). Then the link (l_2) is represented as a white patch (l_2). Since there are no joints attached to the link (l_2), the fixed link (l_1) is represented by a white patch (l_1) below the black patch. This completes the Zebra crossing diagram and is shown in Figure 3 (b).

From the Zebra Crossing diagram, the number of loops in the mechanism are calculated using the Equation 1. There is 1 black patch and 2 white patches in the zebra crossing diagram. Therefore,

$$L = 1 - 2 + 1 = 0 \quad (5)$$

The number of loops in the mechanism is found to be 0. Hence it is an open loop mechanism. Calculating the degrees of freedom from Equation 2,

$$M = 1 \quad (6)$$

Therefore the mechanism has 1 degree of freedom. The above steps can be followed to find the degrees of freedom in open loop mechanisms.

3.2. Closed loop mechanisms

3.2.1. Planar mechanisms

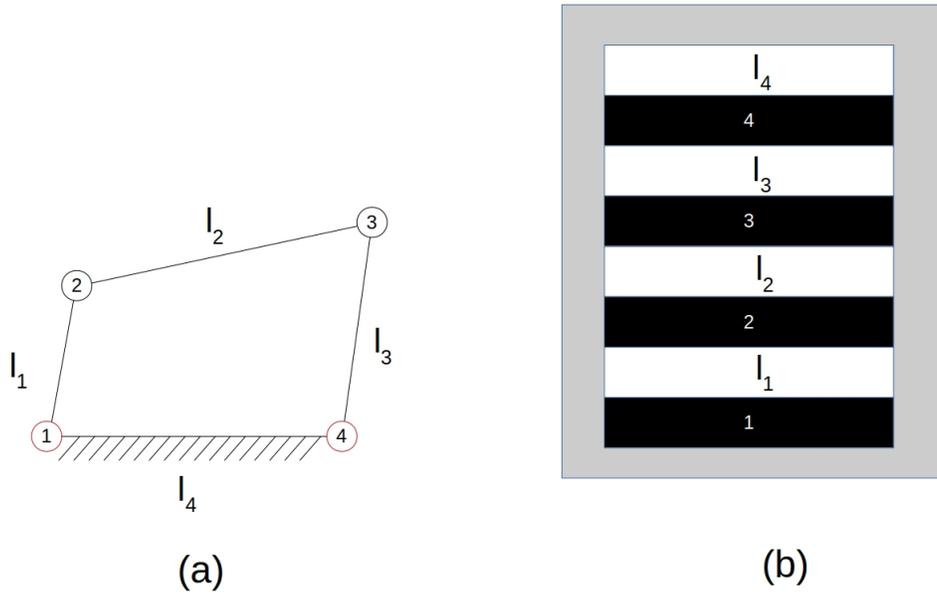


Figure 4: The zebra crossing algorithm applied to the four bar mechanism (a) The four bar mechanism (b) The zebra crossing diagram of the mechanism

Four-Bar Mechanism. The four bar mechanism is shown in Figure 4 (a). The Zebra crossing diagram is drawn by considering the joint 1 which connects the link (l_4) and link (l_1). It is represented by the black patch 1 in 4 (b). The link (l_1) is represented by a white patch (l_1) above the black patch 1. Similar steps are followed to draw the complete Zebra crossing diagram.

There are 4 black patches and 4 white patches in the Zebra crossing diagram. Applying Equation 1, the number of loops in the mechanism are

$$L = 4 - 4 + 1 = 1 \tag{7}$$

The number of white patches between the black patches N_w are 3. The number of loops L is 1. The number of joints attached to the ground link J_f are 2. The degrees of freedom is calculated using the Equation 4,

$$M = 3 - 1 - 2 + 1 = 1 \quad (8)$$

Therefore the mechanism has 1 degree of freedom.

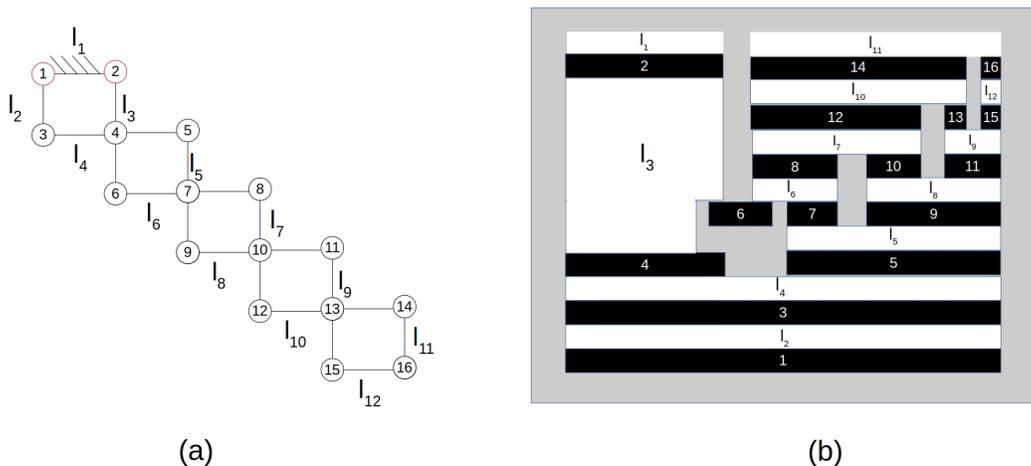


Figure 5: The zebra crossing algorithm applied to the staircase mechanism (a) The staircase mechanism (b) The zebra crossing diagram of the mechanism

Staircase Mechanism. The staircase mechanism is shown in Figure 5 (a). The Zebra crossing diagram is drawn (in Figure 5 (b)) by representing the joint 1 (which is connected to the base) as the black patch 1. The link (l_2) is a binary link represented as a white patch (l_2). The joint 3 connects the link (l_2) and (l_4). It is represented by the black patch 3. The link (l_4) is a ternary link since it has three joints (joint 3, 4 and 5) connected to it. The link (l_4) is represented by a white patch (l_4). The joints 4 and 5 present in the link (l_4) which are represented by two black patches 4 and 5. The next ternary link (l_3) is represented as a white patch (l_3) and has joints 2 and 6 attached to it by black patches 2 and 6 respectively. In the similar way, the ternary links l_6 , l_8 , l_7 , l_9 and l_{10} are represented by white patches. The links l_{11} and l_{12} are binary in nature. The

fixed link l_1 is represented as a white patch l_1 above the black patch 2 (joint 2). The other end of the link l_1 is left open.

There are 16 black patches and 12 white patches. The number of loops in the mechanism are found using the Equation 1, which is

$$L = 16 - 12 + 1 = 5 \quad (9)$$

The number of white patches between the black patches N_w are 7. The number of loops L are 5. The number of joints attached to the ground link J_f are 2. The degrees of freedom is calculated using the Equation 4,

$$M = 7 - 5 - 2 + 1 = 1 \quad (10)$$

Therefore the mechanism has 1 degree of freedom.

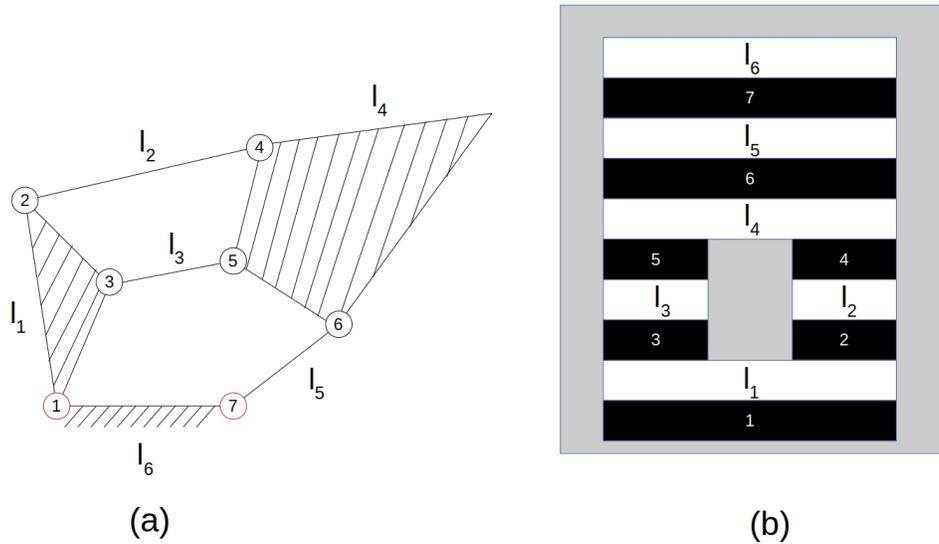


Figure 6: The zebra crossing algorithm applied to the six-bar mechanism (a) The six-bar mechanism (b) The zebra crossing diagram of the mechanism

Six-Bar Mechanism. The six-bar mechanism is shown in Figure 6 (a). The mechanism has 6 links and 7 joints. The zebra crossing diagram for this mechanism is shown in Figure 6 (b). It starts with

the black patch 1 which represents the joint 1 in the mechanism. Then the link l_1 in the mechanism is represented by a white patch l_1 . It can be found in the Figure 6 (a) that the joints 2 and 3 are attached to the link l_1 . In the zebra crossing diagram these joints are represented by the black patches 3 and 4. Then the links l_2 and l_3 are connected to the link l_4 by joints 4 and 5 respectively. These joints are represented by the black patches 4 and 5 in the zebra crossing diagram. The link l_4 is represented by a white patch l_4 . The joint 6, which is represented by the black patch 6 connects the link l_4 and l_5 . Then the joint 7 which is represented by black patch 7 connects the link l_5 with l_6 .

There are 7 black patches and 6 white patches in the zebra crossing diagram. The number of loops in the mechanism are found out using the Equation 1. The number of loops are,

$$L = 7 - 6 + 1 = 2 \quad (11)$$

The number of white patches between the black patches N_w are 4. The number of loops L are 2. The number of joints attached to the ground link J_f are 2. The degrees of freedom is calculated using the Equation 4,

$$M = 4 - 2 - 2 + 1 = 1 \quad (12)$$

Therefore the mechanism has 1 degree of freedom.

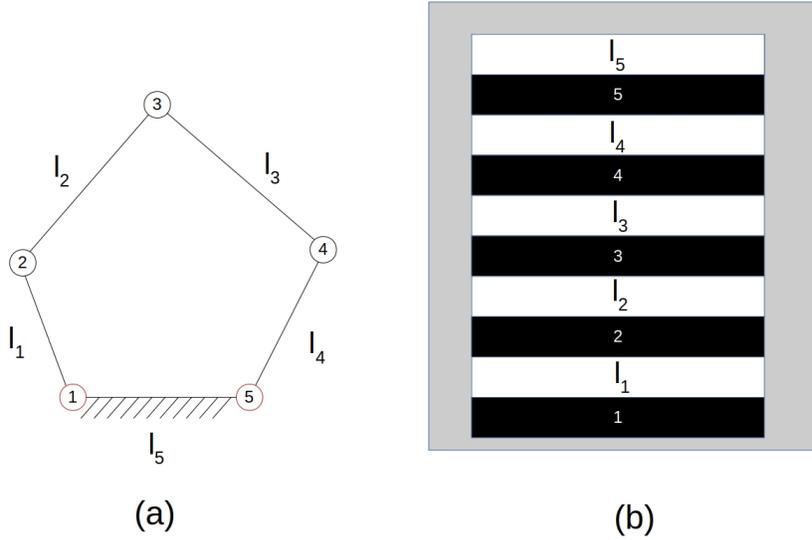


Figure 7: The zebra crossing algorithm applied to the five-bar mechanism (a) The five bar mechanism (b) The zebra crossing diagram of the mechanism

Five-Bar Mechanism. The five-bar mechanism is shown in Figure 7 (a). The Zebra crossing diagram for this mechanism is shown in 7 (b). The steps involved in drawing the Zebra crossing diagram are similar to that of the four bar mechanism. In this case an additional link and joint are added.

There are 5 black patches and 5 white patches in the zebra crossing diagram. The number of loops in the mechanism are found out using the Equation 1. The number of loops are,

$$L = 5 - 5 + 1 = 1 \quad (13)$$

The number of white patches between the black patches N_w are 4. The number of loops L is 1. The number of joints attached to the ground link J_f are 2. The degrees of freedom is calculated using the Equation 4,

$$M = 4 - 1 - 2 + 1 = 2 \quad (14)$$

Therefore the mechanism has 2 degrees of freedom.

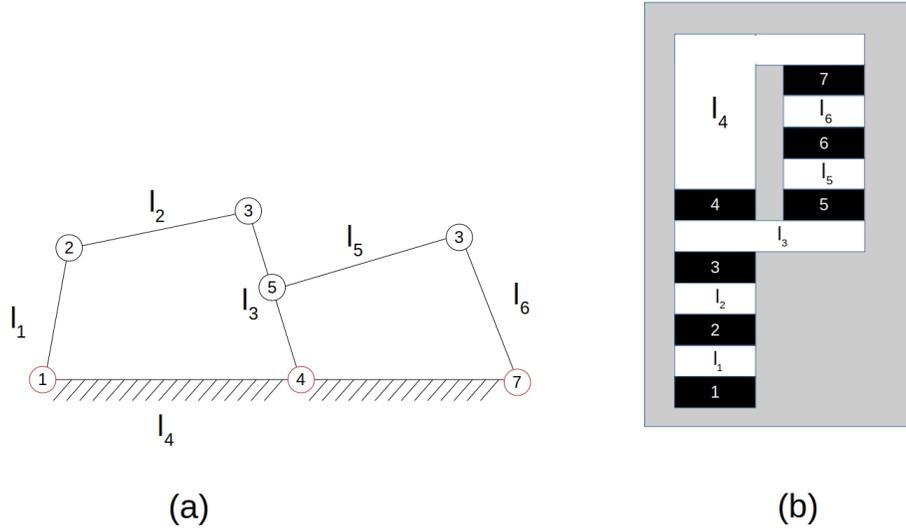


Figure 8: The zebra crossing algorithm applied to the four-bar mechanism in series (a) The four-bar mechanism in series (b) The zebra crossing diagram of the mechanism

Four-Bar Mechanism in Series. The four-bar mechanism in series is shown in Figure 8 (a). The Zebra crossing diagram for this mechanism is shown in Figure 8 (b). The steps followed are similar to that of a four bar mechanism but the link l_3 is ternary in nature.

There are 7 black patches and 6 white patches in the zebra crossing diagram. The number of loops in the mechanism are found out using the Equation 1. The number of loops are,

$$L = 7 - 6 + 1 = 2 \quad (15)$$

The number of white patches between the black patches N_w are 5. The number of loops L are 2. The number of joints attached to the ground link J_f are 3. The degrees of freedom is calculated using the Equation 4,

$$M = 5 - 2 - 3 + 1 = 1 \quad (16)$$

Therefore the mechanism has 1 degree of freedom.

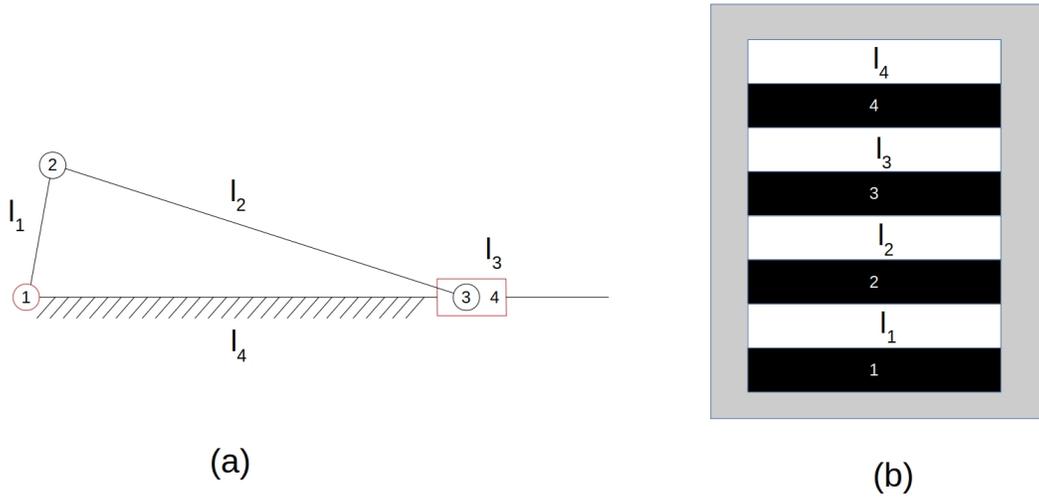


Figure 9: The zebra crossing algorithm applied to the crank and slider mechanism (a) The crank and slider mechanism (b) The zebra crossing diagram of the mechanism

Crank and Slider Mechanism. The crank and slider mechanism is shown in Figure 9 (a). This mechanism has 4 links and 4 joints. The number of revolute joints are 3 and prismatic joint is 1. The zebra crossing diagram for this mechanism is shown in Figure 9 (b). The steps involved in drawing the zebra crossing diagram is similar to that of the four bar mechanism.

There are 4 black patches and 4 white patches in the zebra crossing diagram. The number of loops in the mechanism are found out using the Equation 1. The number of loops are,

$$L = 4 - 4 + 1 = 1 \quad (17)$$

The number of white patches between the black patches N_w are 3. The number of loops L is 1. The number of joints attached to the ground link J_f are 2. The degrees of freedom is calculated using the Equation 4,

$$M = 3 - 1 - 2 + 1 = 1 \quad (18)$$

Therefore the mechanism has 1 degree of freedom.

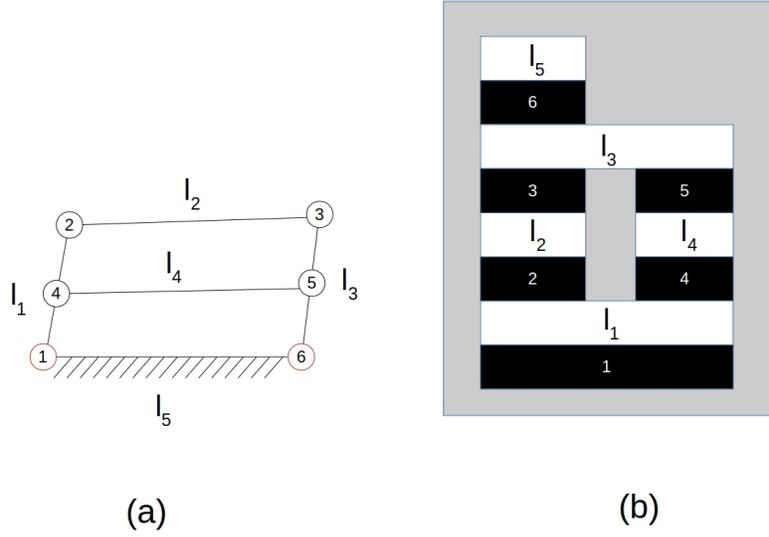


Figure 10: The zebra crossing algorithm applied to the four-bar mechanism in parallel (a) The four-bar mechanism in parallel (b) The zebra crossing diagram of the mechanism

Four-bar Mechanism in Parallel. The four-bar mechanism in parallel is shown in Figure 10 (a). The Zebra crossing diagram is shown in Figure 10 (b). The steps involved in drawing the Zebra crossing diagram are similar to that of the six bar mechanism. The degree of freedom for this mechanism depends on the length of the links l_2 , l_4 and l_5 . There are two cases which arises based on the length of the mechanism.

Case 1: The links l_2 , l_4 and l_5 are of same length.

There are 6 black patches and 5 white patches in the zebra crossing diagram. The number of loops in the mechanism are found out using the Equation 1. The number of loops are,

$$L = 6 - 5 + 1 = 2 \quad (19)$$

The number of white patches between the black patches N_w are 4. The number of loops L is 2. The number of joints attached to the ground link J_f are 2. The degrees of freedom is calculated using the Equation 4. Calculating the degrees of freedom,

$$M = 4 - 2 - 2 + 1 = 1 \quad (20)$$

Therefore the mechanism has 1 degree of freedom.

Case 2: The links l_2 , l_4 and l_5 are of different lengths.

There are 6 black patches and 5 white patches in the zebra crossing diagram. The number of loops in the mechanism are found out using the Equation 1. The number of loops are,

$$L = 6 - 5 + 1 = 2 \quad (21)$$

The number of white patches between the black patches N_w are 3 (the links l_2 and l_4 are treated as one white patch). The number of loops L are 2. The number of joints attached to the ground link J_f are 2. The degrees of freedom is calculated using the Equation 4. Calculating the degrees of freedom,

$$M = 3 - 2 - 2 + 1 = 0 \quad (22)$$

Therefore the mechanism has 0 degree of freedom.

Calculating the degrees of freedom based on the lengths of the links (as done above) will be explained in detail in our future works.

3.2.2. Spatial mechanisms

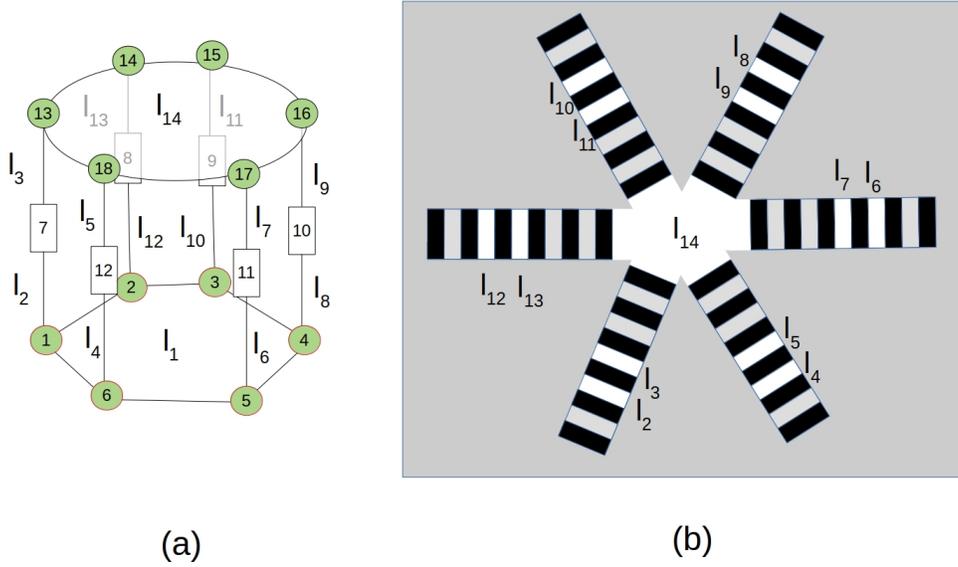


Figure 11: The zebra crossing algorithm applied to the Stewart platform (a) The Stewart platform (b) The zebra crossing diagram of the mechanism

Stewart Platform. The Stewart platform is shown in Figure 11 (a). The link l_1 is the fixed link and the link l_{14} is the moving platform. There are 6 legs which connect the fixed link to the moving platform. To draw the Zebra crossing diagram for this mechanism, one of the legs is considered. The joint 1 connects the fixed link to the link l_2 . This joint has 2 degrees of freedom. Hence it is represented by a black patch followed by a grey patch and a black patch. The link l_2 is represented by a white patch. The joint 7 is a prismatic joint (1-DoF joint) which connects the link l_2 and l_3 . This is represented by a black patch above the link l_2 . It is followed by the white patch which represents the link l_3 . This link connects to the moving platform l_{14} through a spherical joint. The spherical joint is represented by patches as shown in Figure 1 (d). Similarly the other legs are connected to the moving platform l_{14} from the fixed link l_1 .

There are 46 black patches and 37 white and grey patches in the zebra crossing diagram. The number of loops in the mechanism are found out using the Equation 1. The number of loops are,

$$L = 42 - 37 + 1 = 6 \quad (23)$$

The number of white patches between the black patches N_w are 17 (the number of white patches between the black patches in the legs are 12 and for the link l_{14} , the white patch is assigned a number which is one less than the number of legs in the parallel manipulator, which is 5). The number of loops L are 6. The number of joints attached to the ground link J_f are 6. The degrees of freedom is calculated using the Equation 4. Calculating the degrees of freedom,

$$M = 17 - 6 - 6 + 1 = 6 \quad (24)$$

Therefore the mechanism has 6 degrees of freedom.

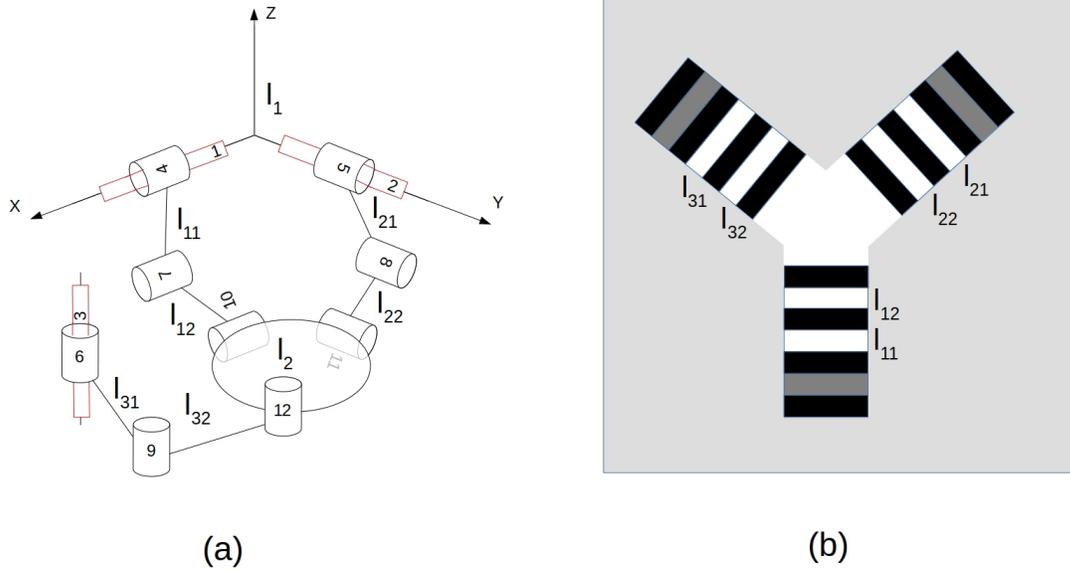


Figure 12: The zebra crossing algorithm applied to the cartesian parallel manipulator (a) The cartesian parallel manipulator (b) The zebra crossing diagram of the mechanism

Cartesian Parallel Manipulator. The cartesian parallel manipulator is shown in Figure 12 (a). The link l_1 is the fixed link and the link l_2 is the moving platform. They are connected by three legs. The Zebra crossing diagram is shown in Figure 12 (b). The joints 1 and 4 are represented by a black, grey and black patch. These are followed by the link l_{11} (which is a white patch) and a revolute joint 7 which is a black patch. The link l_{12} is represented as a white patch above the black patch 7. The link l_{12} is connected to the platform l_2 by a joint 10 (black patch). This completes the drawing of a leg of the manipulator. Similarly, the other legs of the manipulator is converted in to a Zebra crossing diagram.

There are 12 black patches and 10 white and grey patches in the zebra crossing diagram. The number of loops in the mechanism are found out using the Equation 1. The number of loops are,

$$L = 12 - 10 + 1 = 3 \quad (25)$$

The number of white patches between the black patches N_w are 8 (the number of white patches

between the black patches in the legs are 6 and for the link l_2 , the white patch is assigned a number which is one less than the number of legs in the parallel manipulator, which is 2). The number of loops L are 3. The number of joints attached to the ground link J_f are 3. The degrees of freedom is calculated using the Equation 4. Calculating the degrees of freedom,

$$M = 8 - 3 - 3 + 1 = 3 \quad (26)$$

Therefore the mechanism has 3 degrees of freedom.

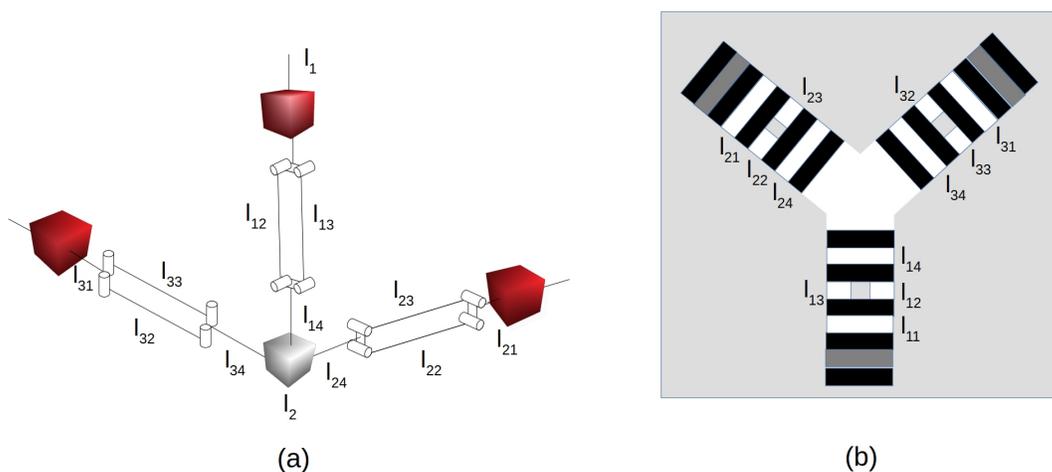


Figure 13: The zebra crossing algorithm applied to the orthoglide manipulator (a) The orthoglide manipulator (b) The zebra crossing diagram of the mechanism

Orthoglide Manipulator. The orthoglide manipulator is shown in Figure 13 (a). The link l_1 is the fixed link and the link l_2 is the moving platform. There are three legs which connect the fixed link and the moving platform. The Zebra crossing diagram is drawn as follows. A two degree of freedom joint connects the fixed link and with link l_{21} by a black, grey and black patch. Then the link l_{21} (ternary link) is represented by a white patch l_{21} . The other end of the white patch is connected to two joints which is represented by two black patches. On each black patch, a white patch is drawn which represents the links l_{22} and l_{23} . These white patches are connected to the white patch l_{24} by two joints. The white patch l_{24} is connected to the moving platform l_2 by a joint which is represented by a black patch.

There are 21 black patches and 16 white and grey patches in the zebra crossing diagram. The number of loops in the mechanism are found out using the Equation 1. The number of loops are,

$$L = 21 - 16 + 1 = 6 \quad (27)$$

The number of white patches between the black patches N_w are 11 (the number of white patches between the black patches in the legs are 9 and for the link l_2 , the white patch is assigned a number which is one less than the number of legs in the parallel manipulator, which is 2). The number of loops L are 6. The number of joints attached to the ground link J_f are 3. The degrees of freedom is calculated using the Equation 4. Calculating the degrees of freedom,

$$M = 11 - 6 - 3 + 1 = 3 \quad (28)$$

Therefore the mechanism has 3 degrees of freedom.

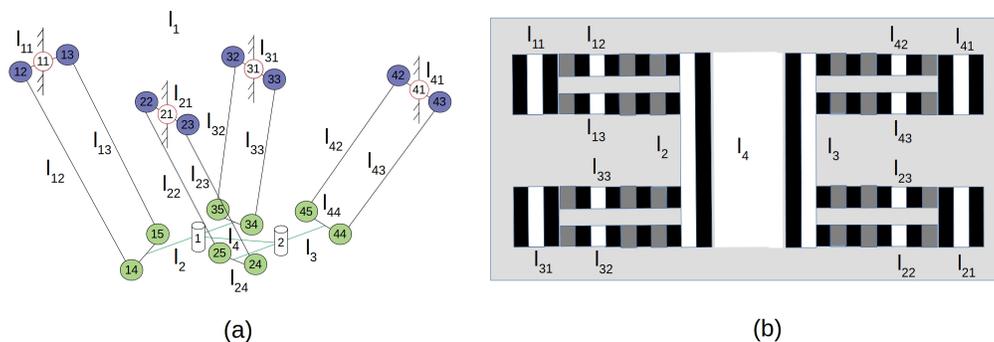


Figure 14: The zebra crossing algorithm applied to the H4 parallel manipulator (a) The H4 parallel manipulator (b) The zebra crossing diagram of the mechanism

H4 Parallel Manipulator. The H4 Parallel Manipulator is shown in Figure 14 (a). This manipulator has a fixed link l_1 and a moving platform l_4 . It has four legs which connect the fixed link and the moving platform. The Zebra crossing diagram is drawn as follows. The joint 11 which is attached to the fixed link is represented by a black patch. The link l_{11} is a ternary link which has joints 11, 12 and 13 connected to it. It is represented by a white patch l_{11} . The two degrees of freedom joints 12 and 13 are drawn above the white patch l_{11} by a black, grey and black patch. A white patch

STAR Manipulator. The STAR manipulator is shown in Figure 15 (a). The link l_1 is the fixed link and the link l_2 is the moving platform. The link l_1 is connected to the link l_2 through three legs. The Zebra crossing diagram for this manipulator is shown in Figure 15 (b). The cylindrical joint 11 is represented as black, grey and black patch. The joints 12 and 13 are attached to the joint 11. This is represented by two grey and black patches above the joint 11. The links l_{11} and l_{12} are represented by white patches l_{11} and l_{12} above the black patches. The joints 14 and 15 are represented by black patches above the white patches l_{11} and l_{12} . The link l_{13} is a ternary link which is represented by the white patch l_{13} . This connects to the link l_2 by a joint which is represented by a black patch. This completes the representation of a leg in the mechanism. Similarly the other two legs are represented in Zebra crossing diagram.

There are 21 black patches and 16 white and grey patches in the zebra crossing diagram. The number of loops in the mechanism are found out using the Equation 1. The number of loops are,

$$L = 21 - 16 + 1 = 6 \quad (31)$$

The number of white patches between the black patches N_w are 11 (the number of white patches between the black patches in the legs are 9 and for the link l_2 , the white patch is assigned a number which is one less than the number of legs in the parallel manipulator, which is 2). The number of loops L are 6. The number of joints attached to the ground link J_f are 3. The degrees of freedom is calculated using the Equation 4.

$$M = 11 - 6 - 3 + 1 = 3 \quad (32)$$

Therefore the mechanism has 3 degrees of freedom.

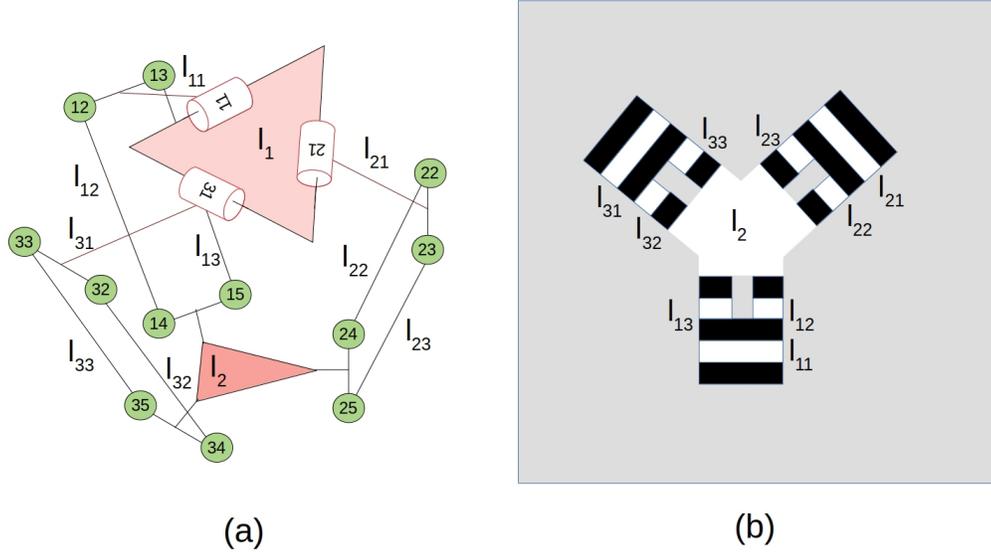


Figure 16: The zebra crossing algorithm applied to the DELTA manipulator (a) The DELTA manipulator (b) The zebra crossing diagram of the mechanism

DELTA Manipulator. The DELTA manipulator is shown in Figure 16 (a). The link l_1 is fixed and the link l_2 is the moving platform. There are three legs which connect the fixed link to the moving platform. The Zebra crossing diagram for this mechanism is shown in Figure 16 (b). It is drawn by taking the joint 11 as a black patch. The link l_{11} is represented as white patch above the black patch. This link is ternary in nature since there are 3 joints (joint 11, 12 and 13) connected with it. Hence there are two black patches above the white patch l_{11} . These black patches represent the joints 12 and 13. There are two white patches (l_{12} and l_{13}) attached to the two black patches. There is a black patch attached to each of the white patches and inturn they are attached to the link l_2 which is the moving platform. Similarly the other two legs are drawn.

There are 15 black patches and 10 white patches in the zebra crossing diagram. The number of loops in the mechanism are found out using the Equation 1. The number of loops are,

$$L = 15 - 10 + 1 = 6 \quad (33)$$

The number of white patches between the black patches N_w are 11 (the number of white patches between the black patches in the legs are 6 and for the link l_2 , the white patch is assigned a number

which is one less than the number of legs in the parallel manipulator, which is 5). The number of loops L are 6. The number of joints attached to the ground link J_f are 6. The degrees of freedom is calculated using the Equation 4.

$$M = 11 - 6 - 3 + 1 = 3 \quad (34)$$

Therefore the mechanism has 3 degrees of freedom.

4. A comparison the Zebra Crossing Method with other quick methods

In [2], details about the existing methods in the literature for calculating degrees of freedom of mechanisms are given. We compare the results of Zebra Crossing Method with the quick methods mentioned in it for the mechanisms analysed above. It is given in the Figure 17. It can be seen in the Figure 17 that applying the quick methods for planar mechanisms gives the right degrees of freedom for most of the cases. But considering the spatial mechanisms, especially the modern parallel manipulators, the quick methods fail to give the right degrees of freedom. The reason for this is the inability to find the kinematically dependant loops in the mechanisms. A detailed explanation for this is given in [2].

The proposed Zebra crossing method can be applied to planar and spatial mechanisms. The Stewart platform, Cartesian Parallel manipulator, Orthoglide manipulator and the STAR manipulator are a few modern manipulators. Most of the quick methods that exist in the literature are either not applicable or give wrong results for these modern mechanisms. But when the Zebra crossing method is applied to these modern mechanisms, we obtain the right degrees of freedom.

5. Conclusions

A new method to find the degees of freedom for a mechanism is proposed in this work. It is called the zebra crossing method. The designed mechanism is converted into a zebra crossing diagram. The number of loops are calculated. Based on the number of loops and the nature of the mechanism, a suitable formula for calculating degrees of freedom is chosen. The degrees of freedom of the mechanism is calculated using it. To the best of authors knowledge, this quick method can be applied to any mechanism. About 14 mechanisms of which a few of them whose degrees of freedom can not be found using the methods existing in the literature can be found using the zebra crossing method. Thus this zebra crossing method provides accurate results.

Names of Contributors	Condition/Formula	Mechanism Applicable	Planar Mechanism							Spatial Mechanism							
			4 Bar	Staircase	6 bar	5 bar	4 bar in series	Crank and slider	4 bar parallel	1-DoF Helical Link	Stewart platform	CPM	Orthoglide	H4	STAR	DELTA	
Chebichev's contribution	Formula	Planar mechanisms with 1 DoF	YES	YES	YES	YES	YES	NO	YES	NO	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Sivester's contribution	Condition	1 DoF pin-connected planar mechanisms	YES	YES	YES	N/A	YES	NO	NO	NO	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Grubler's contribution	Condition	1 DoF pin-connected planar mechanisms	YES	YES	YES	N/A	YES	NO	NO	NO	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Grubler's contribution	Condition	1 DoF spatial complex mechanisms with helical joints	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Somov's contribution	Condition	1 DoF planar and spatial mechanisms	YES	YES	YES	YES	YES	YES	NO	NO	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Hochmann's contribution	Condition	1 DoF mechanisms	YES	YES	YES	N/A	YES	YES	NO	NO	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Somov-Maiyashvili's formula	Formula	Spatial mechanisms	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Koenigs' formula	Formula	Spatial mechanisms	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Kutzbach's mobility equation	Formula	Planar and spatial mechanisms	YES	YES	YES	YES	YES	YES	NO	NO	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Dobrovolski's mobility equation	Formula	Planar and spatial mechanisms	YES	YES	YES	YES	YES	YES	NO	NO	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Koichin's mobility equation	Formula	Planar and spatial mechanisms	YES	YES	YES	YES	YES	YES	NO	NO	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Rosser's contribution	Formula	Spatial mechanisms	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Boden's mobility equation	Formula	Spatial mechanisms	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Manatu's formula	Formula	Complex Kinematic Chain	N/A	YES	YES	N/A	YES	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Ozol's formula	Formula	Spatial mechanisms	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Contribution of Waldron	Formula	Single loop mechanisms	YES	N/A	N/A	YES	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Contribution of Manolescu	Formula	Spatial mechanisms	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Contribution of Bagci	Formula	Loop mechanisms	YES	YES	YES	YES	YES	YES	NO	NO	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Contribution of Antonescu	Formula	Planar and spatial mechanisms	YES	YES	YES	YES	YES	YES	NO	NO	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Hunt's contribution	Formula	Planar and spatial mechanisms	YES	YES	YES	YES	YES	YES	NO	NO	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Hunt's contribution	Formula	Planar and spatial mechanisms	YES	YES	YES	YES	YES	YES	NO	NO	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Hunt's contribution	Formula	Planar and spatial mechanisms	YES	YES	YES	YES	YES	YES	NO	NO	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Gronowicz's contribution	Formula	Planar and spatial mechanisms	N/A	YES	YES	N/A	YES	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Contribution of Ajlraawi and Rao	Formula	Complex Kinematic Chain	N/A	YES	YES	N/A	YES	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Contribution of Durr's R and Diaconescu	Formula	Simple and Complex Kinematic Chain	N/A	YES	YES	N/A	YES	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Contribution of Durr's R and Diaconescu	Formula	Simple and Complex Kinematic Chain	N/A	YES	YES	N/A	YES	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Contribution of Durr's R and Diaconescu	Formula	Simple and Complex Kinematic Chain	N/A	YES	YES	N/A	YES	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
McCarthy's formula	Formula	Planar and spatial mechanisms	YES	YES	YES	YES	YES	YES	NO	NO	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Contribution of Huang, Kong and Fang	Formula	Platform is connected to the ground by serial chains	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Contribution of Huang, Kong and Fang	Formula	Platform is connected to the ground by serial chains	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Contribution of Huang, Kong and Fang	Formula	Platform is connected to the ground by serial chains	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Contribution of Huang, Kong and Fang	Formula	Platform is connected to the ground by serial chains	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Zebra Crossing Method	Formula	Planar and spatial mechanisms	YES	YES	YES	YES	YES	YES	YES	YES	YES	YES	YES	YES	YES	YES	YES

Figure 17: The zebra crossing algorithm compared with the other methods in the literature

References

References

- [1] G. Bgelsack, Terminology for the theory of machines and mechanisms, *Mech. Mach. Theor.* 26 (5) (1983) 435–539.
- [2] G. Gogu, Mobility of mechanisms: a critical review, *Mechanism and machine Theory* 40 (9) (2005) 1068–1097.
- [3] J.-P. Merlet, *Parallel robots*, Vol. 128, Springer Science & Business Media, 2006.
- [4] Z. Huang, J. Liu, D. Zeng, A general methodology for mobility analysis of mechanisms based on constraint screw theory, *Science in China Series E: Technological Sciences* 52 (5) (2009) 1337–1347.
- [5] A. Müller, Generic mobility of rigid body mechanisms, *Mechanism and Machine Theory* 44 (6) (2009) 1240–1255.
- [6] T.-L. Yang, D.-J. Sun, A general degree of freedom formula for parallel mechanisms and multiloop spatial mechanisms, *Journal of Mechanisms and Robotics* 4 (1).
- [7] J. Rico, L. Aguilera, J. Gallardo, R. Rodriguez, H. Orozco, J. Barrera, A more general mobility criterion for parallel platforms, in: *International Design Engineering Technical Conferences and Computers and Information in Engineering Conference*, Vol. 46954, 2004, pp. 163–184.
- [8] C. Wampler, B. T. Larson, A. G. Erdman, A new mobility formula for spatial mechanisms, in: *International Design Engineering Technical Conferences and Computers and Information in Engineering Conference*, Vol. 48094, 2007, pp. 561–570.
- [9] D.-C. Yang, J. Xiong, X.-D. Yang, A simple method to calculate mobility with jacobian, *Mechanism and machine theory* 43 (9) (2008) 1175–1185.
- [10] J.-S. Zhao, K. Zhou, Z.-J. Feng, A theory of degrees of freedom for mechanisms, *Mechanism and Machine Theory* 39 (6) (2004) 621–643.
- [11] C. Li, H. Guo, D. Tang, R. Liu, Z. Deng, X. Song, S. I. Zahin, Cell division method for mobility analysis of multi-loop mechanisms, *Mechanism and Machine Theory* 141 (2019) 67–94.

- [12] J.-F. Rameau, P. Serré, Computing mobility condition using groebner basis, *Mechanism and Machine Theory* 91 (2015) 21–38.
- [13] J.-F. Rameau, P. Serré, Dimensional perturbation of rigidity and mobility, *Computer-Aided Design* 71 (2016) 1–14.
- [14] A. Müller, O. Shai, Constraint graphs for combinatorial mobility determination, *Mechanism and Machine Theory* 108 (2017) 260–275.
- [15] D. Zeng, W. Lu, Z. Huang, Determination of overconstraint and mobility analysis for planar mechanisms, *Proceedings of the Institution of Mechanical Engineers, Part C: Journal of Mechanical Engineering Science* 230 (20) (2016) 3743–3754.
- [16] J. Rico, J. Cervantes, A. Tadeo, J. Gallardo, L. Aguilera, C. Diez, Infinitesimal kinematics methods in the mobility determination of kinematic chains, in: *International Design Engineering Technical Conferences and Computers and Information in Engineering Conference*, Vol. 49040, 2009, pp. 1195–1204.
- [17] D. Talaba, Mechanical models and the mobility of robots and mechanisms., *Robotica* 33 (1) (2015) 181–193.
- [18] C. W. Wampler, J. D. Hauenstein, A. J. Sommese, Mechanism mobility and a local dimension test, *Mechanism and machine theory* 46 (9) (2011) 1193–1206.
- [19] Y. Yang, X. Ding, W. Zhang, Mobility analysis for deployable assemblies of mechanisms based on nullspace, in: *Advances in Reconfigurable Mechanisms and Robots II*, Springer, 2016, pp. 1049–1059.
- [20] W. Bu, S. Yan, J. Chen, X. An, Mobility analysis for parallel manipulators based on intersection of screw manifolds, *Journal of Mechanical Science and Technology* 30 (9) (2016) 4345–4352.
- [21] J. S. Dai, D. Li, Q. Zhang, G. Jin, Mobility analysis of a complex structured ball based on mechanism decomposition and equivalent screw system analysis, *Mechanism and Machine Theory* 39 (4) (2004) 445–458.
- [22] Q. Li, X. Chai, J. Xiang, Mobility analysis of limited-degrees-of-freedom parallel mechanisms in the framework of geometric algebra, *Journal of Mechanisms and Robotics* 8 (4).

- [23] X. Chai, Q. Li, W. Ye, Mobility analysis of overconstrained parallel mechanism using grassmann-cayley algebra, *Applied Mathematical Modelling* 51 (2017) 643–654.
- [24] C. Chen, Mobility analysis of parallel manipulators and pattern of transform matrix, *Journal of Mechanisms and Robotics* 2 (4).
- [25] P. Milenkovic, Mobility of single-loop kinematic mechanisms under differential displacement, *Journal of Mechanical Design* 132 (4).
- [26] L. Wang, H. Xu, L. Guan, Mobility analysis of parallel mechanisms based on screw theory and mechanism topology, *Advances in Mechanical Engineering* 7 (11) (2015) 1687814015610467.
- [27] J. S. Dai, Z. Huang, H. Lipkin, Mobility of overconstrained parallel mechanisms.
- [28] D. Zeng, W. Lu, Z. Huang, Over-constraint and a unified mobility method for general spatial mechanisms part 1: Essential principle, *Chinese Journal of Mechanical Engineering* 28 (5) (2015) 869–877.
- [29] J. Rico, B. Ravani, On calculating the degrees of freedom or mobility of overconstrained linkages: single-loop exceptional linkages.
- [30] T.-L. Yang, D.-J. Sun, Rank and mobility of single loop kinematic chains, in: *International Design Engineering Technical Conferences and Computers and Information in Engineering Conference*, Vol. 43260, 2008, pp. 1369–1378.
- [31] F. Freudenstein, R. Alizade, On the degree of freedom of mechanisms with variable general constraint, in: *Proceedings Fourth World Congress on the Theory of Machines and Mechanisms*, 1975, pp. 51–56.
- [32] L.-W. Tsai, *Mechanism design: enumeration of kinematic structures according to function*, CRC press, 2000.