A Change-Point Based Control Chart for Detecting Sparse Changes in High-Dimensional Heteroscedastic Data

Zezhong Wang 1,* and Inez Maria Zwetsloot 1

¹Department of Systems Engineering and Engineering Management, City University of Hong Kong, Tat Chee Avenue, Kowloon, Hong Kong *Corresponding author: Zezhong Wang, zezhowang3-c@my.cityu.edu.hk

January 26, 2021

Total Words:4226

A Change-Point Based Control Chart for Detecting Sparse Changes in

High-Dimensional Heteroscedastic Data

Abstract

Because of the curse-of-dimensionality, high-dimensional processes present challenges to

traditional multivariate statistical process monitoring (SPM) techniques. In addition, the

unknown underlying distribution and complicated dependency among variables such as

heteroscedasticity increase uncertainty of estimated parameters, and decrease the effective-

ness of control charts. In addition, the requirement of sufficient reference samples limits

the application of traditional charts in high dimension low sample size scenarios (small n,

large p). More difficulties appear in detecting and diagnosing abnormal behaviors that are

caused by a small set of variables, i.e., sparse changes. In this article, we propose a change-

point based control chart to detect sparse shifts in the mean vector of high-dimensional

heteroscedastic processes. Our proposed method can start monitoring when the number

of observations is a lot smaller than the dimensionality. The simulation results show its

robustness to nonnormality and heteroscedasticity. A real data example is used to illustrate

the effectiveness of the proposed control chart in high-dimensional applications. Supple-

mentary material and code are provided online.

Key Words: Statistical process monitoring (SPM); High-dimensional control chart; Change-

point; Sparse changes; Heteroscedasticity; Moving window

2

1. Introduction

In modern manufacturing systems, widely used sensor and internet technologies make it possible to collect hundreds of measurements related to the final product and its production over time. These measurements can be used to determine whether the process' performance is under control or whether corrective action is needed. Statistical process monitoring (SPM) tools for high-dimensional data are becoming popular for such applications.

Detecting abnormality from high-dimensional data is a challenging task. Traditional multivariate control charts, such as the Hotelling's T^2 control chart and the MEWMA chart, are popular in monitoring multiple variables simultaneously. However, they are challenged by the "curse-of-dimensionality" which affects parameter estimates and signal detection ability significantly (Hastie et al., 2009).

The accuracy of parameter estimates is an important factor of control charts' performances, but the uncertainty of estimates, especially of the estimated covariance matrix, grows rapidly with dimensionality (Zhang et al., 2020). In conventional monitoring schemes, large amounts of in-control (IC) data are needed for getting reliable parameter estimates before monitoring can start (Zamba and Hawkins, 2006). One popular way to avoid directly estimating the convariance matrix is projecting the variables into a lower dimensional subspace by principal components analysis (PCA), and then monitoring the PCA scores. De Ketelaere et al. (2015) give an overview of PCA-based high-dimensional process monitoring techniques.

PCA-based methods are generally designed under the assumption that the process follows a multivariate normal distribution, this assumption is violated in many high-dimensional processes applications (Zhang et al., 2020). The underlying distribution is usually unknown and challenging to verify. This situation inspires the development of non-parametric control charts, such as the spatial sign based method proposed by Zou and Tsung (2011).

One drawback of the nonparametric method is that it requires sufficient IC observations to estimate various parameters which affect the performance of control charts (Zou and Tsung, 2011; Zou et al., 2012; Holland and Hawkins, 2014). They can not be directly applied in high dimension low sample size (HDLSS) scenarios where the number of variables is much greater than the number of individual observations (p > n), this is also referred to as short-run processes. Change-point based control charts have better performances in this scenario (Li et al., 2014).

It is rare that all variables change simultaneously in a process, a small subset of variables are more likely to cause the abnormality. Under this sparsity assumption, the out-of-control (OC) signals can be easily buried in the noise of numerous variables (Shu and Fan, 2018). Sparsity also increases the difficulty to locate and identify assignable causes among variables (Wang and Jiang, 2009).

One overlooked character in SPM solutions for high-dimensional data is heteroscedasticity (Hong et al., 2018). A straightforward definition of heteroscedasticity is the inequality of error variance (Downs and Rocke, 1979). This character is deeply discussed in financial and economic fields, and is treated as a set of variances to be modeled (Engle, 2001). It is rarely considered in manufacturing industries thought it would affect the accuracy of parameters estimate. Consequently, the performances of control charts are fallible.

To overcome the three mentioned challenges of monitoring high-dimensional processes, 1) the HDLSS problem makes parameter estimation impossible, 2) sparsity of the change, and 3) heteroscedasticity in the data, we propose a change-point based control chart for detecting sparse mean shifts in high-dimensional heteroscedastic data. The change-point methods allow us to deal naturally with the first challenge. We apply a supremum-based test to deal with the second and third challenges. The proposed method can start monitoring when the sample size is much smaller than the dimension $(p \gg n)$. Another attraction is that this method is robust to both nonnormality and heteroscedasticity. We also propose a post-signal diagnosis method to estimate the change-point and assignable causes. Simulation and comparison results show that the proposed method has good performance in detecting large and sparse shifts from high-dimensional heteroscedastic data streams. Application of the methods is illustrated by a real-data example.

The structure of this article is as follows. Section 2 is a review of the related litera-

ture. In Section 3, we propose our novel change-point based control chart for detecting sparse shifts in the mean vector of possibly heteroscedastic non-normal data. Section 4 shows the performance of the proposed method. In Section 5, we propose a post-signal diagnosis procedure. Section 6 discusses a comparison with another method. In Section 7, a manufacturing process example is used to showcase the proposed method. Section 8 concludes.

2. Related Work

Quite some research has been done to adapt classical SPM methods to high-dimensional monitoring problems. Combining dimensionality reduction techniques with control charts is one alternative to efficiently detect sparse changes in the high-dimensional setting. Wang and Jiang (2009), Zou and Qiu (2009), Zou et al. (2011), Capizzi and Masarotto (2011), Jiang et al. (2012), and Abdella et al. (2017) applied different penalized likelihood-based variable selection algorithms, such as LASSO, to screen out suspicious variables that possibly make the process deviate from its normal stage. Next, conventional control charts are applied to the selected variables.

These above discussed methods are efficient under the assumption of normal distributed data, which is usually violated. Nonparametric methods are developed to fill this gap. Zou et al. (2015) proposed an online monitoring scheme based on a goodness-of-fit (GOF) test for monitoring nonnormal and i.i.d. observations. Shu and Fan (2018) proposed a distribution-free control chart by adapting a Minkowski distance based test.

The sparsity also increases the difficulty for signal diagnosis, one benefit of variable-selection algorithm is that the tasks of monitoring and diagnosis are naturally integrated and conveniently solved simultaneously (Jiang et al., 2012). In Zhang et al. (2020), they proposed a square-root LASSO based diagnosis framework. An effective tool to locate the occurrence time of changes in data sequences is change-point estimate, it has been widely used in univariate, multivariate, and profile monitoring problems. Amiri and Allahyari (2012) reviewed the applications of change-point estimation techniques in process

monitoring systematically. This type of method not only supports practitioners to identify assignable causes but also shows robustness to nonnormality. Therefore, change-point based methods are potentially useful in monitoring high-dimensional data streams.

Zou et al. (2011) estimated the change-point in post-signal diagnosis phase. Li et al. (2014); Huang et al. (2014); Chen et al. (2016) also proposed change-point based control charts. The first one is developed from a two-sample location test proposed by Chen et al. (2010), which is a sum-of-square type test. It is more efficient in monitoring dense shifts. Huang et al. (2014) proposed a novel Reproducing Kernel Hilbert Space (RKHS)-based control chart which is robust to nonnormality and is able to detect a wide range of process changes include the sparse changes. The method proposed by Chen et al. (2016) is developed from Bickel (1969), and only dense scenarios are considered in the simulation part. One more attraction of the above change-point based schemes is that they are capable of starting monitoring with a small set of observations.

The heteroscedasticity has been well studied in financial data. This type of data can be modeled by autoregressive conditional heteroscedastic (ARCH) models (Engle, 1982) or generalized autoregressive conditional heteroskedastic (GARCH) models (Bollerslev, 1986). To monitor for shifts in heteroscedastic data, Schipper and Schmid (2001) and Bodnar (2009) proposed control charts based on univariate and multivariate GARCH models respectively. Both methods used the same strategy that is monitoring the fitting errors between the target process and the observed process. It is challenging to apply the same strategy to high-dimensional scenarios, because of the computational complexity (Frisén, 2008). Another alternative strategy for monitoring heteroscedastic data is using methods that are robust to inconsistent covariance matrices.

The above literature offers solutions for either sparse changes in normal data or HDLSS methods for dense changes or method focused on heteroscedasticity. No method is able to do it all. Our objective is to develop a method to detect sparse changes in heteroscedastic and possibly non-normal data in the HDLSS scenarios. We will adapt the two-sample hypothesis tests of high-dimensional means proposed by Chang et al. (2017) to process monitoring in Section 3, because it allows for different covariance matrices between two

samples.

3. Change-Point Based Control Chart

In this section we introduce our proposed method.

3.1. Change-Point Based Monitoring Scheme

Given a series of independent and individual p-dimensional observations $\mathbf{X}_i = (X_{i1}, X_{i2}, ..., X_{ip})'$, i = 1, 2, ..., n, which follow a multivariate normal distribution, the change-point model is

$$H_0: \mathbf{X}_i \sim N_p(\boldsymbol{\mu}_0, \boldsymbol{\Sigma}_0)$$
 and $H_1: \mathbf{X}_i \sim \begin{cases} N_p(\boldsymbol{\mu}_0, \boldsymbol{\Sigma}_0), & i \leq \tau \\ N_p(\boldsymbol{\mu}_1, \boldsymbol{\Sigma}_1), & i > \tau, \end{cases}$ (1)

where μ_0 , μ_1 , Σ_0 , and Σ_1 are the unknown IC and OC mean vectors and covariance matrices. The change-point τ , which indicates that the process changes after X_{τ} , is also unknown and needs to be estimated. If only a mean shift occurs, Σ_0 is equal to Σ_1 in Equation (1).

Various high-dimensional hypothesis tests for the shifts in locations have been proposed, see, for example, Randles (2000); Zhang (2002); Chen et al. (2010); Saha et al. (2017). These tests have been integrated into process monitoring tools that were reviewed in Sections 1 and 2. High-dimensional test statistics can be categorized as sum-of-squares-based test statistic (Chen et al., 2010), and supremum-based test statistic (Randles, 2000). The former is powerful when there are many small differences between μ_0 and μ_1 , in other words, the signals are dense but weak. However, this type of method could be ineffective under sparsity assumption, where the accumulation of all differences will not be greatly influenced by a few large differences especially in a big data stream. For the case that a few variables have large shifts, the signals are sparse but strong, a supremum-based test statistic should have better performance (Gregory et al., 2015).

Our proposed control chart for detecting sparse mean shifts is based on the supremum-

based-test statistics proposed by Chang et al. (2017). Chang et al. (2017) proposed four tests. The first two are supremum-based test based on a non-studentized test statistics and a studentized test statistic. The second two use the same two test statistics and add an initial screening step to reduce the dimension of the data. In this paper we focus on the non-studentized method without screening. We have also implemented our proposed methods using the studentized test statistics and discovered it shows inferior performance in all experiments. The detailed results of the studentized test statistics are therefor only reported in the supplementary material.

To test for H_0 vs. H_1 in Equation (1), we partition the n observations into two sets, $\{X_1, ..., X_k\}$ and $\{X_{k+1}, ..., X_n\}$ at a split point k ($3 \le k \le n-3$). Each subset contains at least 3 observations in order to calculate the sample means and variances. Therefore this methods can start monitoring with at least 6 observations which is appropriate for monitoring short-run processes. As in Chang et al. (2017), the non-studentized statistics (NS) with n observations and split point k are as follows,

$$T_{n,k}^{NS} = \max_{1 \le r \le p} \frac{\sqrt{k(n-k)}|\bar{X}_{k,r} - \bar{X}_{n-k,r}|}{\sqrt{n}},\tag{2}$$

where $\bar{X}_{k,r}$ and $\bar{X}_{n-k,r}$ are the means of the rth variable (X_r) in the pre-shift sample and post-shift sample respectively. The monitoring statistic at time point n, referred as U_n^{NS} , is the maximum value of $T_{n,k}^{NS}$ over all split points k,

$$U_n^{NS} = \max_{3 \le k \le n-3} T_{n,k}^{NS}. \tag{3}$$

The change-point τ can be estimated directly by the corresponding k when U_n^{NS} exceeds the control limits:

$$\hat{\tau}_n^{NS} = \arg_k \max_{3 \le k \le n-3} (T_{n,k}^{NS}). \tag{4}$$

Though Chang et al. (2017) present mathematical expressions for the critical values, they still use a fully data driven bootstrap method to estimate them. Therefore, we also use the same strategy to determine the control limits based on a predefined *False Alarm*

Probability (FAP).

3.2. Moving Window

Note that for progressive monitors our statistic will be based on larger and larger samples (i.e. n increases with time). The efficiency of detecting sparse shifts decreases with the sample size (n), because the signals are more likely to be buried by the noises. Another practical problem of our method is that the time and complexity of data processing multiply with incoming observations, because n-5 iterations are needed to compute the control statistic from n observations. A third issue is that the statistic is influenced by the sample size, and therefore, the control limits are dynamic. To reduce the detection delay and promote the sensitivity of the proposed monitoring scheme, we add a moving window to the proposed method.

For a fixed window size W, the monitoring procedure starts with the first W observations $(\boldsymbol{X}_1,...,\boldsymbol{X}_W)$. After collecting s new observations, s is the step size, it excludes the oldest s observations and moves to the second window $(\boldsymbol{X}_{1+s},...,\boldsymbol{X}_{W+s})$. An appropriate step size can speed up the computation and reduce the serial correlation, making the monitoring statistics become approximately independent. The observation matrix at time point n (n > W) is $\mathbb{X}_n = (\boldsymbol{X}_{n-W+1}, \boldsymbol{X}_{n-W+2}, ..., \boldsymbol{X}_n)$. The window-based non-studentized statistics are

$$T_{n,W,k^*}^{NS} = \max_{1 \le r \le p} \frac{\sqrt{k^*(W-k^*)}|\bar{X}_{k^*,r} - \bar{X}_{W-k^*,r}|}{\sqrt{W}}, \tag{5}$$

where k^* ($3 \le k^* \le W - 3$) is the split point inside the current window, and $\bar{X}_{k^*,r}$ is the mean of first k^* observations in window W_n . The corresponding charting statistic based on this window is

$$U_{n,W}^{NS} = \max_{3 \le k^* \le W-3} T_{n,W,k^*}^{NS}.$$
 (6)

Note that we observe $U_{n,W}^{NS}$ each s time only. Estimating the change-point is also straightforward, if the control chart signals at time point n, the corresponding change-

point estimate is

$$\hat{\tau}_{n,W}^{NS} = n - W + \arg_{k^*} \max_{3 \le k^* \le W - 3} T_{n,W,k^*}^{NS}. \tag{7}$$

The statistic depends on the window size, which is a pre-specified fixed value. Consequently, the control limits are a constant value and they need to be simulated for different dimensionality and window sizes. Our method, referred by NS_W , signals when $U_{n,W}^{NS} > h_{p,W}$, where $h_{p,W}$ is the control limit.

3.3. Control Limits

In this paper, the control limits are determined by prespecifying the FAP instead of the ARL, because the ARL is affected by the window size and autocorrelation. Moreover, simulation for ARLs is more time consuming. We define the FAP as the probability of at lease one false alarm in the process in time 1 to n (Chakraborti et al., 2008). We use a bootstrap method to get the control limits with a predefined $FAP = \alpha$, as defined in Algorithm 1.

Step 1. Import B, n, W, s, and \mathbb{X}_p . Where B is the number of bootstrap samples, n is the monitoring interval, W is the window size and s is the step size.

Step 2. Draw B bootstrap samples of size W with replacement from \mathbb{X}_p .

Step 3. Use Equation 6 to calculate the charting statistics $U_{W,W}^{NS,b}$, b=1,2,...B for every bootstrap sample.

Step 4. Find the control limits as the $(1-\alpha)^Q$ empirical quantile from the pooled $U^{NS,b}_{W,W},\ b=1,2,....B$ respectively with $Q=\frac{1}{\max\{z\in\mathbb{Z}|z\leq(\frac{n-W}{s})\}+1}$.

Algorithm 1: Bootstrap method for control limits

Step 4 in Algorithm 1 is valid because appropriate step sizes can make the sequential $U_{n,W}^{NS}$ series an approximately independent process. Figure 1 shows the autocorrelation of $U_{n,W}^{NS}$ with s=1, 3, 5, and W=20. When s=5, the autocorrelation is small for all lags.

In this paper, we set $\alpha = 0.01$, B = 10000, n = 100, W = 20, 30, 40, s = 5, and \mathbb{X}_p is drawn from a p-dimensional normal distribution. All codes for calculating the statistics,

control limits and performances analysis are available on GitHub (https://github.com/wyfwzz/Supplementary-code-for-A-change-point-based-control-chart...-).

4. Performance Study

4.1. Experiments

To evaluate the OC performances of the proposed NS_W method, we use simulation experiments. In these experiments, we vary the underlying distribution, dimensionality, window size, shift size, sparsity level and change-point. The detailed settings are as follow:

- 1. Models: the IC process follows a p-dimension standardized normal distribution $N_p(\mathbf{0}, \mathbf{I}_p)$.

 To test the robustness to heteroscedasticity, correlation, and nonnormality, we design four OC models, where for each model $\{\mathbf{X}_i\}_{i=1}^{\tau} \sim N_p(\mathbf{0}, \mathbf{I}_p)$ and
 - Model I: $\{X_i\}_{i=\tau+1}^n \sim N_p(\boldsymbol{\mu}_1, \boldsymbol{I}_p)$. This model is the baseline model which only involves a change in the mean vector;
 - Model II: $\{X_i\}_{i=\tau+1}^n \sim N_p(\boldsymbol{\mu}_1, \lambda_t \boldsymbol{I})$, where λ_t controls the change of variance and is set equal to $\{0.5, 0.6, ..., 0.9, 1, 0.9, ..., 0.6\}$ which is repeated until n. This model is used to simulate heteroscedasticity, after τ , the variances vary with time;
 - Model III: $\{X_i\}_{i=\tau+1}^n \sim N_p(\boldsymbol{\mu}_1, \boldsymbol{\Sigma}_1)$, where $\boldsymbol{\Sigma}_1 = (\sigma_{l,m})_{(1 \leq l, m \leq p)}$, and $\sigma_{l,m} = 0.995^{|l-m|}$. This model incorporates the dependency among variables;
 - Model IV: $\{X_i\}_{i=\tau+1}^n \sim t_{p,30}(\boldsymbol{\mu}_1, \boldsymbol{\Sigma}_1)$, where $\boldsymbol{\Sigma}_1 = (\sigma_{l,m})_{(1 \leq l,m \leq p)}$, and $\sigma_{l,m} = 0.995^{|l-m|}$. This model is designed for testing the robustness to nonnormality;
- 2. Dimensionality: p = 20, 50, 100;
- 3. Window size: W = 20, 30, 40;
- 4. Change point: $\tau = 10, 25, 50;$

- 5. Sparsity level (the percentage of OC variables): v = 10%, 25%, which means the first $v \times p$ variables change simultaneously after τ ;
- 6. Shifts size: $\delta = 0.5$, 1, 1.5, 2, so that $\mu_1 = (\delta_{vp}, \mathbf{0}_{p-vp})$, where δ_{vp} is a $v \times p$ size vector with values of δ and $\mathbf{0}_{p-vp}$ is a $p-v \times p$ size vector with values of 0.

4.2. Performance Metrics

We run R=1000 simulation runs for every scenario to test the performance of the proposed method. In every simulation run, the monitoring procedure will stop once a signal is detected or when we run out of the predefined process with n=100 observations. The proportion of runs that are stopped by a signal to all runs represents the detecting power of the proposed method. This metric is called the *Detection Rate (DR)*, where $DR = \frac{\sum_{j=1}^{R} I(U_{n,W}^{NS,j} > h_{p,W}|H_1)}{R}$. When DR is close to 1, it indicates that the proposed method is sensitive to change.

The DR reflects the power of our method, in addition, a timely detection is also important. We define the Conditionally Expected Detection Delay (CED) which is the time between the average stop point and the change point: $CED = \frac{\sum_{j=1}^{R} \min(arg_n(U_{n,W}^{NS,j} > h_{p,W}|H_1))}{R} - \tau$. CED is influenced by W, s, and τ . When $W \leq \tau$, the smaller CED reflects better performances. When $W > \tau$ and $CED = W - \tau$, it means that the control chart can detect a signal as early as the first window. All simulation results for all experiments can be found in the supplementary materials, along with the simulation results of the studentized method. We discuss the highlights in the rest of Section 4.

4.3. Baseline Simulation Results

Table 1 shows the DR and CED for the NS_W control chart under Model I with various p, W, δ, τ , and v. The NS_W method has very low DR when the shift is smaller than 1.5. The DR increases with the growth of window size. It also performs well in more sparse scenarios where v = 10% with large change and appropriate window size. The location of τ has no significant influence on DR unless it is very small ($\tau = 10$). It has better DR in

detecting larger changes of higher dimensional mean vector.

[Table 1 near here.]

The CED of the NS_W method is worth considering when $DR \geq 0.5$. When $\tau > W$, the proposed method can detect a signal with about 10 extra observations after the change point. Large W can result in slower detection (large CED) especially if τ is very small. This result confirms the conclusion that the proposed method works well when the number of pre-shift and after-shift observations are balanced within one window. Therefore the optimal window size need to be determined based on a trade-off between sensitivity and detection delay. Consequently, we recommend the NS_W method for detecting large and sparse shifts in high-dimensional mean vector with larger window size, and we select W = 40 for the remaining experiments.

4.4. Robustness

The baseline model only considers mean shifts in multivariate normal distributed data, which is often an invalid assumption in practice. This section focuses on the results from Model II to IV to explore the robustness of our proposed method under heteroscedasticity, correlation, and nonnormality. The performance of our method is shown in Table 2, for more results, see the supplementary material.

Compared with the baseline model, the DR approximately decrease by 10 percent points in heteroscedastic model with small shift size, and DR = 1 when $\delta = 2$. This result is consistent under different levels of sparsity. The CED results show that heteroscedasticity has neglectable influence on the detection delay, and the NS_W method is robust to data with unequal variances. The results from the other two models yield the same conclusion regarding of robustness. Therefore, we highly recommend to monitor a process with the NS_W method when the underlying distribution is unknown or shows deviation from a normal distribution.

Table 2 near here.

5. Diagnostic

After a signal is obtained, it is of interest to diagnose the problem. Equations (4) and (7) give the change-point estimate which can be useful in post-signal diagnosis. More than that, locating the assignable causes, the suspicious variables, is worth considering. One limitation of the proposed supremum-based method is that the signal is directly caused by one variable, and the abnormal behavior in other variables is ignored. We propose the following diagnostic procedure to select all suspicious variables:

$$\hat{V}_{n}^{NS} = \arg_{r} \left(\frac{\sqrt{k^{*}(W - k^{*})} |\bar{X}_{k^{*}, r} - \bar{X}_{W - k^{*}, r}|}{\sqrt{W}} > h_{p, W} |U_{n, W}^{NS} > h_{p, W}, H_{1} \right), \tag{8}$$

where \hat{V}_n^{NS} is the set of variables that all yield a signal. To evaluate the accuracy of the diagnostic procedure, we compared \hat{V}_n^{NS} with the predefined variable set $V_n^{NS} = (X_1, ..., X_{vp})$. The Detection Rate of Variables (DRV) is defined as

$$DRV = P\left(\frac{|\hat{V}_n^{NS} \cap V_n^{NS}|}{|V_n^{NS}|}\right) = \frac{\sum_{i \in \hat{V}_n^{NS}} I(i \le p \times v)}{p \times v},\tag{9}$$

where i is an element in \hat{V}_n^{NS} (and the index of the variable that signals).

Table 3 shows the post-signal diagnostic performances of the proposed method with $p=100, \tau=25$, and W=40 under different models. The Conditional Change-Point Estimate (CPE) in Equation 7 and DRV are calculated from 1000 simulations. The NS_W method can estimate the change-point accurately under various setting of shift size and sparsity. There is no significant different performance between different models. It also shows good performance in finding the suspicious variables, especially when $\delta=2$, and is able to detect approximately 80% of the change variables correctly. One possible way to improve the capability of locating assignable causes is adding a variable selection algorithm to the proposed method.

[Table 3 near here.]

6. Comparison

As discussed in Section 2, Chen et al. (2016) proposed a distribution-free EWMA control chart (DFEWMA). The DFEWMA method is also based on a change-point model and is robust to nonnormality. It is efficient in detecting small and moderate shifts in location parameters for unknown distributions. We will compare the DFEWMA control chart with our proposed method, because it is one of the most comparable methods that we can find and for the DFEWMA method there is the matlab code available online. Before introducing the DFEWMA chart, we first need to rewrite H_1 in Equation 1 as

$$\boldsymbol{X}_i \sim \begin{cases} N_p(\boldsymbol{\mu}_0, \boldsymbol{\Sigma}_0), & i = -m_0 + 1, ..., 0, 1, ..., \tau, \\ N_p(\boldsymbol{\mu}_1, \boldsymbol{\Sigma}_1), & i > \tau \end{cases}$$

The difference is including m_0 IC observations to compose a reference sample. After collecting \mathbf{X}_n , the charting statistic can be constructed as $T_n(W,\lambda) = \sum_{r=1}^p T_{n,r}^2(W,\lambda)$, where

$$T_{n,r}(W,\lambda) = \sum_{i=n-W+1}^{n} (1-\lambda)^{n-i} \frac{R_{n,i,r} - W(m_0 + n + 1)/2}{\sqrt{W(m_0 + n + 1)(m_0 + n - W)/12}},$$
(10)

where W is the window size, λ is the smoothing parameter, $R_{n,i,r}$ is the rank of $X_{i,r}$ among the sample $X_{-m_0+1,r},...,X_{n,r}$. The data-dependent control limits are determined online rather than before monitoring. For more detailed properties of this method, see Chen et al. (2016).

To make the DFEWMA method more comparable with the proposed NS_W methods, we use Model I and the same setting of parameters $(p, \tau, W, \text{ and } v)$ as in Section 4, and the shift size are set at $\delta = 1, 1.5, 2$. Next, 100 IC observations are used as reference sample for the DFEWMA method. Table 4 shows the simulation results of the NS_W and DFEWMA methods, when $\tau = 50$ and v = 10%, additional results can be found in the supplementary material. Both methods are designed to have a FAP = 0.01 with 100 observations. The empirical FAP are in brackets. DFEWMA has larger empirical FAP than the target value

of 0.01. We can neither fix the problem nor change the comparer, since the codes of other methods are unavailable.

The DR of the DFEWMA chart is close to 1 in all scenarios which outperforms the NS_W method. We don't know how much it is affected by the larger FAP. It has better performance with less sparsity (large v), because it is a spatial-rank based statistic. The same explanation is also applicable to interpret the increase of DR with dimensionality. Because the DFEWMA chart uses increasing window size and moves with every new observation instead of using fixed window size and steps as us, it can achieve smaller detection delay. The proposed NS_W method only outperforms in CED with W=20 in lower dimension scenarios. One more reason for the good performance of the DFEWMA method is that it has 100 reference observations. As already pointed out by Chen et al. (2016), the efficiency of the DFEWMA chart relies on the large enough reference sample, which is unnecessary for our proposed method. An additional drawback of Chen et al. (2016) is the excessive false alarm rate. If there is a large reference sample and the practitioner does not mind many false alarms we recommend the DFEWMA method. For all other scenarios we believe the practitioner should rather use our proposed method. It's detection power is a little smaller but monitoring can start quickly and false alarm is at the nominal level.

[Table 4 near here.]

7. Case Study

In this section, we illustrate the proposed method by applying it to a real dataset from a semiconductor manufacturing process which is under constant surveillance via the monitoring of signals/variables collected from sensors and or measurement points. This dataset is available online (http://archive.ics.uci.edu/ml/datasets/SECOM). It consists of 590 variables each with 1567 records in chronological order. A classification label (± 1) is given to indicate whether the product passes or fails, where -1 represents pass and 1 is a failed one. Among these, 1463 observations are the IC sample, and the remaining 104 observations compose the OC sample.

Since the dataset contains constant values, null values and potential outliers, preprocessing is necessary. We remove the constant variables from both samples, leaving 416
variables. The outliers in the IC sample are identified by Tukey's fences (Tukey, 1977), and
replaced by the the variable median. The missing values in both samples are replaced by
variable median. After that, all the observations are standardized by the sample mean and
standard deviation from the IC observations. The proposed method is applied to monitor
the standard scores. Figure 2 shows the heteroscedastic standard scores of some variables
when they are in control.

[Figure 2 near here]

The control limits are simulated by the proposed bootstrap method in Algorithm 1 based on the IC sample with FAP = 0.01. Based on the assumption that the process starts from an IC status and then the mean vector changes at time τ , where $\tau = 10, 25, 50$. As shown in Table 5, the NS_W method is efficient in monitoring real high-dimensional process. The DR is equal to 1 in all scenarios. When $W > \tau$, it can always detect an out of control signal in the first window, and the CPE is close to the real one. When $W < \tau$, 5 observations detection delay is acceptable. These results confirm that the NS_W method is robust to unknown distributions and heteroscedasticity.

[Table 5 near here.]

8. Conclusion

Curse-of-dimensionality and unknown distributions increase the unreliability of parameter estimate, especially when a large amount of IC observations are unavailable. In analyzing OC performance, sparsity is another practical assumption, which challenges both signal detection and diagnosis methods. In this research we proposed a change-point based control chart for monitoring sparse changes in high-dimensional mean vector, specifically for HDLSS scenarios. A moving window is added to speed up the computation and increase the sensitivity. As shown by the experimentation results, the proposed NS_W chart is efficient

in detecting large sparse shifts. And it can achieve accurate estimation of the change-point and the potential OC variables. It is robust to correlation, nonnormality, and heteroscedasticity, the latter is an important and often overlooked characteristic of high-dimensional process data. More than that, the experiments give some reference in determining the optimal window size, a tradeoff between sensitivity and false alarms needs to be considered. The real case study illustrates the robustness and practicability of the NS_W method in application. Our proposed supremum-based method, the NS_W method, is not as sensitive as the spatial-rank-based DFEWMA chart in comparison. However the DFEWMA needs a large reference sample and shows excessive false alarms, both are not issues in our method. Future directions for research is to improve the sensitivity. One possible way is to adapt a variable selection algorithms before starting monitoring.

Supplementary Materials

The PDF file provides the studentized method and the additional tables of the detailed simulation results.

Acknowledgement

The work of Inez M. Zwetsloot described in this paper was supported by a grant from the Research Grants Council of the Hong Kong Special Administrative Region, China (Project No. CityU 21215319).

Declaration of Interest Statement

Zezhong WANG is a Ph.D candidate in the City University of Hong Kong in the Department of Systems Engineering and Engineering Management. Her research interests include Statistical Process Monitoring, in particular, the High-Dimensional Process Monitoring.

References

- Abdella, G. M., Al-Khalifa, K. N., Kim, S., Jeong, M. K., Elsayed, E. A., and Hamouda, A. M. (2017). Variable selection-based multivariate cumulative sum control chart. Quality and Reliability Engineering International, 33(3):565–578.
- Amiri, A. and Allahyari, S. (2012). Change point estimation methods for control chart postsignal diagnostics: a literature review. Quality and Reliability Engineering International, 28(7):673–685.
- Bickel, P. J. (1969). A distribution free version of the smirnov two sample test in the p-variate case. The Annals of Mathematical Statistics, 40(1):1–23.
- Bodnar, O. (2009). Application of the generalized likelihood ratio test for detecting changes in the mean of multivariate garch processes. *Communications in Statistics-Simulation and Computation*, 38(5):919–938.
- Bollerslev, T. (1986). Generalized autoregressive conditional heteroskedasticity. *Journal of econometrics*, 31(3):307–327.
- Capizzi, G. and Masarotto, G. (2011). A least angle regression control chart for multidimensional data. *Technometrics*, 53(3):285–296.
- Chakraborti, S., Human, S., and Graham, M. (2008). Phase i statistical process control charts: an overview and some results. *Quality Engineering*, 21(1):52–62.
- Chang, J., Zheng, C., Zhou, W.-X., and Zhou, W. (2017). Simulation-based hypothesis testing of high dimensional means under covariance heterogeneity. *Biometrics*, 73(4):1300–1310.
- Chen, N., Zi, X., and Zou, C. (2016). A distribution-free multivariate control chart. *Technometrics*, 58(4):448–459.
- Chen, S. X., Qin, Y.-L., et al. (2010). A two-sample test for high-dimensional data with applications to gene-set testing. *The Annals of Statistics*, 38(2):808–835.

- De Ketelaere, B., Hubert, M., and Schmitt, E. (2015). Overview of pca-based statistical process-monitoring methods for time-dependent, high-dimensional data. *Journal of Quality Technology*, 47(4):318–335.
- Downs, G. W. and Rocke, D. M. (1979). Interpreting heteroscedasticity. *American Journal of Political Science*, pages 816–828.
- Engle, R. (2001). Garch 101: The use of arch/garch models in applied econometrics.

 Journal of Economic Perspectives, 15(4):157–186.
- Engle, R. F. (1982). Autoregressive conditional heteroscedasticity with estimates of the variance of united kingdom inflation. *Econometrica: Journal of the Econometric Society*, pages 987–1007.
- Fani, S., Pasha, M., and Moghadam, M. B. (2019). A new approach to optimal design of control charts based on change point estimation and total time on test plot. *Communications in Statistics-Theory and Methods*, 48(22):5571–5584.
- Frisén, M. (2008). Financial surveillance, volume 71. Wiley Online Library.
- Gregory, K. B., Carroll, R. J., Baladandayuthapani, V., and Lahiri, S. N. (2015). A two-sample test for equality of means in high dimension. *Journal of the American Statistical Association*, 110(510):837–849.
- Hastie, T., Tibshirani, R., and Friedman, J. (2009). The elements of statistical learning: data mining, inference, and prediction. Springer Science & Business Media.
- Holland, M. D. and Hawkins, D. M. (2014). A control chart based on a nonparametric multivariate change-point model. *Journal of Quality Technology*, 46(1):63–77.
- Hong, D., Balzano, L., and Fessler, J. A. (2018). Asymptotic performance of pca for high-dimensional heteroscedastic data. *Journal of multivariate analysis*, 167:435–452.

- Huang, S., Kong, Z., and Huang, W. (2014). High-dimensional process monitoring and change point detection using embedding distributions in reproducing kernel hilbert space. *IIE Transactions*, 46(10):999–1016.
- Jiang, W., Wang, K., and Tsung, F. (2012). A variable-selection-based multivariate ewma chart for process monitoring and diagnosis. *Journal of Quality Technology*, 44(3):209– 230.
- Kim, S., Jeong, M. K., and Elsayed, E. A. (2019). A penalized likelihood-based quality monitoring via l2-norm regularization for high-dimensional processes. *Journal of Quality Technology*, pages 1–16.
- Li, Y., Liu, Y., Zou, C., and Jiang, W. (2014). A self-starting control chart for high-dimensional short-run processes. *International Journal of Production Research*, 52(2):445–461.
- Randles, R. H. (2000). A simpler, affine-invariant, multivariate, distribution-free sign test.

 Journal of the American Statistical Association, 95(452):1263–1268.
- Saha, E., Sarkar, S., and Ghosh, A. K. (2017). Some high-dimensional one-sample tests based on functions of interpoint distances. *Journal of Multivariate Analysis*, 161:83–95.
- Schipper, S. and Schmid, W. (2001). Control charts for garch processes. *Nonlinear Analysis:*Theory, Methods & Applications, 47(3):2049–2060.
- Sheikhrabori, R., Aminnayeri, M., and Ayoubi, M. (2018). Maximum likelihood estimation of change point from stationary to nonstationary in autoregressive models using dynamic linear model. *Quality and Reliability Engineering International*, 34(1):27–36.
- Shu, L. and Fan, J. (2018). A distribution-free control chart for monitoring highdimensional processes based on interpoint distances. *Naval Research Logistics (NRL)*, 65(4):317–330.
- Tukey, J. W. (1977). Exploratory data analysis, volume 2. Reading, MA.

- Wang, K. and Jiang, W. (2009). High-dimensional process monitoring and fault isolation via variable selection. *Journal of Quality Technology*, 41(3):247–258.
- Zamba, K. and Hawkins, D. M. (2006). A multivariate change-point model for statistical process control. *Technometrics*, 48(4):539–549.
- Zhang, C., Chen, N., and Wu, J. (2020). Spatial rank-based high-dimensional monitoring through random projection. *Journal of Quality Technology*, 52(2):111–127.
- Zhang, J. (2002). Powerful goodness-of-fit tests based on the likelihood ratio. *Journal of the Royal Statistical Society: Series B (Statistical Methodology)*, 64(2):281–294.
- Zou, C., Jiang, W., and Tsung, F. (2011). A lasso-based diagnostic framework for multivariate statistical process control. *Technometrics*, 53(3):297–309.
- Zou, C. and Qiu, P. (2009). Multivariate statistical process control using lasso. *Journal of the American Statistical Association*, 104(488):1586–1596.
- Zou, C. and Tsung, F. (2011). A multivariate sign ewma control chart. *Technometrics*, 53(1):84–97.
- Zou, C., Wang, Z., and Tsung, F. (2012). A spatial rank-based multivariate ewma control chart. *Naval Research Logistics (NRL)*, 59(2):91–110.
- Zou, C., Wang, Z., Zi, X., and Jiang, W. (2015). An efficient online monitoring method for high-dimensional data streams. *Technometrics*, 57(3):374–387.

Table 1: DR and CED of the NS_W method under Model I with various setting of p, δ, W, τ , and v.

						DR					C	CED		
			$\tau =$	= 10	$\tau = 2$	= 25	$=\mathcal{T}$	= 50	7	= 10	$\tau = \tau$	= 25	7	= 50
d	M	δ	10%	25%	10%	25%	10%	25%	10%	25%	10%	25%	10%	25%
			0.078	0.114	0.063	0.119	0.073	0.13	23.8	17.7	13.8	11.1	9.2	6.6
	20	1.5	0.326	0.587	0.322	0.652	0.347	0.636	12.5	11.1	9.2	8.6	8.1	8.1
20		2	0.772	0.984	0.82	0.993	0.831	0.979	10.5	10.1	7.3	0.9	7.3	5.8
		\vdash	0.074	0.167	0.236	0.495	0.273	0.514	32.4	32.4	19.0	18.5	17.5	16.4
	40	1.5	0.523	0.841	0.892	0.996	0.902	0.996	30.3	30.0	16.3	15.2	12.4	9.7
		2	0.964	1	1	1	1	1	30.0	30.0	15.0	15.0	9.7	5.9
		\vdash	920.0	0.157	0.098	0.178	0.09	0.166	22.4	13.2	13.8	12.0	9.3	10.0
	20	1.5	0.467	0.791	0.537	0.825	0.506	0.807	11.2	10.3	0.6	8.0	8.5	7.5
0.50		2	0.961	0.999	96.0		0.962	0.999	10.2	10.0	6.4	5.3	6.4	5.2
		\leftarrow	0.111	0.238	0.364	0.684	0.385	0.705	31.6	31.6	19.5	18.2	16.9	15.3
	40	1.5	0.751	0.968	0.987		0.992	1	30.1	30.0	15.4	15.0	10.5	8.2
		2	П	1		1	1	1	30.0	30.0	15.0	15.0	6.2	5.2
		\vdash	0.031	0.112	0.042	0.105	0.052	0.114	16.5	11.7	11.3	9.5	11.6	9.3
	20	1.5	0.42	0.738	0.439	0.782	0.431	0.781	10.6	10.4	8.8	8.2	8.8	8.3
100		2	0.973	\vdash	0.982	\vdash	0.977		10.1	10.0	6.5	5.3	6.5	5.2
))			0.165	0.343	0.508	0.822	0.531	0.848	31.6	30.6	18.7	17.3	16.3	14.9
	40	1.5	0.903	966.0		\vdash	\vdash	1	30.1	30.0	15.1	15.0	9.1	6.9
		2	П	\vdash			П	\vdash	30.0	30.0	15.0	15.0	5.4	5.0

Table 2: DR and CED for the proposed NS_W method under Model I to IV with various setting of δ and v. When $p=100,\,\tau=25,\,$ and W=40.

		L	\overline{OR}	C_{A}	ED
Model	δ	v = 10%	v = 25%	v = 10%	v=25%
I (Baseline)	1 1.5 2	0.508 1 1	0.822 1 1	18.7 15.1 15.0	17.3 15.0 15.0
II (Heteroscedastic)	1 1.5 2	0.408 0.999 1	0.712 1 1	19.7 15.1 15.0	18.6 15.0 15.0
III (Dependent)	1 1.5 2	0.348 0.968 1	0.539 0.992 1	19.2 16.3 15.0	19.5 15.6 15.0
IV (Nonnormal)	1 1.5 2	0.404 0.955 1	0.547 0.989 1	18.9 16.3 15.0	19.2 15.7 15.0

Table 3: Post-signal diagnosis of the NS_W chart under Model I to Model IV with various setting of v. When $p=100,\,\tau=25,\,W=40.$

		C.	PE	D.	\overline{RV}
Model	δ	v = 10%	v = 25%	v = 10%	v=25%
I (Baseline)	1 1.5 2	25.4 24.9 24.9	25.1 24.9 24.9	0.105 0.261 0.805	0.045 0.263 0.814
II (Heteroscedastic)	1 1.5 2	24.3 24.6 24.8	24.2 24.6 24.8	0.103 0.263 0.843	0.043 0.241 0.836
III (Dependent)	1 1.5 2	25.2 24.9 24.8	24.7 24.7 24.8	0.179 0.405 0.828	0.090 0.338 0.807
IV (Nonnormal)	1 1.5 2	24.8 24.7 24.8	24.8 24.7 24.8	0.200 0.396 0.818	0.121 0.350 0.821

Table 4: The DR and CED of the DFEWMA and NS_W charts with various combinations of p, W, and δ . When $m_0 = 100, v = 10\%, \tau = 50$. Between bracket the FAP = 0.01.

				\overline{DR}		CED
p	W	δ	$\overline{NS_W}$	\overline{DFEWMA}	$\overline{NS_W}$	DFEWMA
		0	(0.015)	(0.05)		
	20	1.5	0.347	1	8.08	11.01
		2	0.831	1	7.30	8.07
		0	(0.013)	(0.042)		
20	30	1.5	0.715	ì	11.21	11.20
		2	0.991	1	7.51	8.23
		0	(0.01)	(0.046)		
	40	1.5	0.902	1	12.39	10.51
		2	1	1	7.64	8.03
		0	(0.018)	(0.047)		
	20	1.5	0.506	ì	8.54	7.19
		2	0.962	1	6.36	5.40
		0	(0.013)	(0.037)		
50	30	1.5	0.918	1	10.11	7.23
		2	1	1	6.30	5.30
		0	(0.016)	(0.043)		
	40	1.5	0.992	1	10.50	7.14
		2	1	1	6.21	5.64
		0	(0.004)	(0.047)		
	20	1.5	0.431	1	8.84	5.33
100		2	0.977	1	6.51	4.34
		0	(0.011)	(0.047)		
	30	1.5	0.966	1	9.65	5.33
		2	1	1	5.61	4.21
		0	(0.003)	(0.037)		
	40	1.5	ì	1	9.11	5.54
		2	1	1	5.39	4.45

Table 5: The DR and CED of the proposed NS_W method in signal detection, and the CPE in post-signal diagnosis with various setting of W and τ .

\overline{W}		20		30				40	
au	10	25	50	10	25	50	10	25	50
DR	1	1	1	1	1	1	1	1	1
CED	10.00	4.99	4.92	20.00	5.02	4.95	30.00	15.00	4.93
CPE	14.15	26.24	51.19	20.05	26.35	51.22	25.96	31.94	51.12

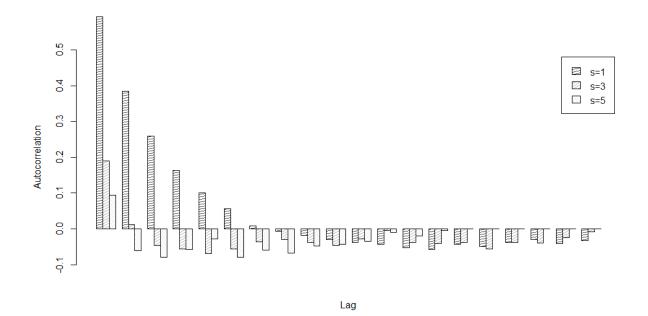


Figure 1: The autocorrelation of $U_{n,W}^{NS}$ with various s, when W=20.

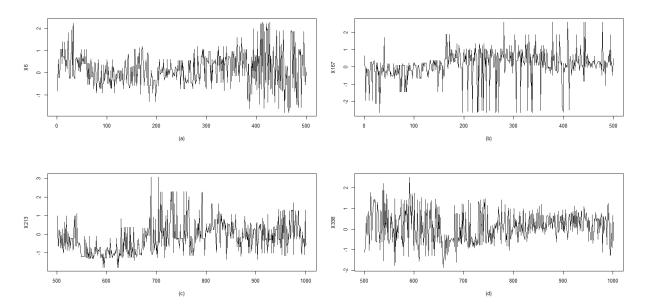


Figure 2: The heteroscedasticity of standard scores of X_6 , X_{167} , X_{213} , and X_{338} .

- Figure 1. The autocorrelation of $U_{n,W}^{NS}$ with various s, when W=20.
- Figure 2. The heteroscedasticity of standard scores of X_6 , X_{167} , X_{213} , and X_{338} .