

# AN ALGEBRAIC STUDY OF LINKAGES WITH HELICAL JOINTS

HAMID AHMADINEZHAD, ZIJIA LI, AND JOSEF SCHICHO

ABSTRACT. Methods from algebra and algebraic geometry have been used in various ways to study linkages in kinematics. These methods have failed so far for the study of linkages with helical joints (joints with screw motion), because of the presence of some non-algebraic relations. In this article, we explore a delicate reduction of some analytic equations in kinematics to algebraic questions via a theorem of Ax. As an application, we give a classification of mobile closed 5-linkages with revolute, prismatic, and helical joints.

## CONTENTS

1. Introduction	1
2. Algebraic set up	3
3. 5-linkages with Revolute and Prismatic Joints	6
4. Construction of Linkages with Helical Joints	7
5. Classification of 5-linkages with Helical Joints	9
6. Conclusion	13
Acknowledgements	14
References	14

## 1. INTRODUCTION

Linkages, and in particular closed linkages, are a crucial object of study in the modern theory of kinematics. The use of algebra and geometry for studying linkages is very classical and goes back to Sylvester, Kempe, Cayley and Chebyshev.

A linkage, as appearing in robotics/mechanical engineering, biology, as well as modelling of molecules in chemistry, etc., is a mechanical structure that consists of a finite number of rigid bodies – its *links* – and a finite number of *joints* that connect the links together, so that they possibly produce a motion. A linkage is called *closed* if its number of links and joints are equal and they are connected cyclically. We consider four types of joints:

- (R) revolute joints: allow rotations around a fixed axes;
- (P) prismatic joints: allow translations in a fixed direction;
- (C) cylindrical joints: allow rotations around a fixed axes and translations in the the direction of the axes;
- (H) helical joints: allow the motions of a cylindrical joint where the rotation angle and the translation length are coupled by a linear equation.

We will use the notation R-joint for a revolute joint, and similarly for other types. Note that the dimensions of the set of allowed motions (the degree of freedom) is 1 for joints of type R, P, and H, and 2 for C-joints.

---

2010 *Mathematics Subject Classification.* 70B15, 14Q99, 14H99 .

*Key words and phrases.* Algebraic Kinematics; Bond Theory; Helical Joint; Overconstrained Linkages.

The *configuration set* of a closed linkage  $L$ , denoted by  $K_L$ , is the set of possible simultaneous motions of all joints (see Definition 1 for a precise description). The dimension of  $K_L$  is called the *mobility* of  $L$ , and  $L$  is called *mobile* if the mobility is positive.

It is known that  $K_L$  can be described by analytic equations; see [14], page 356. If there are no H-joints, then we also have a description by algebraic equations. We refer to [13] for a historic overview of the use of geometric algebra in kinematics. This is the subject that has attracted algebraists the most. It should be mentioned, however, that also number theory has been used for studying linkages: in [9], reduction modulo prime numbers are considered in order to construct a new family of Stewart-Gough platforms. Below, in Section 2 we briefly explain the algebraic setup, as well as the theory of bonds, a rather new combinatorial technique that has shown to be very useful for analysing closed linkages with R-joints [10]. We also explain the analytical relations in the presence of H-joints. There are also other (numerical) algebraic methods that are applied in kinematics, see for example [3, 7, 15].

A closed linkage with  $n$  joints, where all joints are R-joints, is denoted by  $nR$ -linkage. We denote by  $n$ -linkage a linkage with  $n$  joints where no information on the type of joints is specified. It is easy to imagine that a 3R-linkage does not have a motion, and hence its configuration set is trivial. On the other hand a generic  $nR$ -linkage for  $n \geq 7$  has positive mobility (see [14], page 356), and hence there is not much to study. So the interesting cases are when  $n = 4, 5$  or 6. Nowadays we have a full classification of 4R- and 5R-linkages with mobility one ( $\dim K_L = 1$ ), and we know many cases for  $n = 6$  (see [8]). It is an open research problem to classify all 6R-linkages. These classification problems are considered by algebraists. Because of the nature of other types of linkages it seemed difficult, or rather impossible, to be able to use any of the present algebraic techniques for linkages with H-joints.

**What is new in this article?** As a main result, we show that unexpected mobility of a linkage with H-joints, i.e., a mobility that is strictly bigger than predicted by the Grübler-Kutzbach-Chebychev formula which simply counts parameters and equational restrictions, can always be explained algebraically. Let  $L$  be a linkage with H-joints, and let  $L'$  be the linkage obtained from  $L$  by replacing all H-joints by C-joints. It is clear that the configuration set of  $L$  is a subset of the configuration set of  $L'$ . The relation between the configuration set of  $L'$  and the Zariski closure of the configuration set of  $L$  will be made very precise (Theorem 9), with the help of Ax's Theorem [1] on the transcendence degree of function fields with exponentials. Note that Ax's theorem is originally about Schanuel's conjecture in number theory and has no apparent connections to kinematics.

The mobile linkages with 4 joints of type H, R, or P have been classified in [6]. Here (more precisely in Theorem 10) we give a classification of mobile linkages with 5 joints of type H, R, or P. Using our main result, we reduce to linkages with joints of type R or P only. The classification of mobile 5R-linkages has been done in [12], but for linkages with both R-joints and P-joints, we could not find a complete classification in the literature. On the other hand, this classification is not difficult when we use the theory of bonds, so we also give it in here (Theorem 6).

**Structure of the paper.** In Section 2 we setup a mathematical language to describe and to analyse linkages with arbitrary types of joints, we recall the theory of bonds for R-joints and we introduce the adaptations of this theory that make it work also for P-joints. In Section 3 we use these algebraic methods to classify mobility for 5-linkages with P- and R-joints. In Section 4 we reduce H-joints to C-joints. Finally, in Section 5 we use Ax's theorem and the results of the previous sections to classify mobile 5-linkages with helical joints.

Because the two proofs of the classification results, i.e., Theorem 6 and Theorem 10, are methodically quite different, it is possible to apply a "filter" while reading in case one is only interested in the main result (or in one of the proofs using Ax's theorem). In that case, the reader

could omit the second half of Section 2, right before bonds are introduced, and the whole Section 3, except for Theorem 6 which has to be taken for granted.

## 2. ALGEBRAIC SET UP

In this section we set up the notation for an algebraic description of linkages with arbitrary joints. Then we briefly recall bonds for R-joints as defined in [10]. Finally, we introduce bonds for P-joints and prove some basic properties of them.

**Dual quaternions and configuration set.** Suppose  $\mathbb{R}$  is the set of real numbers,  $\mathbb{D} := \mathbb{R} + \epsilon\mathbb{R}$  is the ring of dual numbers and  $\epsilon^2 = 0$ . Denote by  $\mathbb{H}$  the non-commutative algebra of quaternions, where

$$\mathbb{H} = \{A = a_0 + a_1\mathbf{i} + a_2\mathbf{j} + a_3\mathbf{k} \text{ where } \mathbf{i}^2 = \mathbf{j}^2 = \mathbf{k}^2 = -1 \text{ and } \mathbf{i}\mathbf{j} = \mathbf{k}, \mathbf{j}\mathbf{k} = \mathbf{i}, \mathbf{k}\mathbf{i} = \mathbf{j}\}.$$

Let  $\mathbb{DH} := \mathbb{D} \otimes_{\mathbb{R}} \mathbb{H}$  denote the dual quaternions, i.e.

$$\mathbb{DH} = \{h = A + \epsilon B \text{ where } A, B \in \mathbb{H} \text{ and } \epsilon^2 = 0\}.$$

We call  $A$  the *primal* part of a dual quaternion  $h$ , and  $B$  the *dual* part of  $h$ . The conjugate of  $A \in \mathbb{H}$ , as above, is defined by  $\bar{A} = a_0 - a_1\mathbf{i} - a_2\mathbf{j} - a_3\mathbf{k}$ . This extends naturally to define the conjugate dual quaternion of  $h$  by

$$\bar{h} = \bar{A} + \epsilon\bar{B}$$

The norm function  $N: \mathbb{DH} \rightarrow \mathbb{D}$  is then defined by  $N(h) = h\bar{h} = A\bar{A} + \epsilon(A\bar{B} + \bar{A}B)$ ; and the latter is called the *norm* of  $h$ .

Note that  $\mathbb{DH}$  can be regarded as a real 8-dimensional vector space, and projectivising  $\mathbb{DH}$  we obtain  $\mathbb{P}^7$ . The *Study quadric*  $S$  is a hypersurface of this projective space defined by the quadratic equation

$$\sum_{i=0}^3 a_i b_i = 0$$

where  $h = a_0 + a_1\mathbf{i} + a_2\mathbf{j} + a_3\mathbf{k} + \epsilon(b_0 + b_1\mathbf{i} + b_2\mathbf{j} + b_3\mathbf{k})$ . In other words

$$S = \{h \in \mathbb{P}^7 \text{ such that } N(h) \in \mathbb{R}\}$$

The linear 3-space represented by all dual quaternions with zero primal part is denoted by  $E$ . It is contained in the Study quadric, and the complement  $S - E$  is closed under multiplication and multiplicative inverse; hence  $S - E$  forms a group, which is isomorphic to the group of Euclidean displacements (see [11, Section 2.4]).

For a natural number  $n \in \mathbb{N}$ , a *linkage* with  $n$  joints is described as an  $n$ -tuple  $L = (j_1, \dots, j_n)$ , where each  $j_i$  represents a joint. We will use cyclic notation for joint indices, i.e.,  $j_{n+1} = j_1$ .

**Quantisation.** The type of joint specifies which data must be given in order to determine the set of possible motions, as follows. Suppose  $k \in \{1, \dots, n\}$ .

- I. If  $j_k$  is an *R-joint*, then we specify a dual quaternion  $h_k$  such that  $h_k^2 = -1$ . We write  $p_k$  and  $q_k$  for the primal and the dual part of  $h_k$ , i.e.,  $h_k = p_k + \epsilon q_k$  with  $p_k, q_k \in \mathbb{H}$ . The set of possible motions is parametrized by the joint parameter  $t_k \in \mathbb{P}^1$ , which is the rotation with an angle of  $2 \operatorname{arccot}(t_k)$ . The rotation corresponds to the dual quaternion  $m_k = t_k - h_k$ , and to 1 if  $t_k = \infty$ . Note that the latter means we have fixed the initial position at  $\infty$ .
- II. If  $j_k$  is a *P-joint*, then we specify a quaternion  $p_k \in \mathbb{H}$  such that  $p_k^2 = -1$ . The set of possible motions is parametrized by the joint parameter  $s_k \in \mathbb{R}$ , and the translation corresponds to the dual quaternion  $m_k = 1 - \epsilon s_k p_k$ .

- III. If  $j_k$  is a *C-joint*, then we specify a dual quaternion  $h_k = p_k + \epsilon q_k$  such that  $h_k^2 = -1$ , The set of possible motions is parametrized by the joint parameters  $(s_k, t_k)$  and corresponds to the dual quaternion  $m_k = (1 - \epsilon s_k p_k)(t_k - h_k)$ .
- IV. If  $j_k$  is an *H-joint*, then we specify a dual quaternion  $h_k = p_k + \epsilon q_k$  such that  $h_k^2 = -1$ , and a nonzero real number  $g_k$ . The number  $\frac{g_k}{2\pi}$  is often referred to as the *pitch* in mechanical engineering. The joint parameter is  $\alpha_k \in \mathbb{R}$ , and the motion corresponds to the dual quaternion  $m_k = (1 - \epsilon g_k \alpha_k p_k)(1 - \tan(\frac{\alpha_k}{2})h_k)$ .

The data which must be specified for all joints are called the *geometric parameters*. Note that when the linkage moves, the geometric parameters also change. However, there are functions in the geometric parameters that do not change when the linkage moves, such as the normal distance and the angle between neighbour rotation or helical axes.

**Definition 1.** The *configuration set*  $K$  is the set of all parameters  $t_k, s_k, \alpha_k$  such that the closure equation

$$(1) \quad m_1 m_2 \cdots m_n \equiv 1$$

is fulfilled. The symbol  $\equiv$  stands for projective equivalence, i.e., up to multiplication by a nonzero real scalar.

The *mobility* of  $K$  is the dimension of the solution set of Equation 1 as a complex analytic set in the parameter space. If it is positive, then we say that  $L$  is *mobile*.

We are interested in mobile linkages, and mainly those with mobility 1. Finding such linkage for given types, and numbers, of joints is a main goal. This leads to analysing the solutions of Equation (1).

If all values for  $t$ -parameters are  $\infty$  and all values for  $s$ - and  $\alpha$ -parameters are 0, then all  $m_k$  are equal to 1 and Equation (1) is fulfilled. This point of  $K$  is called the *initial configuration* of  $L$ .

*Remark 1.* The dimension of  $K$  as a real analytic set would be a more interesting number than the mobility we defined above, but it is harder to control. For instance, planar 4R-linkages always have mobility 1, but the real dimension can also be 0. In any case, the complex dimension is an upper bound for the real dimension, and if the two numbers are not equal then all real configurations must be singularities of the complex configuration space.

The remaining part of this section is concerned with the theory of bonds. If the reader is willing to believe Theorem 6, he/she may jump forward to this theorem, skip its proof and proceed with Section 4, in order to get faster to the application of Ax's theorem.

**Bonds.** For linkages with R-joints, bonds have been introduced in [10] as an algebraic tool which is used to describe and understand the algebraic structure of the configuration set. Informally speaking, bonds are the points in the boundary of the compactification of the complex configuration set. The closure equation degenerates in the boundary, and one obtains useful algebraic consequences. At this moment, we do not have any geometric intuition for bonds, we just use them mainly as a tool for studying the (real) configuration set and for deriving geometric conditions of the rotation axes. Here is the precise definition.

**Definition 2.** Let  $L$  be an  $n$ -linkage with joints of type R or P. Suppose  $Z$  is the projective closure of the complexification of  $K_L$  in  $(\mathbb{P}_{\mathbb{C}}^1)^n$ . Then the *bond set*  $B$  is defined as the intersection of  $Z$  and the solution set of the bond equation

$$(2) \quad m_1 m_2 \cdots m_n = 0.$$

*Remark 2.* In [10], where the theory of bonds is initially developed, only linkages with mobility 1 are considered and bonds are defined as points on the normalisation of the curve  $K$ . In this

paper, however, this is not necessary because we do not need multiplicities of bonds. Hence we can afford to simply say a bond is a point of  $B$ .

**Construction of the bond diagram.** Let  $\beta$  be a bond. We say that  $\beta$  is *attached* to a joint  $m_k$  if  $N(m_k(\beta)) = 0$ . This is equivalent to  $t_k^2 + 1 = 0$  if  $j_k$  is an R-joint, and to  $s_k = \infty$  if  $j_k$  is a P-joint. If  $\beta$  is attached to two different joints  $j_k$  and  $j_\ell$ , then we say that  $\beta$  *connects*  $j_k$  and  $j_\ell$  if and only if

$$m_k(\beta)m_{k+1}(\beta)\cdots m_\ell(\beta) = m_\ell(\beta)m_{\ell+1}(\beta)\cdots m_k(\beta) = 0$$

(this definition is slightly different from the definition in [10], but the more complicated definition using multiplicities is not needed here).

**Definition 3.** Suppose  $G = (V, E)$  is the graph of a linkage, where vertices, elements of  $V$ , represent the rigid bodies of  $L$  and  $v_i, v_i \in V$  are connected via an edge  $e \in E$  if there is a joint between them. The *bond diagram* is then defined to be this graph together with the following extra information: two edges are connected if their corresponding joints are connected via a bond.

**Example 1.** There is a unique family of 4R linkages such that the four axes are not all parallel and do not all have a common point, the Bennett linkage (see [4]). Its configuration curve can be defined by the equations

$$t_1 = t_3, t_2 = t_4, at_1s - t_2 + b = 0,$$

where  $a, b \in \mathbb{R}$ ,  $(a, b) \neq (1, 0)$ ,  $a \neq 0$  are parameters. The bond set is

$$B = \{(\pm i, a \pm i + b, \pm i, a \pm i + b), ((\pm i - b)/a, \pm i, (\pm i - b)/a, \pm i)\},$$

and the bond diagram is shown in Figure 1.

We define the offset  $o(h_1, h_2, h_3)$  of three lines  $h_1, h_2, h_3$  as follows. We assume that neither  $h_1 \parallel h_2$  nor  $h_2 \parallel h_3$ , where the symbol  $\parallel$  is used to show the two lines are parallel (otherwise, the offset is not defined). Let  $n_{12}$  be the common normal of  $h_1, h_2$ , i.e., the unique line intersecting both  $h_1$  and  $h_2$  at a right angle. Let  $n_{23}$  be the common normal of  $h_2, h_3$ . Then  $o(h_1, h_2, h_3)$  is defined as the signed distance between the intersection of  $h_2, n_{12}$  and the intersection of  $h_2, n_{23}$ . The sign comes from the orientation of the line  $h_2$  represented as a dual quaternion. The offset of three consecutive R-joints is fixed when the linkage moves.

**Example 2.** Assume that the lines  $h_1, h_2, h_3$  are coplanar and pairwise not parallel. Then  $o(h_1, h_2, h_3)$  is the distance of the intersection points  $h_1 \cap h_2$  and  $h_2 \cap h_3$ . If  $h_3$  is rotated around  $h_2$  by an angle different from  $\pi$ , call the result  $h'_3$ , then  $h_1, h_2, h'_3$  will not be coplanar, but we still have  $o(h_1, h_2, h_3) = o(h_1, h_2, h'_3)$ .

We recall some well-known facts on the bond diagram, and refer to [10] for details.

- (i) Every bond is attached to at least two joints.
- (ii) If a bond is attached to a joint  $j_k$ , then it connects  $j_k$  to at least one other joint.
- (iii) If a joint  $j_k$  actually moves during the motion, then it is attached to at least one bond.
- (iv) Two consecutive R-joints,  $j_i$  and  $j_{i+1}$ , are not connected by a bond.
- (v) If  $j_i, j_{i+1}$  and  $j_{i+2}$  are R-joints with axes  $h_i, h_{i+1}$  and  $h_{i+2}$  such that  $j_i$  is connected to  $j_{i+2}$  and  $h_1 \parallel h_2$ , then  $h_2 \parallel h_3$ .
- (vi) If  $j_i, j_{i+1}$  and  $j_{i+2}$  are R-joints with axes  $h_i, h_{i+1}$  and  $h_{i+2}$  such that  $h_i$  is not parallel to  $h_{i+1}$ , and  $j_i$  is connected to  $j_{i+2}$ , then  $o(h_i, h_{i+1}, h_{i+2}) = 0$ .

## 3. 5-LINKAGES WITH REVOLUTE AND PRISMATIC JOINTS

In this section we classify mobile closed 5-linkages with R- and P-joints. For the case of R-joints only, this is well-known, as described below. The general case is handled by bond theory; this makes the proof quite conceptual and avoids long and technical calculations. We use the results of this section to classify 5-linkages with helical joints in Section 5.

If  $L$  has two neighbouring R-joints with equal axes or two neighbouring P-joints with equal directions, then we say that  $L$  is *degenerate*. Throughout this section, we assume that  $n = 5$  or  $n = 4$ , and  $L = (j_1, \dots, j_n)$  is a mobile linkage with configuration set  $K$ . We also assume that  $L$  is not degenerate, and that no joint parameters are constant during motion of the linkage (otherwise one could easily make  $n$  smaller).

If  $L$  has only R-joints, then we have one of the following three cases ([12]; see [10] for a proof using bond theory).

- (1)  $L$  is spherical, i.e., all rotation axes meet in the same point; then  $L$  has mobility 2.
- (2)  $L$  is planar, i.e., all rotation axes are parallel; then  $L$  has mobility 2.
- (3)  $L$  is a Goldberg linkage, constructed as follows: take two spatial 4-linkages with one joint and one link in common; then remove the common link. The mobility of the Goldberg linkage is 1. If  $h_1, \dots, h_5$  are the rotation axes, then

$$o(h_4, h_5, h_1) = o(h_5, h_1, h_2) = o(h_1, h_2, h_3) = 0, \text{ and } o(h_2, h_3, h_4) = \pm o(h_3, h_4, h_5)$$

up to cyclic permutation of joints.

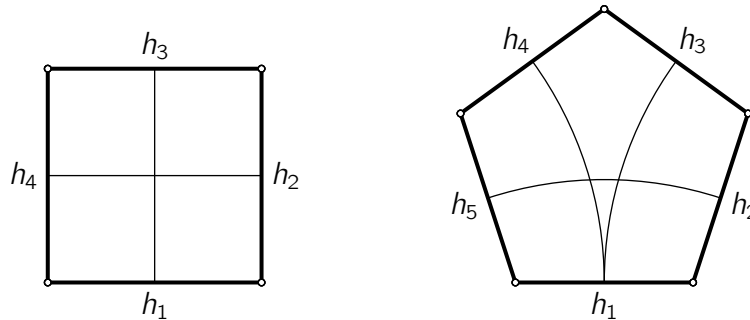


FIGURE 1. Bond diagrams for the Bennett 4R and the Goldberg 5R linkage. The vanishing of all offsets of the Bennett 4R linkage and of the three offsets  $o(h_4, h_5, h_1)$ ,  $o(h_5, h_1, h_2)$ , and  $o(h_1, h_2, h_3)$  of the Goldberg 5R linkage are easy consequences of bond theory.

By considering the specified data and parametrized motions modulo  $\epsilon$ , we may construct a spherical linkage  $L'$ , the *spherical projection* of  $L$ . The P-joints of  $L$  disappear, their translation motions are projected to the identity. Parallel joint axes of  $L$  are projected to identical axes of  $L'$ . Note that  $K$  is projected to an algebraic subset of  $K'$  (the configuration set of  $L'$ ). This subset has positive dimension if and only if  $L$  has at least one R-joint.

**Lemma 3.** *If  $L$  has 2 or more P-joints, then all rotation axes are parallel.*

*Proof.* Let  $r \geq 2$  be the number of P-joints. Then  $L'$  is a spherical linkage with  $5 - r \leq 3$  joints. Such a linkage is necessarily degenerate: if all three (or fewer) joints are actually moving, then all axes are identical.  $\square$

In order to classify PRRRR linkages, we use bond theory. Here are some additional facts for bonds in the presence of P-joints.

**Lemma 4.** *Assume that  $j_i$  is a P-joint, and  $j_{i+1}$  and  $j_{i+2}$  are R-joints.*

(a) *The joints  $j_i$  and  $j_{i+1}$  cannot be connected by a bond.*

(b) *If the joints  $j_i$  and  $j_{i+2}$  are connected by a bond, then the axes  $h_{i+1}$  and  $h_{i+2}$  are parallel.*

*Proof.* (a) Assume, without loss of generality, that  $(\infty, t)$  are the coordinates at  $(j_i, j_{i+1})$  of the bond connecting  $j_i$  and  $j_{i+1}$ . Then we have that  $\epsilon p_i(t - h_{i+1}) = 0$ , which is impossible.

(b) If  $(\infty, t, t')$  are the coordinates at  $(j_i, j_{i+1}, j_{i+2})$  of the bond connecting  $j_i$  and  $j_{i+1}$ , then  $\epsilon p_i(t - h_{i+1})(t' - h_{i+2}) = 0$ . We pass to the dual part. Since  $p_i$  is invertible, we conclude that  $(t - p_{i+1})(t' - p_{i+2}) = 0$ . This is only possible if  $t^2 + 1 = t'^2 + 1 = 0$  and  $p_{i+1} = \pm p_{i+2}$ .  $\square$

**Lemma 5.** *If  $j_1$  is a P-joint and all other joints are R-joints, then  $h_2 \parallel h_3$  and  $h_4 \parallel h_5$ .*

*Proof.* Assume that  $j_1$  is the P-joint. It must be connected by a bond to at least one other joint. By Lemma 4, this cannot be  $j_2$  and  $j_5$ , so we may assume it is connected to  $j_3$ . By Lemma 4 again,  $h_2$  and  $h_3$  are parallel. Then the spherical projection  $L'$  is a 4-linkage with 2 equal axes  $p_2$  and  $p_3$ . Hence  $L'$  is degenerate, and the other two axes  $p_4$  and  $p_5$  are equal too.  $\square$

Note that Lemma 5 holds for all  $j_i$  with appropriate indices.

**Theorem 6.** *Let  $L$  be a 5-linkage with at least one P-joint and all other joints of type R. Then the following two cases are possible.*

- (1) *Up to cyclic shift,  $j_1$  is the only P-joint,  $h_2 \parallel h_3$ , and  $h_4 \parallel h_5$ ;  $L$  has mobility 1, and  $t_2 = \pm t_3$  and  $t_4 = \pm t_5$  is fulfilled on the configuration curve.*
- (2) *All axes of R-joints are parallel.*

*Proof.* Using Lemma 5, we get  $h_2 \parallel h_3$ ,  $h_4 \parallel h_5$ . Without loss of generality, we assume  $p_2 = p_3$  and  $p_4 = p_5$ ; if this is not true, it can be easily achieved by replacing  $h_3$  by  $-h_3$  or  $h_5$  by  $-h_5$ . Either all axes of R-joints are parallel or the axes of  $h_3$  and  $h_4$  are not parallel. In the second case, there is nothing left to show; let us assume that  $h_3$  and  $h_4$  are not parallel. The primal part of the closure equation is equivalent to the equality of the two rotations

$$(t_2 - p_2)(t_3 - p_2) \equiv (t_5 + p_5)(t_4 + p_4).$$

Since the axes are distinct, both rotations must be the identity, which implies  $t_2 = -t_3$  and  $t_4 = -t_5$ .  $\square$

#### 4. CONSTRUCTION OF LINKAGES WITH HELICAL JOINTS

In this section we give a construction that produces mobile linkages with H-joints from linkages with C-, P-, and R-joints. We illustrate the construction by several well-known examples and one example which is new.

We start with a simple construction: take a linkage with  $r$  C-joints that has mobility at least  $r + 1$ . For each C-joint  $j_k$ , impose the additional restriction  $t_k = \cot(\frac{s_k}{2g_k})$  on its joint parameters  $(s_k, t_k)$ , where  $g_k$  is a nonzero real constant. Any additional equation reduces the mobility at most by 1, so we get a mobile linkage where every C-joint  $j_k$  is replaced by an H-joint with pitch  $g_k$ .

We can extend this simple construction using the observation that  $\mathbb{Q}$ -linear relations between the angles imply algebraic relations between their tangents. For the general construction, which we call *screw carving*, we need the following ingredients.

- (1) a linkage  $L$  with  $m$  C-joints  $j_{k_1}, \dots, j_{k_m}$  and an undetermined number of R- and P-joints;
- (2) an irreducible analytic subspace  $K_0$  of the configuration space of  $L$ ;
- (3) an integer matrix  $A$  with  $m$  columns that annihilates the vector of analytic functions  $(\alpha_{k_1}, \dots, \alpha_{k_m})^t \in \mathbb{C}(K_0)^m$  such that  $\cot(\frac{\alpha_k}{2}) = t_k$ ;
- (4) an  $m$ -tuple  $(g_{k_1}, \dots, g_{k_m})$  of nonzero real numbers, so that  $A$  also annihilates the vector of functions  $(a_{k_1}, \dots, a_{k_m})^t$ , where  $a_k : K_0 \rightarrow \mathbb{C}$  is the function  $(s_*, t_*) \mapsto \frac{s_k}{g_k}$ .

As before, the linkage  $L'$  with H-joints instead of C-joints is obtained by imposing the additional restriction  $t_k = \cot(\frac{s_k}{2g_k})$  on its joint parameters  $(s_k, t_k)$ , for each C-joint  $t_k$ . To obtain linkages with large mobility, the integer matrix  $A$  should have the largest possible rank, which means that all integral relations between the analytic angle functions are linear combination of matrix rows. (In the next section, we will indeed always choose such matrices of maximal rank.) The empty matrix with zero rows is allowed, then we just get the simple construction above.

**Lemma 7.** *Let  $d := \dim(K_0)$  and  $\ell := \text{rank}(A)$ . Then the mobility of the linkage produced by screw carving is at least  $d - m + \ell$ .*

*Proof.* The subset  $K'$  of  $K_0$  that satisfies the additional restrictions  $t_k = \cot(\frac{s_k}{2g_k})$  is contained in the configuration space of  $L'$ . Since the codimension of an analytic subset is never bigger than the number of defining equations, we see that  $\dim(K') \geq d - m$ . We claim that  $K'$  can be defined (as a subset of  $K'$ ) by only  $m - \ell$  equations.

Let  $\alpha_{k_1}, \dots, \alpha_{k_m} \in \mathbb{C}(K_0)$  be as above. The  $\mathbb{Q}$ -vector space generated by these  $m$  functions has dimension at most  $m - \ell$ . Without loss of generality, we assume that  $\{\alpha_{k_1}, \dots, \alpha_{k_{m-\ell}}\}$  is a generating set. Any other  $\alpha_k$  can be expressed as a  $\mathbb{Q}$ -linear combination

$$\alpha_k = q_1 \alpha_{k_1} + \dots + q_{k_{m-\ell}} \alpha_{k_{m-\ell}},$$

with rational coefficients depending on the matrix  $A$ . But then we also have

$$\frac{s_k}{g_k} = q_1 \frac{s_{k_1}}{g_{k_1}} + \dots + q_{k_{m-\ell}} \frac{s_{k_{m-\ell}}}{g_{k_{m-\ell}}}.$$

It follows that the equations  $t_{k_1} = \cot(\frac{s_{k_1}}{2g_{k_1}}), \dots, t_{k_{m-\ell}} = \cot(\frac{s_{k_{m-\ell}}}{2g_{k_{m-\ell}}})$  imply all other equations.  $\square$

**Example 3.** Let  $L$  be a 4-linkage with 4 cylindrical joints with parallel axes. Its mobility is 4. For all configurations  $(t_1 = \cot(\frac{\alpha_1}{2}), s_1, \dots, t_4 = \cot(\frac{\alpha_4}{2}), s_4)$ , we have  $\alpha_1 + \alpha_2 + \alpha_3 + \alpha_4 = 0$  and  $s_1 + s_2 + s_3 + s_4 = 0$ . So we take  $K_0$  as the full configuration set,  $A$  as the  $1 \times 4$  matrix  $(1, 1, 1, 1)$ , and  $g_1 = g_2 = g_3 = g_4$ , and apply screw carving. We obtain a 4-linkage with 4 helical joints and mobility  $4-4+1=1$ .

Similarly, one can obtain an  $n$ -linkage with  $n$  H-joints with parallel axes with mobility  $n - 3$ ,  $n \geq 4$ .

**Example 4.** Here is a variation of the previous example. Set

$$h_1 = \mathbf{k} - \epsilon \mathbf{i}, h_2 = \mathbf{k} + \epsilon \mathbf{i}, h_3 = h_5 = \mathbf{k}, h_4 = \mathbf{k} + 2\epsilon \mathbf{j}$$

and let  $L$  be the CCRRR linkage with C-joint axes  $h_1, h_2$  and R-joint axes  $h_3, h_4, h_5$ . Its mobility is 3, and all configurations satisfy  $s_1 + s_2 = 0$ . We define  $K_0$  as the subvariety defined by  $\tan(17 \arccot(t_1) - 11 \arccot(t_2)) = 0$  (this is a rational function in  $t_1, t_2$ ). Its dimension is 2. We set as the  $1 \times 2$  matrix  $A = (1, 1)$  and  $g_1 = \frac{1}{17}, g_2 = \frac{-1}{11}$ . By screw carving we get an HHRRR linkage with mobility 1. Figure 2 shows the trace of the joint  $j_4$  when the link with the two H-joints  $j_1, j_2$  is fixed.

**Example 5.** Let  $h_1, h_2, h_3$  be lines. Reflecting them by the coordinate axes represented by  $\mathbf{i}$ , we get  $h_4 = \mathbf{i}h_1\mathbf{i}, h_5 = \mathbf{i}h_2\mathbf{i}, h_6 = \mathbf{i}h_3\mathbf{i}$ . Let  $L$  be the 6C-linkage with axes  $h_1, \dots, h_6$ . The zero set of the closure equation

$$(t_1 - h_1)(1 - \epsilon s_1 h_1) \cdots (t_6 - h_6)(1 - \epsilon s_6 h_6) \equiv 1$$

has a component of dimension 4, given by the equations

$$t_1 = t_4, t_2 = t_5, t_3 = t_6, s_1 = s_4, s_2 = s_5, s_3 = s_6, \mathbf{x}\mathbf{i} + \mathbf{i}\mathbf{x} = 0,$$



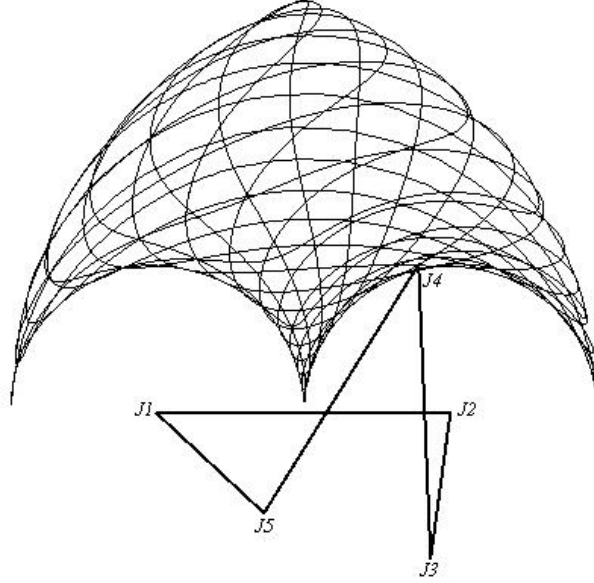


FIGURE 2. Planar projection of an HRRR linkage with 5 parallel axes to the plane orthogonal to the axes (Example 4). The helical joints are at  $j_1$  and  $j_2$ . The ratio of the pitches at the two helical joints  $j_1, j_2$  is 11:17. The curve shown is the trace of the joint  $j_4$ . It is an algebraic curve of large degree.

where  $x = (t_1 - h_1)(1 - \epsilon s_1 h_1)(t_2 - h_2)(1 - \epsilon s_2 h_2)(t_3 - h_3)(1 - \epsilon s_3 h_3)$ .

With  $A = \begin{pmatrix} 1 & -1 & 0 & 0 & 0 & 0 \\ 0 & 0 & 1 & -1 & 0 & 0 \\ 0 & 0 & 0 & 0 & 1 & -1 \end{pmatrix}$  and  $g_1 = g_4, g_2 = g_5, g_3 = g_6$ , the screw carving procedure gives a line symmetric 6H linkage with mobility 1.

Similarly, one can construct a plane symmetric RHHRRH linkage with mobility 1. Both linkages are well-known, see [2].

**Example 6.** Let  $h_1, h_2, h_3$  be lines with linear independent primal parts that do not intersect pairwise, such that  $o(h_1, h_2, h_3) = o(h_3, h_1, h_2) = 0$ . Let  $L$  be the RRCRRC linkage with axes  $h_1, h_2, h_3, h_2, h_1, h_3$ . The zero set of the closure equation

$$(t_1 - h_1)(t_2 - h_2)(t_3 - h_3)(1 - \epsilon s_1 h_3)(t_4 - h_2)(t_5 - h_1)(t_6 - h_3)(1 - \epsilon s_6 h_3) \equiv 1$$

has two components of dimension 2. The first is given by  $t_1 = -t_5, t_2 = -t_4, t_3 = t_6 = \infty, s_3 = s_6 = 0$ ; this is a degenerate motion which does not separate the pairs of axes at joints  $(j_1, j_5)$  and at  $(j_2, j_4)$ . The equations of the second component  $K_0$  can be computed by computer algebra. Two of them are  $s_3 = s_6$  and  $t_3 = t_6$ ; the remaining are more complicated. With  $A = \begin{pmatrix} 1 & -1 \end{pmatrix}$  and  $g_3 = g_6$ , the screw carving procedure gives an RRHRRH linkage with mobility 1. In contrast to all families of mobile 6-linkages with H-joints that have been known up to now, this linkage has no parallel axes or apparent geometric symmetries. A distinctive property is the existence of a starting position with three pairs of coinciding axes.

## 5. CLASSIFICATION OF 5-LINKAGES WITH HELICAL JOINTS

Now we show that the construction in Section 4 is complete, i.e., every linkage with helical joints can be obtained in this way. The main idea is the application of a theorem by Ax to

separate the transcendental part and the algebraic part of the closure equation. Then, we use the completeness result to classify 5-linkages with P-, R-, and H-linkages.

Let  $L$  be a mobile linkage with  $m$  helical joints; we assume that it is not degenerate, and that all joints actually move. There is a natural candidate for ingredients of the screw carving constructions in order to produce  $L$ .

- (i) We define the *cylindrical extension*  $L'$  of  $L$  by replacing all H-joints by C-joints. The configuration set  $K$  of  $L$  can be naturally embedded in the configuration  $K'$  set of  $L'$ .
- (ii) We take  $K_0$  as the Zariski closure of  $K$  in  $K'$ , i.e., the subset of  $K'$  defined by all algebraic equations that hold for  $K$ .
- (iii) We take  $A$  as an integer matrix whose rows generate, as a  $\mathbb{Z}$ -module, the coefficient vectors of all integral linear equations that hold for the  $m$   $\alpha$ -parameters in  $K$ .
- (iv) The  $m$  nonzero numbers are defined as the  $m$  pitches of  $K$ .

Application of the screw carving constructions just re-installs the screw conditions that already existed in  $L$ . But our construction includes a prediction on the mobility, and it is not clear if the mobility of  $L'$  is big enough to explain the mobility of  $L$ .

Since the use of number theoretic theorems is not usual in kinematics, we include the full statement of the Theorem of Ax on the transcendence degrees of a function field with exponential functions.

**Theorem 8.** *Let  $q, n$  be positive integers. Let  $f_1, \dots, f_q$  be analytic functions in some neighbourhood of  $\mathbb{C}^m$  about the origin  $o$  for which  $f_1 - f_1(o), \dots, f_q - f_q(o)$  are  $\mathbb{Q}$ -linearly independent. Let  $r$  be the rank of the Jacobi-matrix  $\frac{\partial(f_1, \dots, f_q)}{\partial(z_1, \dots, z_m)}$ . Then the transcendence degree of  $\mathbb{C}(f_1, \dots, f_q, e^{f_1}, \dots, e^{f_q})$  is greater than or equal to  $q + r$ .*

*Proof.* This is [1], Corollary 2. □

**Theorem 9.** *Let  $L$  be a linkage with  $m$  helical joints. Let  $K$  be an irreducible component of its configuration space containing the initial configuration as a nonsingular point. Let  $K_0$  be the Zariski closure of  $K$  in the cylindrical extension of  $L$ . Let  $A$  be the integral matrix defined by the  $\mathbb{Z}$ -relations between the helical joint parameters. Then*

$$\dim(K_0) = \dim(K) + m - \text{rank}(A).$$

*Consequently,  $L$  can be obtained by screw carving from its cylindrical extension.*

*Proof.* By Lemma 7, we have  $\dim(K_0) \leq \dim(K) + m - \text{rank}(A)$ , so it suffices to show the other inequality. Let  $d := \dim(K)$ , and  $q := m - \text{rank}(A)$ . Let  $\pi_H : K \rightarrow \mathbb{C}^m$  be the projection to the helical joint parameters  $\alpha_{k_1}, \dots, \alpha_{k_m}$ , and let  $K_H \subset \mathbb{C}^m$  be its image. Similarly, we define  $\pi_C : K_0 \rightarrow \mathbb{C}^m \times (\mathbb{P}^1)^m$  as the projection to the cylindrical joint parameters of  $L'$  and  $K_C$  as the image. There is a natural embedding  $K_H \hookrightarrow K_C$ , the map  $\pi_H$  is the restriction of  $\pi_C$  along this embedding, and  $K_C$  is the Zariski closure of  $K_H$  in  $\mathbb{C}^m \times (\mathbb{P}^1)^m$ .

Let  $d_H := \dim(K_H)$ . Then there is an analytic isomorphism  $\phi$  of a neighbourhood  $U \subset \mathbb{C}^{d_H}$  of the origin  $o$  mapping  $o$  to the initial configuration. For  $k = 1, \dots, m$ , let  $\overline{\alpha_k} : U \rightarrow \mathbb{C}$  be the projection to the joint parameter  $\alpha_k$ . They generate a  $q$ -dimensional  $\mathbb{Q}$ -vector space. We may assume that  $\overline{\alpha_{k_1}}, \dots, \overline{\alpha_{k_q}}$  generate this vector space. The rank of the Jacobian of  $\overline{\alpha_{k_1}}, \dots, \overline{\alpha_{k_q}}$  is equal to the rank of the Jacobian of all coordinate functions, which is equal to  $d_H$ . By Theorem 8, the field  $\mathbb{C}(\overline{\alpha_{k_1}}, \dots, \overline{\alpha_{k_q}}, e^{\overline{\alpha_{k_1}}}, \dots, e^{\overline{\alpha_{k_q}}})$  has transcendence degree at least  $d_H + q$  over  $\mathbb{C}$ . This field is  $\mathbb{C}$ -isomorphic to the function field of  $K_C$ , by the isomorphism

$$\overline{\alpha_{k_1}} \mapsto g_{k_1}^{-1} s_{k_1}, \dots, \overline{\alpha_{k_q}} \mapsto g_{k_q}^{-1} s_{k_q}, e^{\overline{\alpha_{k_1}}} \mapsto \frac{1 + it_{k_1}}{1 - it_{k_1}}, \dots, e^{\overline{\alpha_{k_q}}} \mapsto \frac{1 + it_{k_q}}{1 - it_{k_q}}.$$

Therefore  $\dim(K_C) \geq d_H + q$ .

Let  $E \subset K_C$  be the set of all points  $x$  such that  $\dim(\pi_C^{-1}(x)) > \dim(K_0) - \dim(K_C)$ . Since dimension is upper semicontinuous in the Zariski topology,  $E$  is a proper algebraic subvariety of  $K_C$ . Since  $K_H$  is Zariski dense in  $K_C$ , it is not contained in  $E$ . Therefore the generic fibre of  $\pi_H : K \rightarrow K_H$  has dimension  $\dim(K_0) - \dim(K_C)$ . Hence we have

$$\dim(K_0) = \dim(K_C) + \dim(K) - \dim(K_H) \geq d_H + q + \dim(K) - d_H = \dim(K) + q.$$

□

From the cylindrical extension  $L_c$ , we may construct families  $F_p$  and  $F_r$  of linkages by setting either the rotation parameters or the translation parameters of the joints  $j_{k_1}, \dots, j_{k_q}$  to fixed values  $(\tau_{k_1}, \dots, \tau_{k_q})$  respectively  $(\sigma_{k_1}, \dots, \sigma_{k_q})$ , where  $\overline{\alpha_{k_1}}, \dots, \overline{\alpha_{k_q}}$  generate the  $\mathbb{Q}$ -vector space of all angle parameter functions at the helical joints. This imposes exactly  $q$  additional equations to the configuration set  $K_0$ , hence the mobility of any linkage in one of the two families is greater than or equal to the mobility of  $L$ . In family  $F_r$ , every C-joint is replaced by an R-joint, and in family  $F_p$ , every C-joint is replaced by a P-joint.

We choose generic members for both families and call them  $L_p$  and  $L_r$ . The angles and orthogonal distances of neighbouring R-joints is constant for both families, and is equal to the value of the corresponding parameter of  $L$ . The offsets do change, but in a transparent way: if  $j_2$  is an H-joint and  $j_1, j_3$  are H- or R-joints in  $L$ , then the offset of the axes at the corresponding axes in the family  $F_r$  is a linear non-constant function in the family parameter  $\sigma_2$ . Similarly, the angle between the directions of  $j_1$  and  $j_3$  from  $j_2$  in spherical geometry change with the family parameter  $\tau_2$ . In particular, the generic family member  $L_r$  has nonzero offset and the generic family member  $L_p$  has nonzero angles at this place.

Linkages with helical joints are called degenerate if there are neighbouring R- or H-joints with equal axes, neighbouring P-joints with equal directions, or an H-joint with a neighbouring P-joint in the direction of the axis of the H-joint. In all these cases it is easily possible to simplify the pair of neighboring joints from RR to R, HH to H or C, HR to C, PP to P, or HP to C.

Assume that  $L$  is nondegenerate. Because the axes/directions of  $L_r$  and  $L_p$  are equal to the axes/directions of an instance of  $L_c$  after application of a motion in  $K_0$ ,  $L_r$  is also nondegenerate, and  $L_p$  can only be degenerate if  $L$  has neighbouring H-joints with parallel axes. However, it may happen that some joints of  $L_r$  or  $L_p$  remain fixed during the motion, even if this is not the case for  $L$ .

The existence of mobile linkages with only P- and R-joints with particular properties as a consequence of the existence of mobile linkages with H-joints allows to classify the 5-linkages with H-joints. We do that by constructing the linkages  $L_r$  and  $L_p$  and then compare with the classifications in Section 3 and Theorem 6. We also need the classification of 4-linkages, because it may be that some joints of  $L_r$  or  $L_p$  are fixed. For convenience, we write here the facts on 4- and 5-linkages that are used below. For the first 4 facts, we assume that  $L$  is a nondegenerate mobile linkage with R- and P-joints, such that every joint actually moves. Let  $n$  be the number of joints of  $L$ .

- (1) If  $n = 4$  and  $L$  has a P-joint, then all axes of R-joints are parallel (this is a special case of Delassus' theorem [6]).
- (2) If  $n = 4$  and  $L$  has no P-joints, then either all axes are parallel, or no neighbouring pair of axes is parallel and all offsets are zero (see [5]).
- (3) If  $n = 5$  and  $L$  has a P-joint, then either all axes of R-joints are parallel, or  $j_1$  is a P-joint, all other joints are of type R, and  $h_2 \parallel h_3$  and  $h_4 \parallel h_5$  (Theorem 6).
- (4) If  $n = 5$  and  $L$  has no P-joints, then either all axes are parallel, or no neighbouring pair of axes is parallel and at least three of the five offsets are zero (see Section 2).

- (5) Any movable CRP linkage is degenerate, i.e., either the axis of the C-joint and the axis of the R-joint coincide, or the axis of the C-joint is parallel to the direction of the P-joint. Here we leave the proof to the reader.

Here is the classification of 5-linkages with joints of type R, P, or C, based on Theorem 9 (compare also with Delassus's classification [6] of 4-linkages with these three types of joints).

**Theorem 10.** *Let  $L$  be a non-degenerate mobile 5-linkage with R-, P-, and H-joints, with at least one H-joint, such that all joints actually move. Up to cyclic permutation, the following cases are possible.*

- (1) All axes of R- and H-joints are parallel.
- (2) There is one P-joint  $j_1$ , all other joints are of type H or R,  $h_2||h_3$  and  $h_4||h_5$ .

*Proof.* Let  $r$  be the number of neighbouring blocks of equal axes of the spherical projection  $L_s$ . The proof proceeds by case distinction on  $r$ . The cases  $r = 4$  and  $r = 5$  are split into two subcases.

**Case  $r = 1$ :** Then all axes of  $L_s$  are equal, hence all axes of H- and R-joints of  $L$  are parallel; this is possibility (1) of the theorem.

**Case  $r = 2$ :** Then each of the two blocks of R-joints in  $L_s$  has at least two joints and at most three joints, because a single joint could not move. The linkage  $L_r$  is movable and therefore has at least four joints that actually move. In particular, it cannot happen that all axes of  $L_r$  that actually move are parallel. After removing the joints that remain fixed,  $L_r$  still has two blocks of parallel axes. By comparing with Facts 3 and 4 above, it follows that  $L_r$  is a PRRRR linkage; if, say,  $j_1$  is the prismatic joint, then  $h_2||h_3$  and  $h_4||h_5$ . This is the possibility 2 of the theorem.

**Case  $r = 3$ :** There is at least one group of joints of the spherical projection  $L_s$  with only one R-joint. This joint cannot move. Hence the corresponding H- or R-joint of  $L$  does not move either, contradicting our assumption. So this case is impossible.

**Case  $r = 4$ :** If  $L$  has a P-joint, then  $L_r$  is a mobile and nondegenerate PRRRR linkage without any parallel rotation axes. Such a linkage does not exist, hence  $L$  has no P-joint. Then we have two parallel neighbouring axis of  $L$ . Up to cyclic permutation, we may assume  $h_1||h_2$ , and the other directions of axes are not parallel. There is no 4R or 5R linkage with exactly two parallel axes (see Fact 3). Therefore at least one of the two joints with parallel axes  $h_1, h_2$  must be fixed in  $L_r$ . Without loss of generality, we may assume that  $L_r$  is a 4R linkage with axes  $h_2, h_3, h_4, h_5$ . By Fact 2, all offsets of  $L_r$  are zero. In particular,  $o(h_2, h_3, h_4) = o(h_3, h_4, h_5) = 0$ . Hence  $j_3$  and  $j_4$  are R-joints in  $L$ . Hence  $h_3$  and  $h_4$  are axes of R-joints of  $L_p$ . On the other hand, they are not parallel to each other and not parallel to the remaining axes. In any movable 4-linkage or 5-linkage with joints of type R and P, at least one P, any revolute axis is in a block of at least two parallel axes (see Fact 1). It follows that the two joints with axes  $h_3$  and  $h_4$  must be fixed in  $L_p$ . Hence  $L_p$  has at most three joints that actually move. This is not possible if  $L_p$  has an R-joint that actually moves. Since  $h_1||h_2$  and  $h_5$  is not parallel to both, the joint of  $L_p$  corresponding to  $j_5$  is also fixed, and  $L_p$  is a degenerate linkage with two P-joints sharing the same direction. It follows that  $j_1$  and  $j_2$  are H-joints in  $L$ . The type of joint  $j_5$  may be either H or R.

**Subcase 1:**  $j_5$  is an R-joint. The cylindrical extension  $L_c$  has two C-joints with axes  $h_1$  and  $h_2$ . If the mobility of  $L_c$  is 3 or higher, then we freeze one of the two C-joints, and we get mobile CRRR linkage without parallel neighbouring axes, contradicting Fact 1. Therefore the mobility of  $L_c$  is 2, and we must have a  $\mathbb{Q}$ -linear relation between the angle functions. But in  $L_r$ , the joint corresponding to  $j_1$  is fixed, and the joint corresponding to  $j_2$  moves. This is a contradiction.

**Subcase 2:**  $j_5$  is an H-joint. If the mobility of  $L_c$  is 2, then we may argue as in Subcase 1: the three angle functions at the C-joints of  $L_c$  have to generate a one-dimensional  $\mathbb{Q}$ -vector space of  $L_c$ . Especially, there is a  $\mathbb{Q}$ -linear relation between the angle functions at the joints corresponding to  $j_1$  and  $j_2$ . And in  $L_r$ , the joint corresponding to  $j_1$  is fixed, and the joint corresponding to  $j_2$  moves, which gives a contradiction. Hence the mobility of  $L_c$  is at least 3. Now we freeze the R-joint with axes  $h_3$  and the translation component at the joint corresponding to  $j_2$ . We get a mobile CRRC linkage  $L'$  with joint axes  $h_1, h_2, h_4, h_5$ . Since  $h_1 \parallel h_2$ , and  $h_4$  and  $h_5$  have different directions, the spherical projection of  $L'$  is fixed at the two joints with axes  $h_4$  and  $h_5$ . Hence  $L'$  is fixed at the joint with axes  $h_4$  and the C-joint with axes  $h_5$  can be replaced by a P-joint. We may consider  $L'$  as a CRP linkage with axes  $h_1, h_2$ , and translation direction  $p_5$ . By Fact 5, either  $h_1 \equiv h_2$  or  $h_1 \parallel h_5$ . Neither is possible.

**Case  $r = 5$ :** Then  $L_r$  is either a 5R-linkage or a 4R-linkage with an extra immobile R-joint.

**Subcase 1:** If  $L_r$  is a 5R-linkage, then  $L_r$  has at least three vanishing offsets, by Fact 4.

Hence  $L$  has at least one and at most two H-joints, and  $L_p$  has at least one at most two P-joints. Because  $L_p$  has no parallel rotation axes, all its R-joints must be fixed. Then  $L_p$  must have two P-joints with equal directions. On the other hand,  $L$  has no parallel axes. This is a contradiction.

**Subcase 2:** Without loss of generality, let us say that the joint with axis  $h_1$  is fixed in  $L_r$ . By Fact 2, all offsets of  $L_r$  are zero. In particular,  $o(h_2, h_3, h_4) = o(h_3, h_4, h_5) = 0$ . Hence  $j_3$  and  $j_4$  are R-joints. Again,  $L_p$  has no parallel rotation axes, so all its R-joints must be fixed. If  $L_p$  has two moving P-joints, then they would have to be parallel, which is not possible. Hence  $L_p$  has three moving P-joints with direction  $p_5, p_1, p_2$ . Then these three vectors have to be linearly dependent, which is equivalent to saying that the angle between  $p_5$  and  $p_2$  from  $p_1$  (in spherical geometry) is equal to 0. On the other hand,  $L_p$  has a nonzero angle at every joint corresponding to an H-joint of  $L$ . This is a contradiction. □

**Example 7.** Here is an example that shows that the second case is indeed possible.

Let  $h_2, h_3$  be parallel lines with a distance  $a$  to each other. Let  $h_4, h_5$  be another pair of parallel lines, not parallel to the first pair, also with distance  $a$  to each other. We assume that  $p_2 = -p_3$  and  $p_4 = -p_5$ . Let  $g_2, g_4 \in \mathbb{R}$ . For any  $\alpha_2 = \alpha_3 \in \mathbb{R}$ , the composed motion

$$m_2 m_3 = (1 - \epsilon g_2 \alpha_2 p_2) \left(1 - \tan\left(\frac{\alpha_2}{2}\right) h_2\right) (1 - \epsilon g_2 \alpha_3 p_3) \left(1 - \tan\left(\frac{\alpha_3}{2}\right) h_3\right)$$

is a translation, where the translation vector lies on a circle in a plane orthogonal to  $p_2$  with radius  $a$ . Similarly, for  $\alpha_4 = \alpha_5 \in \mathbb{R}$  the composed motion  $m_4 m_5$  is a translation with translation vector on another circle with the same radius. We can choose a parametrisation such that the motion  $m_2 m_3 m_4 m_5$  is a translation in a fixed direction ( $p_2 + p_4$  or  $p_2 - p_4$ ). Hence the linkage with P-joint in this direction and H-joints with axes  $h_2, h_3, h_4, h_5$  and pitches  $g_2, g_2, g_4, g_4$  is mobile.

## 6. CONCLUSION

Using Ax's theorem and screw carving, it is possible to investigate mobility questions for arbitrary linkages with helical joints. The classification of mobile closed 5-linkages with joints of type R, P, or H, given in this paper, is just a first application of this reduction.

A challenge for future research is the classification of mobile closed 6-linkages with helical joints. In contrast to the case of 5-linkages, reduction to linkages with joints of type R or P will not be enough, because our knowledge of that linkages is still quite incomplete: even the

classification of mobile closed 6R linkages is an open problem. But there is a reason to believe that classifying 6-linkages with at least one H-joint is substantially easier than the 6R case: the linkages constructed by cylindrical extension and fixing either the rotational or the translational parameter have properties that could help the classification (for instance, generic offsets). Another possible attempt would be to extend the theory of bonds to linkages with C-joints and to configuration sets where a fixed set of angle functions satisfy  $\mathbf{Z}$ -linear equations.

#### ACKNOWLEDGEMENTS

This research was supported by the Austrian Science Fund (FWF): W1214-N15, project DK9.

#### REFERENCES

- [1] J. Ax. On Schanuel's conjectures. *Ann. Math. (2)*, 93:252–268, 1971.
- [2] J. E. Baker. The single screw reciprocal to the general plane-symmetric six-screw linkage. *J. Geom. Graph.*, 1:5–12, 1997.
- [3] D. J. Bates, C. Peterson, A. J. Sommese, and C. W. Wampler. Numerical computation of the genus of an irreducible curve within an algebraic set. *J. Pure Appl. Algebra*, 215(8):1844–1851, 2011.
- [4] G. T. Bennett. The skew isogram mechanism. *Proc. LMS*, 13(2nd Series):151–173, 1913–1914.
- [5] K. Brunthaler, H.-P. Schröcker, and M. Husty. A new method for the synthesis of Bennett mechanisms. In *Proceedings of CK 2005, International Workshop on Computational Kinematics*, Cassino, 2005.
- [6] E. Delassus. The closed and deformable linkage chains with four bars. *Bull. Sci. Math.*, 46:283–304, 1922.
- [7] S. Di Rocco, D. Eklund, A. J. Sommese, and C. W. Wampler. Algebraic  $\mathbb{C}^*$ -actions and the inverse kinematics of a general 6R manipulator. *Appl. Math. Comput.*, 216(9):2512–2524, 2010.
- [8] P. Dietmaier. *Einfach übergeschlossene Mechanismen mit Drehgelenken*. Habilitation thesis, Graz University of Technology, 1995.
- [9] Florian Geiß and Frank-Olaf Schreyer. A family of exceptional Stewart-Gough mechanisms of genus 7. In *Interactions of classical and numerical algebraic geometry*, volume 496 of *Contemp. Math.*, pages 221–234. Amer. Math. Soc., Providence, RI, 2009.
- [10] G. Hegedüs, J. Schicho, and H.-P. Schröcker. The theory of bonds: A new method for the analysis of linkages. *Mechanism and Machine Theory*, 70(0):407 – 424, 2013.
- [11] M. Husty and H.-P. Schröcker. Algebraic geometry and kinematics. In I. Z. Emiris, F. Sottile, and Th. Theobald, editors, *Nonlinear Computational Geometry*, volume 151 of *IMA Vol. Math. Appl.*, pages 85–107. Springer, 2010.
- [12] A. Karger. Classification of 5R closed kinematic chains with self mobility. *Mech. Mach. Th.*, pages 213–222, 1998.
- [13] C-C. Lee, C. Stammers, and G. Muleux. On the historical overview of geometric algebra for kinematics of mechanisms. *International Symposium on History of Machines and Mechanisms*, pages 21 – 34, 2009.
- [14] J. Selig. *Geometric Fundamentals of Robotics*. Springer, 2005.
- [15] C. W. Wampler and A. J. Sommese. Numerical algebraic geometry and algebraic kinematics. *Acta Numer.*, 20:469–567, 2011.

Johann Radon Institute for Computational and Applied Mathematics (RICAM), Austrian Academy of Sciences, Altenberger Str. 69, A-4040 Linz, Austria

hamid.ahmadinezhad@oeaw.ac.at

zijia.li@oeaw.ac.at

Research Institute for Symbolic Computation (RISC), Johannes Kepler University, Altenberger Str. 69, A-4040 Linz, Austria

josef.schicho@risc.jku.at