

A Theoretical Investigation of Orientation Relationships and Transformation Strains in Steels

Konstantinos Koumatos*

*Gran Sasso Science Institute,
Viale Francesco Crispi 7,
67100 L'Aquila, Italy*

Anton Muehleemann†

*Mathematical Institute, University of Oxford,
Andrew Wiles Building, Radcliffe Observatory Quarter, Woodstock Road,
Oxford OX2 6GG, United Kingdom*

Dated: June 22, 2016

The identification of orientation relationships (ORs) plays a crucial rôle in the understanding of solid phase transformations. In steels, the most common models of ORs are the ones by Nishiyama-Wassermann (NW) and Kurdjumov-Sachs (KS). The defining feature of these and other OR models is the matching of directions and planes in the parent face-centred cubic γ -phase to ones in the product body-centred cubic/tetragonal α/α' -phase.

In this paper a novel method that identifies transformation strains with ORs is introduced and used to develop a new strain-based approach to phase transformation models in steels. Using this approach, it is shown that the transformation strains that leave a close packed plane in the γ -phase and a close packed direction within that plane unrotated are precisely those giving rise to the NW and KS ORs when a cubic product phase is considered. Further, it is outlined how, by choosing different pairs of unrotated planes and directions, other common ORs such as the ones by Pitsch (P) and Greninger-Troiano (GT) can be derived.

One of the advantages of our approach is that it leads to a natural generalisation of the NW, KS and other ORs for different ratios of tetragonality r of the product bct α' -phase. These generalised ORs predict a sharpening of the transformation textures with increasing tetragonality and are thus in qualitative agreement with experiments on steels with varying alloy concentration.

*konstantinos.koumatos@gssi.infn.it †muehleemann@maths.ox.ac.uk

MSC (2010): 74A05, 74N05, 74N10

KEYWORDS: Nishiyama-Wassermann, Kurdjumov-Sachs, tetragonal, orientation relationships, transformation strain, steel, fcc to bcc, fcc to bct, Pitsch, Greninger-Troiano, Bain, Inverse Greninger-Troiano

Contents

1. Introduction	2
2. A unified approach	4
3. The NW and KS models	7
3.1. Relation to other descriptions	12
3.2. Twin relationships between KS variants	13
3.3. The influence of tetragonality on the orientation relationships	14
4. Other orientation relationship models	15
5. Conclusions	17
A. Overview of orientation relationship models	18
B. The group \mathcal{P}^{24}	25

1. Introduction

The transformation mechanism from the face-centred cubic (fcc) to the body-centred cubic/tetragonal (bcc/bct) phase of steel has received widespread attention and the most influential early studies include [Bai24, KS30, Nis34, Was35]. In his seminal paper, Bain [Bai24] proposed a mechanism that transforms the fcc γ -phase of iron to its bcc α -phase “requiring the least temporary distortion”. His conceived mechanism, although now widely accepted, was not without criticism from his contemporaries. Among the critics were Kurdjumov and Sachs [KS30] who conducted X-ray diffraction measurements on 1.4% carbon steel and measured the orientation relationships between austenite and pure bcc α -iron as well as between austenite and 1.4% C α' -steel.¹ The most important feature of their mechanism was the parallelism between the $(111)_{\gamma}$ and the $(011)_{\alpha'}$ plane as well as the $[10\bar{1}]_{\gamma}$ and the $[1\bar{1}1]_{\alpha'}$ direction and they explained how these conditions can be satisfied by a combination of three shears. Following their construction step by step one sees that the overall deformation is always one of the Bain strains followed by a rigid body rotation and that the resulting orientation relationship for pure iron differs from the one for 1.4% C steel (see Tables 2 in [KS30] and [Ott60]). In 1934, using the same

¹ Henceforth, we adopt the convention from [Nis78] of using the symbol α' for the low temperature phase of steels irrespectively of whether it is cubic or tetragonal.

methods, Nishiyama [Nis34] investigated a Fe-30%Ni single crystal which, like pure iron, undergoes an fcc to bcc transformation. Based on his observations, Nishiyama proposed a different orientation relationship that has the same parallel planes but the direction $[10\bar{1}]_\gamma$ parallel to $[100]_{\alpha'}$. One year later, Wassermann [Was35] independently postulated the same relationships and also confirmed the earlier results by Kurdjumov and Sachs. Apart from the Nishiyama-Wassermann (NW) and Kurdjumov-Sachs (KS) orientation relationships (ORs) several other ORs, e.g. by Pitsch [Pit59] (P) and Greninger-Troiano [GT49] (GT), have been proposed and they all share the common feature of matching directions and planes in the parent phase to ones in the product phase.

In the present article, we would like to shift this paradigm towards a derivation of orientation relationships based on the transformation strains. Compared to previous approaches (see e.g. [GLMJ04,HGJ05,CBdC10]), our approach brings the following novelties:

1. The only necessary inputs are the lattice parameters of the two phases and the knowledge of a plane and a direction that is left unrotated.
2. Each derived strain can be uniquely identified with an OR and the parallelism between planes and directions in the two phases follows.
3. The additional knowledge of the actual underlying deformation of the material can e.g. be used to unambiguously determine twin relationships (cf. Section 3.2) and generally lay the groundwork for mathematical theories of steels based on energy minimisation (see e.g. [Bha03,KM15]).
4. Our method takes into account the ratio of tetragonality $r = c/a$ of the bcc α' phase. Thus, the derived strains and orientation relationships also depend on r and can be expressed explicitly as functions of r .

For $r = 1$, corresponding to bcc, we recover the original NW, KS and P ORs. However, for $r > 1$, our approach predicts a deviation from the original ORs. We show how this leads to a sharpening of the transformation textures and how it can be used to explain the deviation from the exact parallelism condition in the GT ORs.

The structure of the paper is as follows: at the end of this section we clarify the notation that will be used throughout. In Section 2, we introduce a unified approach for the derivation of phase transformation models in steels which entails a general method to identify transformation strains with orientation relationships. In Section 3, we apply our unified approach to deduce the KS and NW transformation strains and orientation relationships; we also comment on how the obtained ORs relate to other common descriptions of the NW and KS ORs and show how the additional knowledge of the strains can be used to unambiguously determine twin relationships between KS variants. At the end of Section 3, we illustrate how according to our unified approach the KS and NW ORs change with increasing ratio of tetragonality r of the α' phase. In Section 4, we indicate how the same

methods can be used to explain and generalise the Pitsch (P), Greninger- Troiano (GT) and inverse Greninger-Troiano (GT') OR models.

Preliminaries

Let us consider an orthonormal basis $\{\mathbf{f}_1, \mathbf{f}_2, \mathbf{f}_3\}$. By $[abc] = \frac{a\mathbf{f}_1 + b\mathbf{f}_2 + c\mathbf{f}_3}{\sqrt{a^2 + b^2 + c^2}}$ we denote a normalised direction expressed in this basis.² Similarly, by (abc) we denote a normal in the same basis.³ For $\mathbf{u} = [u_1 \ u_2 \ u_3]$ and $\mathbf{v} = [v_1 \ v_2 \ v_3]$ we denote by $\mathbf{u} \cdot \mathbf{v}$ the inner product, by $|\mathbf{u}|$ the norm and by $\mathbf{u} \times \mathbf{v}$ the cross product. That is $\mathbf{u} \cdot \mathbf{v} = u_1 v_1 + u_2 v_2 + u_3 v_3$, $|\mathbf{u}| = \sqrt{\mathbf{u} \cdot \mathbf{u}}$ and $\mathbf{u} \times \mathbf{v} = (u_2 v_3 - u_3 v_2)\mathbf{f}_1 + (u_3 v_1 - u_1 v_3)\mathbf{f}_2 + (u_1 v_2 - u_2 v_1)\mathbf{f}_3$. We also recall the identities

$$(\mathbf{m} \times \mathbf{u}) \cdot (\mathbf{n} \times \mathbf{v}) = (\mathbf{m} \cdot \mathbf{n})(\mathbf{u} \cdot \mathbf{v}) - (\mathbf{u} \cdot \mathbf{n})(\mathbf{v} \cdot \mathbf{m}) \quad (1)$$

and

$$A\mathbf{u} \times A\mathbf{v} = \text{cof } A (\mathbf{u} \times \mathbf{v}), \quad (2)$$

where A is a 3×3 matrix. In particular, the matrix of cofactors, $\text{cof } A$, measures how a vector normal to \mathbf{u} and \mathbf{v} deforms whenever \mathbf{u} and \mathbf{v} are deformed by A . If A is invertible it holds that $\text{cof } A = A^{-T} \det A$, where as usual A^{-T} denotes the inverse of the transpose.

We end this section by summarising some important properties of rotation matrices, i.e. 3×3 matrices R such that $R^T R = \mathbb{I}$ and $\det R = 1$. Any rotation matrix R can be uniquely identified as a counterclockwise rotation by an angle ϕ about a vector \mathbf{u} and we write $R = R[\phi, \mathbf{u}]$, where \mathbf{u} is always expressed in the standard basis $\mathbf{e}_1 = (1, 0, 0)^T$, $\mathbf{e}_2 = (0, 1, 0)^T$, $\mathbf{e}_3 = (0, 0, 1)^T$. The magnitude of the angle of rotation is given by $|\phi| = \arccos((\text{Tr } R - 1)/2)$, where $\text{Tr } R = \sum_{i=1}^3 R_{ii}$ is the trace of the matrix R and the sign of ϕ is given by $\text{sgn}(\phi) = \text{sgn}((\mathbf{n} \times R\mathbf{n}) \cdot \mathbf{u})$, where \mathbf{n} is any vector that is not parallel to the axis of rotation \mathbf{u} . In particular, reversing the sign of the axis $\mathbf{u} \rightarrow -\mathbf{u}$ is equivalent to reversing the sign of the angle of rotation $\phi \rightarrow -\phi$. Finally, by \mathcal{P}^{24} we denote the group of rotations that map a cube to itself (see Appendix) and we call two vectors \mathbf{n}, \mathbf{n}' *crystallographically equivalent* iff $\mathbf{n}' = P\mathbf{n}$ for some $P \in \mathcal{P}^{24}$.

2. A unified approach to phase transformation models in steels

Since Bain's seminal paper [Bai24] (see also [KM16] for a rigorous mathematical justification) it is well known that the pure stretches required to transform an fcc

² As is commonly asserted in the literature, we make the identification $-a = \bar{a}$. ³ Note that since $\{\mathbf{f}_1, \mathbf{f}_2, \mathbf{f}_3\}$ is an orthonormal basis it coincides with its reciprocal basis, i.e. $[abc] = (abc)$.

lattice to a bcc/bct lattice are given by the three Bain strains

$$B_1 = \begin{pmatrix} \beta & 0 & 0 \\ 0 & \alpha & 0 \\ 0 & 0 & \alpha \end{pmatrix}, B_2 = \begin{pmatrix} \alpha & 0 & 0 \\ 0 & \beta & 0 \\ 0 & 0 & \alpha \end{pmatrix}, B_3 = \begin{pmatrix} \alpha & 0 & 0 \\ 0 & \alpha & 0 \\ 0 & 0 & \beta \end{pmatrix}, \quad (3)$$

where $\alpha = \frac{\sqrt{2}a}{a_0}$ and $\beta = \frac{c}{a_0}$. Here a_0 is the lattice parameter of the fcc phase and $c \geq a$ are the lattice parameters of the bct phase ($a = c$ for bcc). An additional rigid body rotation R does not change the bcc/bct lattice structure and hence any lattice transformation T from fcc to bcc/bct is of the form

$$T = RB_i \text{ for some } i = 1, 2, 3.$$

Now suppose that the transformation T leaves a plane with normal \mathbf{n} and a direction \mathbf{v} within that plane unrotated, i.e.

$$\frac{\text{cof } T \mathbf{n}}{|\text{cof } T \mathbf{n}|} = R \frac{\text{cof } B_i \mathbf{n}}{|\text{cof } B_i \mathbf{n}|} = \mathbf{n} \text{ and } \frac{T \mathbf{v}}{|T \mathbf{v}|} = R \frac{B_i \mathbf{v}}{|B_i \mathbf{v}|} = \mathbf{v}. \quad (4)$$

Defining $\mathbf{m}_i = \text{cof } B_i \mathbf{n} / |\text{cof } B_i \mathbf{n}|$, $\mathbf{u}_i = B_i \mathbf{v} / |B_i \mathbf{v}|$, we observe that

$$\mathbf{m}_i \cdot \mathbf{u}_i \propto \text{cof } B_i \mathbf{n} \cdot B_i \mathbf{v} = B_i^T \text{cof } B_i \mathbf{n} \cdot \mathbf{v} \propto \mathbf{n} \cdot \mathbf{v} = 0,^4$$

where we have used that $\text{cof } B_i \propto B_i^{-T}$ and that $\mathbf{v} \perp \mathbf{n}$. In particular, the pairs $\mathbf{m}_i, \mathbf{u}_i$ and \mathbf{n}, \mathbf{v} are both orthonormal and thus there is a unique rotation $R = R_i$ such that $R_i \mathbf{m}_i = \mathbf{n}$ and $R_i \mathbf{u}_i = \mathbf{v}$ given by

$$R_i = \begin{pmatrix} | & | & | \\ \mathbf{n} & \mathbf{v} & \mathbf{n} \times \mathbf{v} \\ | & | & | \end{pmatrix} \begin{pmatrix} - & \mathbf{m}_i & - \\ - & \mathbf{u}_i & - \\ - & \mathbf{m}_i \times \mathbf{u}_i & - \end{pmatrix}. \quad (5)$$

Consequently, for each $i = 1, 2, 3$ there is exactly one transformation strain, $T_i = R_i B_i$, from fcc to bcc/bct that leaves the plane with normal \mathbf{n} and the direction \mathbf{v} within that plane unrotated.

Identifying strains with orientation relationships

Given the transformation strain T_i , we show how to compute the corresponding orientation relationship (OR). For simplicity, we focus on the case $i = 2$; the remaining two cases can be treated analogously. From the pure Bain mechanism it is clear that the transformation B_2 results in a bcc/bct unit cell with edges along the directions $\mathbf{e}_1 - \mathbf{e}_3$, \mathbf{e}_2 and $\mathbf{e}_1 + \mathbf{e}_3$ (see Figure 1). The additional rotation R_2 in the transformation T_2 then results in a bcc/bct unit cell with edges along the directions

$$R_2(\mathbf{e}_1 - \mathbf{e}_3), R_2 \mathbf{e}_2 \text{ and } R_2(\mathbf{e}_1 + \mathbf{e}_3),$$

⁴ Recall that $x \propto y$ if there is a constant c such that $x = cy$.

which form the natural basis for the bcc/bct lattice. Noting that $\mathbf{e}_1 - \mathbf{e}_3 = R[45^\circ, \mathbf{e}_2]\mathbf{e}_1$

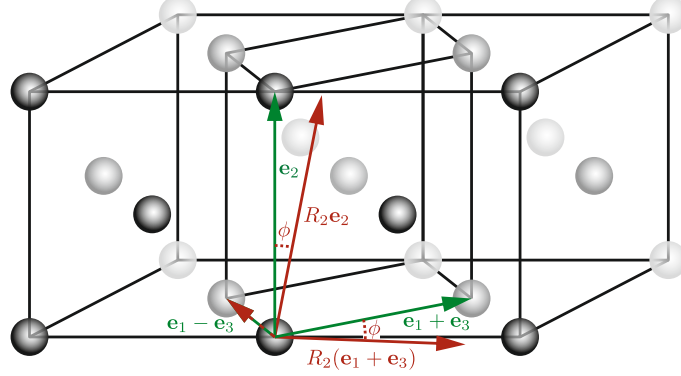


Figure 1: The green vectors $\mathbf{e}_1 - \mathbf{e}_3$, \mathbf{e}_2 , $\mathbf{e}_1 + \mathbf{e}_3$ are along the edges of the tetragonal bct cell that is contained in the fcc lattice and the red vectors are obtained through the rotation R_2 .

and $\mathbf{e}_1 + \mathbf{e}_3 = R[45^\circ, \mathbf{e}_2]\mathbf{e}_3$ we see that the change of basis matrix between fcc and bcc/bct is given by $R_2 R[45^\circ, \mathbf{e}_2]$, i.e. $\mathbf{x} = [x_1 \ x_2 \ x_3]_\gamma = [\hat{x}_1 \ \hat{x}_2 \ \hat{x}_3]_{\alpha'}$, where

$$\begin{pmatrix} \hat{x}_1 \\ \hat{x}_2 \\ \hat{x}_3 \end{pmatrix} = R[-45^\circ, \mathbf{e}_2] R_2^T \begin{pmatrix} x_1 \\ x_2 \\ x_3 \end{pmatrix} =: O_2 \begin{pmatrix} x_1 \\ x_2 \\ x_3 \end{pmatrix}. \quad (6)$$

In particular, through the matrix $O_2 = R[-45^\circ, \mathbf{e}_2] R_2^T$ one can express the coordinates of the unrotated plane \mathbf{n} and direction \mathbf{v} in the new bcc/bct (α' -) basis and hence determine the *orientation relationship*. In general, the orientation relationship corresponding to $T_i = R_i B_i$ is given through the matrix

$$O_i = R[-45^\circ, \mathbf{e}_i] R_i^T, \quad (7)$$

which we henceforth call the *orientation relationship matrix*. We note that $R[45^\circ, \mathbf{e}_i] = R[90^\circ, \mathbf{e}_i] R[-45^\circ, \mathbf{e}_i]$ with $R[90^\circ, \mathbf{e}_i] \in \mathcal{P}^{24}$, i.e. choosing the opposite sign for the 45° rotation about \mathbf{e}_i simply leads to a crystallographically equivalent normal and direction. In summary, starting from the transformation T_i , we obtain the *orientation relationship*

$$(n_1 \ n_2 \ n_3)_\gamma \parallel (\hat{n}_1 \ \hat{n}_2 \ \hat{n}_3)_{\alpha'} \text{ and } [v_1 \ v_2 \ v_3]_\gamma \parallel [\hat{v}_1 \ \hat{v}_2 \ \hat{v}_3]_{\alpha'}, \quad (8)$$

where the coordinates \hat{n}_i and \hat{v}_i are obtained by using the *orientation relationship matrix* O_i from (7) in (6).

Conversely, suppose that an OR of the form (8) is given with the property that the normal $(n_1 \ n_2 \ n_3)_\gamma$ and the direction $[v_1 \ v_2 \ v_3]_\gamma$ are left unrotated by the transformation. By the above process, we can compute three possible transformation strains T_i and corresponding OR matrices O_i . For each OR matrix O_i we can calculate the bcc/bct coordinates of $(n_1 \ n_2 \ n_3)_\gamma$ and $[v_1 \ v_2 \ v_3]_\gamma$. For one of the ma-

trices O_i , the calculated coordinates must agree, up to crystallographic equivalence, with the given OR and, hence, we may uniquely identify the Bain variant B_i , and the corresponding transformation strain T_i , that gives rise to the OR. If the coordinates do not agree for any O_i , then the OR cannot be compatible with the Bain mechanism.

Generating variants through crystallographic equivalence in the γ phase

Given a transformation strain T (or equivalently the corresponding OR matrix O) we are able to generate further variants of T through the application of \mathcal{P}^{24} in the reference configuration. To this end, we recall that given the fcc basis $\{\mathbf{e}_1, \mathbf{e}_2, \mathbf{e}_3\}$, all crystallographically equivalent fcc bases are given by $\{P\mathbf{e}_1, P\mathbf{e}_2, P\mathbf{e}_3\}$ for $P \in \mathcal{P}^{24}$. Thus, letting T as in (4) and using the identity $P_i^T P_i = \mathbb{I}$ we infer that

$$\frac{\text{cof}(P_i T P_i^T) P_i \mathbf{n}}{|\text{cof } T \mathbf{n}|} = P_i \mathbf{n} \text{ and } \frac{(P_i T P_i^T) P_i \mathbf{v}}{|T \mathbf{v}|} = P_i \mathbf{v}.$$

That is, for each $i = 1, 2, \dots, 24$, the deformation $P_i T P_i^T$ leaves the plane with normal $P_i \mathbf{n}$ and the direction $P_i \mathbf{v}$ within that plane unrotated and thus describes a *strain variant* of the original transformation strain T . Similarly, $P_i O P_i^T$ describes the corresponding *orientation relationship variant*. We note that in general, it may happen (see e.g. the NW model) that $P_i T P_i^T = P_j T P_j^T$ for some $i \neq j$ and thus there can be less than 24 distinct variants for a given transformation strain (or equivalently for a given OR).

3. The NW and KS models

In this section, we derive the NW and KS models. Both models have the attractive feature of leaving a close-packed $\{111\}_\gamma$ plane and a close-packed $\langle \bar{1}10 \rangle$ direction within that plane unrotated. Owing to this feature they seem to be the most natural candidates for OR models. To carry out the derivation we apply our unified approach from Section 2 with

$$\mathbf{n} = (111)_\gamma \text{ and } \mathbf{v} = [10\bar{1}]_\gamma.$$

The transformation with stretch component B_2

Let us consider the second Bain variant B_2 . Noting that \mathbf{v} is an eigenvector of B_2 , we immediately deduce that, by (4), $R_2 \mathbf{v} = \mathbf{v}$ and thus \mathbf{v} is the axis of rotation. Regarding the angle of rotation we calculate

$$\text{Tr } R_2 = \mathbf{m}_2 \cdot \mathbf{n} + \mathbf{u}_2 \cdot \mathbf{v} + (\mathbf{m}_2 \times \mathbf{u}_2) \cdot (\mathbf{n} \times \mathbf{v}) = 2\mathbf{m}_2 \cdot \mathbf{n} + 1,$$

where we used that $\mathbf{u}_2 = \mathbf{v}$ and (1). Hence, the angle of rotation is given by

$$\arccos\left(\frac{\text{cof } B_2 \mathbf{n} \cdot \mathbf{n}}{|\text{cof } B_2 \mathbf{n}|}\right) \text{sgn}((\mathbf{m}_2 \times \mathbf{n}) \cdot \mathbf{v}) = \arccos\left(\frac{1 + \sqrt{2}r}{\sqrt{3}\sqrt{1+r^2}}\right) =: \phi(r), \quad (9)$$

where $r = c/a = \sqrt{2}\beta/\alpha$ is the ratio of tetragonality of the bct cell. In particular, for $r = 1$ corresponding to a bcc product lattice we obtain $\phi(1) = \arccos\left(\frac{1+\sqrt{2}}{\sqrt{6}}\right) \approx 9.7356^\circ$.

Hence, the only transformation from fcc to bcc/bct with stretch component B_2 which leaves the plane $(111)_\gamma$ and the direction $[10\bar{1}]_\gamma$ unrotated is

$$T_2 = R_2 B_2 = R[\phi(r), [10\bar{1}]] B_2. \quad (10)$$

Regarding the orientation relationships corresponding to T_2 , through (10) and (7), we infer that $O_2 = R[-45^\circ, \mathbf{e}_2] R[-\phi(r), [10\bar{1}]]$ (cf. Figure 1). Consequently,

$$(111)_\gamma \parallel (01r)_{\alpha'} \text{ and } [10\bar{1}]_\gamma \parallel [100]_{\alpha'}. \quad (11)$$

Note that, as expected, the latter is a closest packed plane in the resulting bct lattice containing the bct direction $[100]_{\alpha'}$. Thus for $r = 1$ (bcc) the transformation T_2 gives rise to the OR NW1 (see Table 1) and henceforth we denote $T_2 = T_{\text{NW1}}$. The OR matrix O_{NW1} between fcc and bcc is given by

$$O_{\text{NW1}} = R[-45^\circ, \mathbf{e}_2] R[-9.7356^\circ, [10\bar{1}]] \approx \begin{pmatrix} 0.7071 & 0 & -0.7071 \\ 0.1196 & 0.9856 & 0.1196 \\ 0.6969 & -0.1691 & 0.6969 \end{pmatrix},$$

and the corresponding transformation T_{NW1} is given by

$$T_{\text{NW1}} = R[9.7356^\circ, [10\bar{1}]] B_2 \approx \begin{pmatrix} 1.1144 & 0.0949 & -0.0081 \\ -0.1342 & 0.7823 & -0.1342 \\ -0.0081 & 0.0949 & 1.1144 \end{pmatrix}.$$

Next, we characterize the remaining NW variants. Following our unified approach, they are given by $P_i T_{\text{NW1}} P_i^T$. Since $T_{\text{NW1}} = R[\phi(r), [10\bar{1}]] B_2$, $P_2 [10\bar{1}]_\gamma = [10\bar{1}]_\gamma$ and $P_2 B_2 P_2^T = B_2$ we deduce that $P_2 T_{\text{NW1}} P_2^T = T_{\text{NW1}}$ and similarly that $P_{2j} T_{\text{NW1}} P_{2j}^T = P_{2j-1} T_{\text{NW1}} P_{2j-1}^T$ for any $j = 2, \dots, 12$. Thus there are only 12 NW strain variants given by

$$T_{\text{NW}j} := P_{2j-1} T_{\text{NW1}} P_{2j-1}^T = R[\phi(r), P_{2j-1} [10\bar{1}]] P_{2j-1} B_2 P_{2j-1}^T,$$

for $j = 1, 2, \dots, 12$. In particular, $T_{\text{NW}j}$ has a stretch component $P_{2j-1} B_2 P_{2j-1}^T$ followed by a rotation of $\phi(r)$ about $P_{2j-1} [10\bar{1}]_\gamma$. The corresponding OR matrices are obtained by the same conjugation. That is

$$O_{\text{NW}j} = P_{2j-1} O_{\text{NW1}} P_{2j-1}^T = R[-45^\circ, P_{2j-1} \mathbf{e}_2] R[-\phi(r), P_{2j-1} [10\bar{1}]],$$

for $j = 1, 2, \dots, 12$. Thus, by (11), O_{NWj} maps the fcc normal $P_{2j-1}\mathbf{n}$ and fcc vector $P_{2j-1}\mathbf{v}$ to the bcc/bct normal $P_{2j-1}(01r)_{\alpha'}$ and the bcc/bct direction $P_{2j-1}[100]_{\alpha'}$ (see Table A1 in the Appendix). It is easy to verify that, for $r = 1$, the resulting bcc vectors are crystallographically equivalent (through P_{2j-1}^T) to the bcc vector $[100]_{\alpha'}$ and the bcc normal $(011)_{\alpha'}$, giving the NW variants as in Table 1. We note that the choice of sign for the 45° rotation about \mathbf{e}_2 , as well as the enumeration of \mathcal{P}^{24} , has been carefully made so that the OR NW j is obtained through P_{2j-1}^T . A choice of the opposite sign and/or a different enumeration of \mathcal{P}^{24} , will not alter the result but will lead to bcc/bct coordinates that are crystallographically equivalent to the ones in Table 1 through different elements of \mathcal{P}^{24} .

Table 1: The NW orientation relationships. The corresponding variants in each row are given by $T_{NWj} = R[\phi(r), \mathbf{v}_j] B_j$.

O.R. ^a	fcc plane ^b	bcc plane	fcc direction ^c	bcc direction	Bain Variant ^d
NW1	$(111)_\gamma$	$(011)_{\alpha'}$	$[10\bar{1}]_\gamma$	$[100]_{\alpha'}$	B_2
NW2	$(111)_\gamma$	$(011)_{\alpha'}$	$[\bar{1}10]_\gamma$	$[100]_{\alpha'}$	B_3
NW3	$(111)_\gamma$	$(011)_{\alpha'}$	$[0\bar{1}1]_\gamma$	$[100]_{\alpha'}$	B_1
NW4	$(\bar{1}11)_\gamma$	$(011)_{\alpha'}$	$[101]_\gamma$	$[100]_{\alpha'}$	B_2
NW5	$(\bar{1}11)_\gamma$	$(011)_{\alpha'}$	$[\bar{1}\bar{1}0]_\gamma$	$[100]_{\alpha'}$	B_3
NW6	$(\bar{1}11)_\gamma$	$(011)_{\alpha'}$	$[01\bar{1}]_\gamma$	$[100]_{\alpha'}$	B_1
NW7	$(1\bar{1}1)_\gamma$	$(011)_{\alpha'}$	$[\bar{1}01]_\gamma$	$[100]_{\alpha'}$	B_2
NW8	$(1\bar{1}1)_\gamma$	$(011)_{\alpha'}$	$[110]_\gamma$	$[100]_{\alpha'}$	B_3
NW9	$(1\bar{1}1)_\gamma$	$(011)_{\alpha'}$	$[0\bar{1}\bar{1}]_\gamma$	$[100]_{\alpha'}$	B_1
NW10	$(11\bar{1})_\gamma$	$(011)_{\alpha'}$	$[\bar{1}0\bar{1}]_\gamma$	$[100]_{\alpha'}$	B_2
NW11	$(11\bar{1})_\gamma$	$(011)_{\alpha'}$	$[1\bar{1}0]_\gamma$	$[100]_{\alpha'}$	B_3
NW12	$(11\bar{1})_\gamma$	$(011)_{\alpha'}$	$[011]_\gamma$	$[100]_{\alpha'}$	B_1

^a NW j ^b $P_{2j-1}(111)_\gamma$ ^c $\mathbf{v}_j = P_{2j-1}[10\bar{1}]_\gamma$ ^d $B_j = P_{2j-1}B_2P_{2j-1}^T$

The transformation with stretch component B_3

Similarly, using B_3 instead of B_2 in (4) gives rise to a rotation R_3 satisfying

$$R_3\mathbf{m}_3 = \mathbf{n} \text{ and } R_3\mathbf{u}_3 = \mathbf{v}. \quad (12)$$

Noting that $R_{NW2}\mathbf{m}_3 = \mathbf{n}$ we immediately see that $R_3 R_{NW2}^T \mathbf{n} = \mathbf{n}$ and

$$R_3 = R[\theta, \mathbf{n}] R_{NW2} = R[\theta, [111]] R[\phi(r), [\bar{1}10]]$$

for some angle $\theta = \theta(r)$. Let us first determine the sign of $\theta(r)$. By (12), we have that $R[\theta, \mathbf{n}] R_{NW2}\mathbf{u}_3 = \mathbf{v}$ and thus $\text{sgn } \theta(r) = \text{sgn}(R_{NW2}\mathbf{u}_3 \times \mathbf{v}) \cdot \mathbf{n} = 1$. For the angle

itself we deduce from (5) that

$$\theta(r) = \arccos\left(\frac{\text{Tr } R[\theta, \mathbf{n}] - 1}{2}\right) = \arccos\left(\frac{\sqrt{3}\sqrt{r^2 + 1} + 1}{2\sqrt{r^2 + 2}}\right). \quad (13)$$

For $r = 1$ (bcc) this angle is given by $\theta(1) = \arccos\left(\frac{1+\sqrt{6}}{2\sqrt{3}}\right) \approx 5.2644^\circ$. Hence, the only transformation from fcc to bcc/bct with stretch component B_3 which leaves the plane $(111)_\gamma$ and the direction $[10\bar{1}]_\gamma$ unrotated is

$$T_3 = R_3 B_3 = R[\theta(r), [111]] R[\phi(r), [\bar{1}10]] B_3. \quad (14)$$

Regarding the corresponding orientation relationships, by (7), we deduce that

$$O_3 = R[45^\circ, \mathbf{e}_3] R[-\phi(r), [\bar{1}10]] R[-\theta(r), [111]] \quad (15)$$

and, consequently,

$$(111)_\gamma \parallel (0r1)_{\alpha'} \text{ and } [10\bar{1}]_\gamma \parallel [11\bar{r}]_{\alpha'}. \quad (16)$$

These correspond to a closest packed plane in the resulting bcc/bct lattice and the close packed direction in that plane. Clearly, for $r = 1$ (bcc), the transformation T_3 gives rise to the OR KS1 (see Table 2) and henceforth we denote $T_3 = T_{\text{KS1}}$. The OR matrix O_{KS1} between fcc and bcc is then given by

$$\begin{aligned} O_{\text{KS1}} &= R[45^\circ, \mathbf{e}_3] R[-9.7356^\circ, [\bar{1}10]] R[-5.2644^\circ, [111]] \\ &\approx \begin{pmatrix} 0.7416 & -0.6667 & -0.0749 \\ 0.6498 & 0.7416 & -0.1667 \\ 0.1667 & 0.07492 & 0.9832 \end{pmatrix} \end{aligned}$$

and the transformation strain by

$$T_{\text{KS1}} = R[5.2644^\circ, [111]] R[9.7356^\circ, [\bar{1}10]] B_3 \approx \begin{pmatrix} 1.1044 & -0.0728 & 0.1323 \\ 0.0595 & 1.1177 & 0.0595 \\ -0.1917 & -0.0728 & 0.7803 \end{pmatrix}.$$

The remaining KS strain variants are $T_{\text{KS}j} := P_j T_{\text{KS1}} P_j^T$ and by (14) they are given by

$$T_{\text{KS}j} = R[\theta(r), P_j[111]] R[\phi(r), P_j[\bar{1}10]] P_j B_3 P_j^T.$$

In particular, $T_{\text{KS}j}$ leaves the close packed plane $P_j \mathbf{n}$ and the close packed direction $P_j \mathbf{v}$ within that plane unrotated. The corresponding OR variants are given by $O_{\text{KS}j} = P_j O_{\text{KS1}} P_j^T$ and $O_{\text{KS}j}$ maps the fcc normal $P_j \mathbf{n}$ and fcc direction $P_j \mathbf{v}$ to the bcc/bct normal $P_j(0r1)_{\alpha'}$ and the bcc/bct direction $P_j[11\bar{r}]_{\alpha'}$ (see Table A2 in the Appendix).

The transformation with stretch component B_1

Let us, for example, consider $P = P_2$. Then

$$P_2 \mathbf{n} = -\mathbf{n}, P_2 \mathbf{v} = \mathbf{v} \text{ and } P_2 B_3 P_2^T = B_1$$

and thus $T_{\text{KS2}} = R[-\theta(r), [111]] R[\phi(r), [\bar{1}10]] B_1$ is the only transformation with stretch component B_1 that leaves the close packed plane $(111)_\gamma$ and the close packed direction $[10\bar{1}]_\gamma$ unrotated. It is therefore the third and last solution of (4).

Just like in the derivation of the NW variants, care has been taken so that all odd $\text{KS}(2j-1)$ variants correspond immediately to the entries in Table 2 and the crystallographic equivalence in the bcc/bct lattice is given by P_{2j-1}^T . However, unlike the NW variants, $T_{\text{KS2}} = P_2 T_{\text{KS1}} P_2^T \neq T_{\text{KS1}}$ are distinct and thus the ORs are different. To illustrate this, let us take $O_{\text{KS2}} = P_2 O_{\text{KS1}} P_2^T$ and investigate its action on the fcc plane with normal $\mathbf{n} = (111)_\gamma$ and the fcc direction $\mathbf{v} = [10\bar{1}]_\gamma$. We have

$$\begin{aligned} O_{\text{KS2}} \mathbf{n} &= P_2 O_{\text{KS1}} (-\mathbf{n}) = -P_2 (0r1)_{\alpha'} = (1r0)_{\alpha'} \\ \text{and } O_{\text{KS2}} \mathbf{v} &= P_2 O_{\text{KS1}} \mathbf{v} = P_2 [11\bar{r}]_{\alpha'} = [r\bar{1}\bar{1}]_{\alpha'}, \end{aligned} \quad (17)$$

which are the closest packed plane and close packed direction in that plane in the resulting bct lattice. If $r = 1$ (bcc), noting that $P_3 (1r0)_{\alpha'} = (01r)_{\alpha'}$ and $P_3 [r\bar{1}\bar{1}]_{\alpha'} = [\bar{1}r\bar{1}]_{\alpha'}$ we obtain, up to crystallographic equivalence in the bcc lattice (by P_3)⁵ the OR associated to KS2 (cf. Table 2). The ORs for the remaining even $\text{KS}(2j)$ are obtained analogously and the required crystallographic equivalence transformation in the bcc lattice is given by $P_3 P_{2j}^T$. Figure 2 shows the relations between all Bain, NW and KS variants.

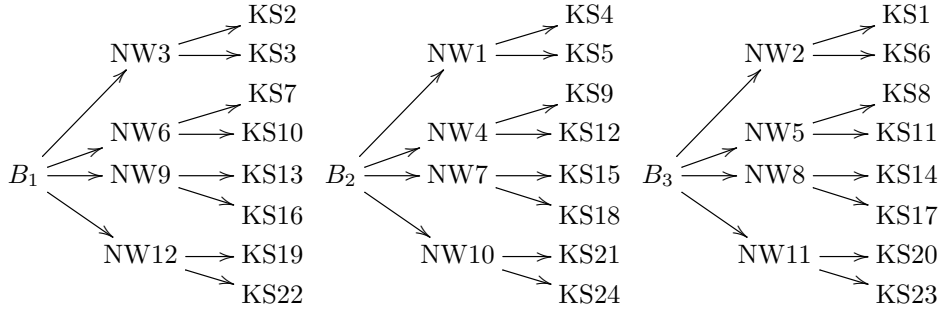


Figure 2: An arrow from a Bain variant B_k to an NW variant $\text{NW}j$ signifies that $T_{\text{NW}j} = R[\phi(r), \mathbf{v}_j] B_k$ (cf. Table 1). Respectively, an arrow from an NW variant $\text{NW}j$ to a KS variant $\text{KS}i$ signifies that $T_{\text{KS}i} = R[(-1)^{i+1}\theta(r), \mathbf{n}_i] T_{\text{NW}j}$ (cf. Table 2).

⁵ Nevertheless, P_3 is not a lattice invariant rotation for the resulting bct lattice.

Table 2: The KS orientation relationships. The corresponding variants in each row are given by $T_{KSj} = R[(-1)^{j+1}\theta(r), \mathbf{n}_j] R[\phi(r), P_j[\bar{1}10]] B_j$.

O.R. ^a	fcc plane ^b	bcc plane	fcc direction ^c	bcc direction	Bain Variant ^d
KS1	$(111)_\gamma$	$(011)_{\alpha'}$	$[10\bar{1}]_\gamma$	$[11\bar{1}]_{\alpha'}$	B_3
KS2	$(111)_\gamma$	$(011)_{\alpha'}$	$[10\bar{1}]_\gamma$	$[\bar{1}1\bar{1}]_{\alpha'}$	B_1
KS3	$(111)_\gamma$	$(011)_{\alpha'}$	$[\bar{1}10]_\gamma$	$[11\bar{1}]_{\alpha'}$	B_1
KS4	$(111)_\gamma$	$(011)_{\alpha'}$	$[\bar{1}10]_\gamma$	$[\bar{1}1\bar{1}]_{\alpha'}$	B_2
KS5	$(111)_\gamma$	$(011)_{\alpha'}$	$[0\bar{1}1]_\gamma$	$[11\bar{1}]_{\alpha'}$	B_2
KS6	$(111)_\gamma$	$(011)_{\alpha'}$	$[0\bar{1}1]_\gamma$	$[\bar{1}1\bar{1}]_{\alpha'}$	B_3
KS7	$(\bar{1}11)_\gamma$	$(011)_{\alpha'}$	$[101]_\gamma$	$[11\bar{1}]_{\alpha'}$	B_1
KS8	$(\bar{1}11)_\gamma$	$(011)_{\alpha'}$	$[101]_\gamma$	$[\bar{1}1\bar{1}]_{\alpha'}$	B_3
KS9	$(\bar{1}11)_\gamma$	$(011)_{\alpha'}$	$[\bar{1}\bar{1}0]_\gamma$	$[11\bar{1}]_{\alpha'}$	B_2
KS10	$(\bar{1}11)_\gamma$	$(011)_{\alpha'}$	$[\bar{1}\bar{1}0]_\gamma$	$[\bar{1}1\bar{1}]_{\alpha'}$	B_1
KS11	$(\bar{1}11)_\gamma$	$(011)_{\alpha'}$	$[01\bar{1}]_\gamma$	$[11\bar{1}]_{\alpha'}$	B_3
KS12	$(\bar{1}11)_\gamma$	$(011)_{\alpha'}$	$[01\bar{1}]_\gamma$	$[\bar{1}1\bar{1}]_{\alpha'}$	B_2
KS13	$(1\bar{1}1)_\gamma$	$(011)_{\alpha'}$	$[\bar{1}01]_\gamma$	$[11\bar{1}]_{\alpha'}$	B_1
KS14	$(1\bar{1}1)_\gamma$	$(011)_{\alpha'}$	$[\bar{1}01]_\gamma$	$[\bar{1}1\bar{1}]_{\alpha'}$	B_3
KS15	$(1\bar{1}1)_\gamma$	$(011)_{\alpha'}$	$[110]_\gamma$	$[11\bar{1}]_{\alpha'}$	B_2
KS16	$(1\bar{1}1)_\gamma$	$(011)_{\alpha'}$	$[110]_\gamma$	$[\bar{1}1\bar{1}]_{\alpha'}$	B_1
KS17	$(1\bar{1}1)_\gamma$	$(011)_{\alpha'}$	$[0\bar{1}\bar{1}]_\gamma$	$[11\bar{1}]_{\alpha'}$	B_3
KS18	$(1\bar{1}1)_\gamma$	$(011)_{\alpha'}$	$[0\bar{1}\bar{1}]_\gamma$	$[\bar{1}1\bar{1}]_{\alpha'}$	B_2
KS19	$(11\bar{1})_\gamma$	$(011)_{\alpha'}$	$[\bar{1}0\bar{1}]_\gamma$	$[11\bar{1}]_{\alpha'}$	B_1
KS20	$(11\bar{1})_\gamma$	$(011)_{\alpha'}$	$[\bar{1}0\bar{1}]_\gamma$	$[\bar{1}1\bar{1}]_{\alpha'}$	B_3
KS21	$(11\bar{1})_\gamma$	$(011)_{\alpha'}$	$[1\bar{1}0]_\gamma$	$[11\bar{1}]_{\alpha'}$	B_2
KS22	$(11\bar{1})_\gamma$	$(011)_{\alpha'}$	$[1\bar{1}0]_\gamma$	$[\bar{1}1\bar{1}]_{\alpha'}$	B_1
KS23	$(11\bar{1})_\gamma$	$(011)_{\alpha'}$	$[011]_\gamma$	$[11\bar{1}]_{\alpha'}$	B_3
KS24	$(11\bar{1})_\gamma$	$(011)_{\alpha'}$	$[011]_\gamma$	$[\bar{1}1\bar{1}]_{\alpha'}$	B_2

^a KSj ^b $\mathbf{n}_j = (-1)^{j+1} P_j(111)_\gamma$ ^c $P_j[10\bar{1}]_\gamma$ ^d $B_j = P_j B_3 P_j^T$

3.1. Relation to other descriptions

In the literature (see e.g. [KMD76, RJ90, Bun13]) the NW ORs are sometimes described as $\zeta = \arccos\left(\frac{1}{\sqrt{6}} - \frac{1}{2}\right) \approx 95.264^\circ$ rotations about $\langle hkl \rangle$ where $[hkl] = [1 + \sqrt{2} + \sqrt{3}, \sqrt{2}, -1 + \sqrt{2} + \sqrt{3}]$ and the KS ORs as 90° rotations about $\langle 112 \rangle$. We show that these descriptions follow, up to crystallographic equivalence, from the above derivation. Let us start with the OR for NW1. With the choice $P_3 = R[120^\circ, [111]]$ we obtain

$$P_3 O_{NW1} = R[\zeta, [hkl]] \approx R[95.264^\circ, (0.85, 0.29, 0.44)]$$

and thus $P_{2j-1} P_3 O_{NW1} P_{2j-1}^T = P O_{NWj} = R[\zeta, P_{2j-1}[hkl]]$ for some⁶ $P \in \mathcal{P}^{24}$. That is, up to crystallographic equivalence in the bcc lattice, O_{NWj} is a $\zeta \approx 95.264^\circ$ rotation about $P_{2j-1}[hkl]$ (see Table 3). Next, let us consider the OR for KS1.

⁶ $P = P_3$ for $j \in \{1, 2, 3\}$, $P = P_{18}$ for $j \in \{4, 5, 6\}$, $P = P_{24}$ for $j \in \{7, 8, 9\}$ and $P = P_{12}$ for $j \in \{10, 11, 12\}$

OR	OR matrix	OR	OR matrix
NW1	$R[95.264^\circ, [hkl]]$	NW7	$R[95.264^\circ, [l\bar{k}h]]$
NW2	$R[95.264^\circ, [l\bar{h}k]]$	NW8	$R[95.264^\circ, [h\bar{l}k]]$
NW3	$R[95.264^\circ, [k\bar{l}h]]$	NW9	$R[95.264^\circ, [k\bar{h}l]]$
NW4	$R[95.264^\circ, [\bar{l}kh]]$	NW10	$R[95.264^\circ, [lk\bar{h}]]$
NW5	$R[95.264^\circ, [\bar{h}lk]]$	NW11	$R[95.264^\circ, [hl\bar{k}]]$
NW6	$R[95.264^\circ, [\bar{k}hl]]$	NW12	$R[95.264^\circ, [kh\bar{l}]]$

Table 3: The OR matrices corresponding to the NW orientation relationships. Here, $[hkl] = [1 + \sqrt{2} + \sqrt{3}, \sqrt{2}, -1 + \sqrt{2} + \sqrt{3}] \approx (0.85, 0.29, 0.44)$.

With the choice $P_{10} = R[-120^\circ, [1\bar{1}1]]$ we obtain

$$P_{10}O_{KS1} = R[90^\circ, [\bar{1}2\bar{1}]]$$

and thus $P_j P_{10} O_{KS1} P_j^T = P O_{KSj} = R[90^\circ, P_j[\bar{1}2\bar{1}]]$ for some⁷ $P \in \mathcal{P}^{24}$, i.e. up to crystallographic equivalence in the bcc lattice, O_{KSj} is a 90° rotation about $P_j[\bar{1}2\bar{1}]$ (see Table 4).

OR	OR matrix	OR	OR matrix
KS1	$R[+90^\circ, [\bar{1}2\bar{1}]]$	KS13	$R[+90^\circ, [\bar{1}\bar{2}\bar{1}]]$
KS2	$R[-90^\circ, [\bar{1}2\bar{1}]]$	KS14	$R[-90^\circ, [\bar{1}\bar{2}\bar{1}]]$
KS3	$R[+90^\circ, [\bar{1}\bar{1}2]]$	KS15	$R[+90^\circ, [\bar{1}\bar{1}2]]$
KS4	$R[-90^\circ, [\bar{1}\bar{1}2]]$	KS16	$R[-90^\circ, [\bar{1}\bar{1}2]]$
KS5	$R[+90^\circ, [2\bar{1}\bar{1}]]$	KS17	$R[+90^\circ, [2\bar{1}\bar{1}]]$
KS6	$R[-90^\circ, [2\bar{1}\bar{1}]]$	KS18	$R[-90^\circ, [2\bar{1}\bar{1}]]$
KS7	$R[+90^\circ, [12\bar{1}]]$	KS19	$R[+90^\circ, [\bar{1}2\bar{1}]]$
KS8	$R[-90^\circ, [12\bar{1}]]$	KS20	$R[-90^\circ, [\bar{1}2\bar{1}]]$
KS9	$R[+90^\circ, [1\bar{1}2]]$	KS21	$R[+90^\circ, [\bar{1}\bar{1}2]]$
KS10	$R[-90^\circ, [1\bar{1}2]]$	KS22	$R[-90^\circ, [\bar{1}\bar{1}2]]$
KS11	$R[+90^\circ, [\bar{2}\bar{1}\bar{1}]]$	KS23	$R[+90^\circ, [2\bar{1}\bar{1}]]$
KS12	$R[-90^\circ, [\bar{2}\bar{1}\bar{1}]]$	KS24	$R[-90^\circ, [2\bar{1}\bar{1}]]$

Table 4: The OR matrices corresponding to the KS orientation relationships.

3.2. Twin relationships between KS variants

The knowledge of the transformation strains allows one to unambiguously identify pairs of KS variants KS_k and KS_l that are twin related, i.e. variant pairs whose relative deformation is an invariant plane strain. That is

$$T_{KS_k} = T_{KS_l}(\mathbb{I} + \mathbf{b} \otimes \mathbf{m}),$$

where $\mathbf{b} \otimes \mathbf{m}$ is the 3×3 matrix with components $(\mathbf{b} \otimes \mathbf{m})_{ij} = b_i m_j$. In particular, this implies that a fully coherent interface of normal \mathbf{m} can be formed between the two phases. We show that this can only happen between the pairs $KS(2j-1)$ and

⁷ $P = P_j P_{10} P_j^T$

KS(2j) and whenever this is the case the lattices on either side of the interface are related by a 180° rotation about the common invariant fcc direction $P_{2j-1}[10\bar{1}] = \mathbf{v}_j$ (cf. Table 1). We start with KS1 and assume that

$$M_i := T_{KS_i} - T_{KS1} = P_i T_{KS1} P_i^T - T_{KS1} = \mathbf{b} \otimes \mathbf{m}. \quad (18)$$

Whenever P_i does not leave \mathbf{v}_1 invariant we have $(T_{KS_i} - T_{KS1})\mathbf{v}_1 \neq 0$ and $(T_{KS_i} - T_{KS1})P_i\mathbf{v}_1 \neq 0$ and thus $\mathbf{m} \parallel \mathbf{v}_1 \times P_i\mathbf{v}_1$. Similarly, whenever P_i does not leave $\mathbf{n}_1 = (111)_\gamma$ invariant, i.e. $i \geq 7$, we have⁸ $M_i^T \mathbf{n}_1 \neq 0$ and $M_i^T \mathbf{n}_i \neq 0$ and thus $\mathbf{b} \parallel \mathbf{n}_1 \times \mathbf{n}_i$, where $\mathbf{n}_i := P_i \mathbf{n}_1$. Hence for $i \geq 7$ it holds that

$$M_i^T \mathbf{n}_i \propto \mathbf{m} \otimes (\mathbf{n}_1 \times \mathbf{n}_i) \mathbf{n}_i = ((\mathbf{n}_1 \times \mathbf{n}_i) \cdot \mathbf{n}_i) \mathbf{m} = 0$$

and thus, since \mathbf{n}_i is an eigenvector of $T_{KS_i}^T$, it must also be an eigenvector of T_{KS1}^T . However, we know that this can only be the case for $i \leq 6$ (cf. Table 2), a contradiction. For the remaining cases, i.e. $2 \leq i \leq 6$, we have

$$M_i P_i \mathbf{v}_1 \propto \mathbf{b} (\mathbf{v}_1 \times P_i \mathbf{v}_1 \cdot P_i \mathbf{v}_1) = 0$$

and thus since $P_i \mathbf{v}_1$ is an eigenvector of T_{KS_i} it must also be an eigenvector of T_{KS1} which is again, unless $i = 2$, a contradiction. Finally,

$$T_{KS2} - T_{KS1} = P_2 T_{KS1} P_2^T - T_{KS1} = \frac{2^{1/6}}{\sqrt{3}} \mathbf{v}_1 \otimes [101],$$

where P_2 is a 180° rotation about the common fcc direction \mathbf{v}_1 . Through conjugation with P_{2j-1} we obtain that the relative deformations between T_{KS2j-1} and $T_{KS2j} = P_{2j-1} T_{KS2} P_{2j-1}^T$ are also invariant plane strains.

3.3. The influence of tetragonality on the orientation relationships

For many compositions of steel the α' -phase is not cubic ($r = 1$) but slightly tetragonal ($r > 1$). For instance, the addition of carbon leads to a ratio of tetragonality approximately given by

$$r = \frac{c}{a} = 1 + 0.045 \text{ wt \% C}, \quad (19)$$

for C in the range 0.4–2 wt % C (see [Rob53, WC62]).⁹ Similarly, the addition of nitrogen instead of carbon leads to a tetragonality ratio of

$$r = \frac{c}{a} = 0.995 + 0.0383 \text{ wt \% N},$$

for N in the range 0.6–2.9 wt % N (after Fig. 2.2 in [Nis78]). For small carbon content and certain Fe-Ni alloys, such as the Fe-30% Ni alloy investigated in [Nis34]

⁸ For an invertible matrix A , v is an eigenvector of $\text{cof } A$ iff it is an eigenvector of A^T . ⁹ Related experiments on Fe-7% Al-C in [WW71] showed that the tetragonality does not increase for carbon above 2%.

and [Was35], the α' -phase is likely to be cubic, however, alloying additional elements such as Cr, Mn or Ti leads again to a tetragonal α' -phase.

Our derivation in Section 3 takes the tetragonality of the α' -phase into account and the transformation strains, as well as the ORs, are derived for any ratio of tetragonality $1 \leq r < \sqrt{2}$.¹⁰ In particular, the angles of rotations $\phi(r)$ and $\theta(r)$ in (9) and (13) respectively decrease with increasing tetragonality and thus our theory predicts a narrower distribution of peaks in the pole figures. This prediction agrees very well with [RJ90] which summarises that “investigators have shown that the chemical composition of steel has a significant effect on the nature and sharpness of the final transformation texture” and that increasing alloy content (i.e. higher tetragonality) leads to sharper textures (see e.g. [RJ90, Fig. 11-16]). Figure 3 depicts the changes in the NW and KS ORs for different ratios of tetragonality obtained through (19) for a carbon content increasing from 0% to 2%.

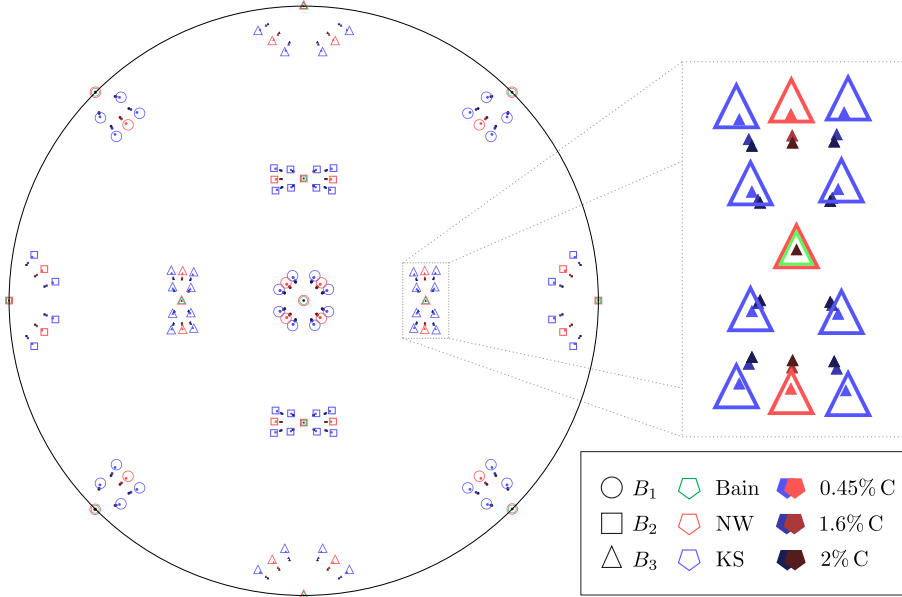


Figure 3: $\{100\}$ pole figures showing the change in the ORs with increasing carbon content. Hollow circles, squares and triangles correspond respectively to the fcc to bcc transformations with stretch components B_1 , B_2 and B_3 . The colours blue, red and green correspond respectively to KS, NW and Bain. The solid shapes correspond to increasing carbon content from lighter to darker shading and with values 0.45, 1.6 and 2 wt % C respectively.

4. Other orientation relationship models

In this section, we briefly comment on how our approach can be used to derive the Pitsch (see [Pit59]), Greninger-Troiano (GT) (see [GT49]) and inverse Greninger-Troiano GT' (see [HGJ06]) OR models.

¹⁰ Note that $r = \sqrt{2}$ corresponds to an fcc lattice and thus there is no phase transformation.

The Pitsch model

Following [Pit59] the Pitsch ORs (P) are given as

$$(110)_\gamma \parallel (\bar{1}\bar{1}\bar{2})_{\alpha'} \text{ and } [001]_\gamma \parallel [1\bar{1}0]_{\alpha'}.^{11} \quad (20)$$

Using our unified approach from Section 2 with $\mathbf{n} = (110)$ and $\mathbf{v} = [1\bar{1}0]$ we obtain $T_{P1} = R[-\psi(r), [001]]B_2$ and $O_{P1} = R[-45^\circ, \mathbf{e}_2]R[\psi(r), [001]]$, where $\psi(r) = \arccos\left(\frac{\sqrt{2+r}}{\sqrt{2}\sqrt{2+r^2}}\right)$. The remaining eleven Pitsch OR and strain variants are given through conjugation with \mathcal{P}^{24} . We note that for $r = 1$, $\psi(1) = \phi(1)$, where $\phi(r)$ is given by (9) in the derivation of the NW variants, and that $O_{P1} = O_{NW7}^T$ (similarly $O_{Pj} = O_{NW_i}^T$ for some i). If instead of (20) one uses the parallelisms $(010)_\gamma \parallel (101)_{\alpha'}$ and $[101]_\gamma \parallel [\bar{1}11]_{\alpha'}$ (as e.g. in [HGJ06, Nol04]) the resulting strains and ORs are the same. Finally, we remark that occasionally [Pit62] is also cited for the Pitsch ORs. However, the measurements in [Pit62] are for cementite which has an orthorhombic crystal structure and thus our unified approach from Section 2 does not apply directly. Nevertheless, the underlying mechanism remains applicable if in (4) one replaces the Bain strain by the respective strain required to transform austenite to cementite.

The Greninger-Troiano and inverse Greninger-Troiano models

In [GT49], Greninger-Troiano (GT) studied a Fe-20%Ni-0.8%C crystal with $r = c/a = 1.045$ and observed the following approximate parallelisms

$$(111)_\gamma : (101)_{\alpha'} \approx 1^\circ, \langle 112 \rangle_\gamma : [10\bar{1}]_{\alpha'} \approx 2^\circ \text{ and } \langle 110 \rangle_\gamma : [11\bar{1}]_{\alpha'} \approx 2.5^\circ.$$

Apart from these original ORs (up to crystallographic equivalence), several authors use slightly different approximate parallelisms as defining features of the Greninger-Troiano (GT) orientation relationships. For instance, [BH11, TCDY02] report $\{111\}_\gamma : \{011\}_{\alpha'} \approx 0.2^\circ$ and $\langle 10\bar{1} \rangle_\gamma : \langle 11\bar{1} \rangle_{\alpha'} \approx 2.7^\circ$ and [HGJ06] uses the parallelisms

$$\{111\}_\gamma \parallel \{011\}_{\alpha'} \text{ and } \langle 51217 \rangle_\gamma \parallel \langle 71717 \rangle_{\alpha'} \quad (21)$$

to approximate the GT ORs. Using the parallelism condition (21) our unified approach can capture the slight misorientations as an effect of the increased tetragonality of the bct lattice. With $\mathbf{n} = (111)_\gamma$ and $\mathbf{v} = [\bar{5}17\bar{1}\bar{2}]_\gamma$ we obtain $T_{GT1} = R[\xi(r), [111]]R[\phi(r), [\bar{1}10]]B_3$ and

$$O_{GT1} = R[45^\circ, \mathbf{e}_3]R[-\phi(r), [\bar{1}10]]R[-\xi(r), [111]]$$

with $\xi(r) = \arccos\left(\frac{7^2+17^2\sqrt{3}\sqrt{1+r^2}}{\sqrt{2}\sqrt{5^2+12^2+17^2}\sqrt{7^2+17^2+17^2r^2}}\right)$. In particular, we have $(111)_\gamma \parallel (0r1)_{\alpha'}$ and $[\bar{1}\bar{2}\bar{5}17]_\gamma \parallel [\bar{7}\bar{1}\bar{7}17r]_{\alpha'}$ and thus for the value $r = 1.045$ studied in

¹¹ In [Pit59] a third parallelism $[1\bar{1}0]_\gamma \parallel [\bar{1}\bar{1}1]_{\alpha'}$ is provided, which is not required for our derivation but, nevertheless, follows from it.

[GT49] we obtain $(111)_\gamma \parallel (01.0451)_{\alpha'} : (011)_{\alpha'} \approx 1.26^\circ$, $[11\bar{2}]_\gamma : [01\bar{1}]_{\alpha'} \approx 2.8^\circ$ and $[10\bar{1}]_\gamma : [11\bar{1}]_{\alpha'} \approx 2.9^\circ$.

The inverse GT introduced in [HGJ06] satisfy the conditions $(\bar{1}\bar{7}\bar{7}17)_\gamma \parallel (\bar{5}\bar{1}\bar{2}17)_{\alpha'}$ and $[101]_\gamma \parallel [111]_{\alpha'}$ and as before our unified approach can be used to derive the corresponding strains and ORs. For further details on the P, GT GT' and also on the NW and KS ORs we refer to the Appendix.

5. Conclusions

A unified approach to derive transformation strains and orientation relationship models in steels is presented. An important aspect is the identification of strains with orientation relationships. The unified approach is used to derive the NW, KS and other models and extend them naturally to the situation of a tetragonal α' phase. The obtained dependence on the ratio of tetragonality seems to be in good qualitative agreement with experiments.

Acknowledgements

The research of A. M. leading to these results has received funding from the European Research Council under the European Union's 7th Framework Programme (FP7/2007-2013) / ERC grant n° 291053.

A. Overview of orientation relationship models

A.1. Nishiyama-Wassermann (NW)

The transformation $T_{\text{NW}1}$ is uniquely defined through our unified approach (cf. Section 2) as the transformation that:

- leaves the normal $\mathbf{n} = (111)_\gamma$ and the direction $\mathbf{v} = [10\bar{1}]_\gamma$ unrotated,
- has pure stretch component B_2 .

The resulting transformation strain is

$$T_{\text{NW}1} = R_2 B_2 = R[\phi(r), [10\bar{1}]] B_2,$$

where $\phi(r) = \arccos\left(\frac{1+\sqrt{2}r}{\sqrt{3}\sqrt{1+r^2}}\right)$. The corresponding OR matrix is

$$O_{\text{NW}1} = R[-45^\circ, \mathbf{e}_2] R[-\phi(r), [10\bar{1}]]$$

which yields the OR

$$(111)_\gamma \parallel (01r)_{\alpha'} \text{ and } [10\bar{1}]_\gamma \parallel [100]_{\alpha'}.$$

The application of \mathcal{P}^{24} yields the remaining eleven NW ORs (cf. Table A1). Note that, unlike Table 1, Table A1 takes the tetragonality of the bct lattice into account and the bct vectors are given in a way that is consistent with the transformation strains and not up to crystallographic equivalence.

Table A1: The NW orientation relationships. The corresponding transformation strain in each row is given by $T_{\text{NW}j} = R[\phi(r), P_{2j-1}[10\bar{1}]] B_j$.

OR ^a	fcc plane ^b	bcc plane ^c	fcc direction ^d	bcc direction ^e	Bain Variant ^f
NW1	$(111)_\gamma$	$(01r)_{\alpha'}$	$[10\bar{1}]_\gamma$	$[100]_{\alpha'}$	B_2
NW2	$(111)_\gamma$	$(r01)_{\alpha'}$	$[\bar{1}10]_\gamma$	$[010]_{\alpha'}$	B_3
NW3	$(111)_\gamma$	$(1r0)_{\alpha'}$	$[0\bar{1}1]_\gamma$	$[001]_{\alpha'}$	B_1
NW4	$(\bar{1}11)_\gamma$	$(\bar{r}10)_{\alpha'}$	$[101]_\gamma$	$[001]_{\alpha'}$	B_2
NW5	$(\bar{1}11)_\gamma$	$(0r1)_{\alpha'}$	$[\bar{1}\bar{1}0]_\gamma$	$[\bar{1}00]_{\alpha'}$	B_3
NW6	$(\bar{1}11)_\gamma$	$(\bar{1}0r)_{\alpha'}$	$[01\bar{1}]_\gamma$	$[010]_{\alpha'}$	B_1
NW7	$(1\bar{1}1)_\gamma$	$(r\bar{1}0)_{\alpha'}$	$[\bar{1}01]_\gamma$	$[001]_{\alpha'}$	B_2
NW8	$(1\bar{1}1)_\gamma$	$(0\bar{r}1)_{\alpha'}$	$[110]_\gamma$	$[100]_{\alpha'}$	B_3
NW9	$(1\bar{1}1)_\gamma$	$(10\bar{r})_{\alpha'}$	$[0\bar{1}\bar{1}]_\gamma$	$[0\bar{1}0]_{\alpha'}$	B_1
NW10	$(11\bar{1})_\gamma$	$(r10)_{\alpha'}$	$[\bar{1}0\bar{1}]_\gamma$	$[00\bar{1}]_{\alpha'}$	B_2
NW11	$(11\bar{1})_\gamma$	$(0r\bar{1})_{\alpha'}$	$[1\bar{1}0]_\gamma$	$[100]_{\alpha'}$	B_3
NW12	$(11\bar{1})_\gamma$	$(10\bar{r})_{\alpha'}$	$[011]_\gamma$	$[010]_{\alpha'}$	B_1

^a NW j ^b $P_{2j-1}(111)_\gamma$ ^c $P_{2j-1}(01r)_{\alpha'}$ ^d $P_{2j-1}[10\bar{1}]_\gamma$ ^e $P_{2j-1}(100)_{\alpha'}$

^f $B_j = P_{2j-1}B_2P_{2j-1}^T$

A.2. Kurdjumov-Sachs (KS)

The transformation T_{KS1} is uniquely defined through our unified approach (cf. Section 2) as the transformation that:

- leaves the normal $\mathbf{n} = (111)_\gamma$ and the direction $\mathbf{v} = [10\bar{1}]_\gamma$ unrotated,
- has pure stretch component B_3 .

The resulting transformation strain is

$$T_{\text{KS1}} = R[\theta(r), [111]] R[\phi(r), [\bar{1}10]] B_3,$$

where $\theta(r) = \arccos\left(\frac{\sqrt{3}\sqrt{r^2+1}+1}{2\sqrt{r^2+2}}\right)$, The corresponding OR matrix is

$$O_{\text{KS1}} = R[45^\circ, \mathbf{e}_3] R[-\phi(r), [\bar{1}10]] R[-\theta(r), [111]]$$

which yields the OR

$$(111)_\gamma \parallel (0r1)_{\alpha'} \text{ and } [10\bar{1}]_\gamma \parallel [11\bar{r}]_{\alpha'}.$$

The application of \mathcal{P}^{24} yields the remaining 23 KS ORs (cf. Table A2). Note that, unlike Table 2, Table A2 takes the tetragonality of the bct lattice into account and the bct vectors are given in a way that is consistent with the transformation strains and not up to crystallographic equivalence.

Table A2: The KS orientation relationships. The corresponding transformation strain in each row is given by $T_{KSj} = R[\theta(r), P_j[111]] R[\phi(r), P_j[\bar{1}10]] B_j$.

OR ^a	fcc plane ^b	bcc plane ^c	fcc direction ^d	bcc direction ^e	Bain Variant ^f
KS1	$(111)_\gamma$	$(0r1)_{\alpha'}$	$[10\bar{1}]_\gamma$	$[11\bar{r}]_{\alpha'}$	B_3
KS2	$(\bar{1}\bar{1}\bar{1})_\gamma$	$(\bar{1}\bar{r}0)_{\alpha'}$	$[10\bar{1}]_\gamma$	$[r\bar{1}\bar{1}]_{\alpha'}$	B_1
KS3	$(111)_\gamma$	$(10r)_{\alpha'}$	$[\bar{1}10]_\gamma$	$[\bar{r}11]_{\alpha'}$	B_1
KS4	$(\bar{1}\bar{1}\bar{1})_\gamma$	$(0\bar{1}\bar{r})_{\alpha'}$	$[\bar{1}10]_\gamma$	$[\bar{1}r\bar{1}]_{\alpha'}$	B_2
KS5	$(111)_\gamma$	$(r10)_{\alpha'}$	$[0\bar{1}1]_\gamma$	$[1\bar{r}1]_{\alpha'}$	B_2
KS6	$(\bar{1}\bar{1}\bar{1})_\gamma$	$(\bar{r}0\bar{1})_{\alpha'}$	$[0\bar{1}1]_\gamma$	$[\bar{1}\bar{1}r]_{\alpha'}$	B_3
KS7	$(\bar{1}11)_\gamma$	$(\bar{1}r0)_{\alpha'}$	$[101]_\gamma$	$[r11]_{\alpha'}$	B_1
KS8	$(1\bar{1}\bar{1})_\gamma$	$(0\bar{r}\bar{1})_{\alpha'}$	$[101]_\gamma$	$[1\bar{1}r]_{\alpha'}$	B_3
KS9	$(\bar{1}11)_\gamma$	$(01r)_{\alpha'}$	$[\bar{1}\bar{1}0]_\gamma$	$[\bar{1}\bar{r}1]_{\alpha'}$	B_2
KS10	$(1\bar{1}\bar{1})_\gamma$	$(10\bar{r})_{\alpha'}$	$[\bar{1}\bar{1}0]_\gamma$	$[\bar{r}\bar{1}\bar{1}]_{\alpha'}$	B_1
KS11	$(\bar{1}11)_\gamma$	$(\bar{r}01)_{\alpha'}$	$[01\bar{1}]_\gamma$	$[\bar{1}1\bar{r}]_{\alpha'}$	B_3
KS12	$(1\bar{1}\bar{1})_\gamma$	$(r\bar{1}0)_{\alpha'}$	$[01\bar{1}]_\gamma$	$[1r\bar{1}]_{\alpha'}$	B_2
KS13	$(1\bar{1}1)_\gamma$	$(1\bar{r}0)_{\alpha'}$	$[\bar{1}01]_\gamma$	$[\bar{r}\bar{1}1]_{\alpha'}$	B_1
KS14	$(\bar{1}1\bar{1})_\gamma$	$(0r\bar{1})_{\alpha'}$	$[\bar{1}01]_\gamma$	$[\bar{1}1r]_{\alpha'}$	B_3
KS15	$(1\bar{1}1)_\gamma$	$(0\bar{1}r)_{\alpha'}$	$[110]_\gamma$	$[1r1]_{\alpha'}$	B_2
KS16	$(\bar{1}1\bar{1})_\gamma$	$(\bar{1}0r)_{\alpha'}$	$[110]_\gamma$	$[r1\bar{1}]_{\alpha'}$	B_1
KS17	$(1\bar{1}1)_\gamma$	$(r01)_{\alpha'}$	$[0\bar{1}\bar{1}]_\gamma$	$[1\bar{1}\bar{r}]_{\alpha'}$	B_3
KS18	$(\bar{1}1\bar{1})_\gamma$	$(\bar{r}10)_{\alpha'}$	$[0\bar{1}\bar{1}]_\gamma$	$[\bar{1}\bar{r}\bar{1}]_{\alpha'}$	B_2
KS19	$(11\bar{1})_\gamma$	$(1r0)_{\alpha'}$	$[\bar{1}0\bar{1}]_\gamma$	$[\bar{r}1\bar{1}]_{\alpha'}$	B_1
KS20	$(\bar{1}\bar{1}1)_\gamma$	$(0\bar{r}1)_{\alpha'}$	$[\bar{1}0\bar{1}]_\gamma$	$[\bar{1}\bar{1}\bar{r}]_{\alpha'}$	B_3
KS21	$(11\bar{1})_\gamma$	$(01\bar{r})_{\alpha'}$	$[1\bar{1}0]_\gamma$	$[1\bar{r}\bar{1}]_{\alpha'}$	B_2
KS22	$(\bar{1}\bar{1}1)_\gamma$	$(\bar{1}0r)_{\alpha'}$	$[1\bar{1}0]_\gamma$	$[r\bar{1}1]_{\alpha'}$	B_1
KS23	$(11\bar{1})_\gamma$	$(r0\bar{1})_{\alpha'}$	$[011]_\gamma$	$[11r]_{\alpha'}$	B_3
KS24	$(\bar{1}\bar{1}1)_\gamma$	$(\bar{r}\bar{1}0)_{\alpha'}$	$[011]_\gamma$	$[\bar{1}r1]_{\alpha'}$	B_2
^a KS _j	^b $P_j(111)_\gamma$	^c $P_j(0r1)_{\alpha'}$	^d $P_j[10\bar{1}]_\gamma$	^e $P_j[11\bar{r}]_{\alpha'}$	^f $B_j = P_j B_3 P_j^T$

A.3. Pitsch (PT)

The transformation T_{P1} is uniquely defined through our unified approach (cf. Section 2) as the transformation that:

- leaves the normal $\mathbf{n} = (110)_\gamma$ and the direction $\mathbf{v} = [001]_\gamma$ unrotated,
- has pure stretch component B_2 .

The resulting transformation strain is

$$T_{P1} = R[\psi(r), [100]] B_2,$$

where $\psi(r) = -\arccos\left(\frac{\sqrt{2+r}}{\sqrt{2+r^2}}\right)$. The corresponding OR matrix is

$$O_{P1} = R[45^\circ, \mathbf{e}_2] R[-\psi(r), [100]]$$

which yields the OR

$$(01\bar{1})_\gamma \parallel (\bar{r}2\bar{r})_{\alpha'} \text{ and } [100]_\gamma \parallel [10\bar{1}]_{\alpha'}$$

The application of \mathcal{P}^{24} yields the remaining eleven P ORs (cf. Table A3).

Remark

O_{P1} also yields the parallelism $[011]_\gamma \parallel [1r1]_{\alpha'}$ stated in [Pit59] (for $r = 1$).

Table A3: The Pitsch orientation relationships. The corresponding transformation strain in each row is given by $T_{Pj} = R[\psi(r), P_{2j-1}[100]] B_j$.

OR ^a	fcc plane ^b	bcc plane ^c	fcc direction ^d	bcc direction ^e	Bain Variant ^f
P1	$(01\bar{1})_\gamma$	$(\bar{r}2\bar{r})_{\alpha'}$	$[100]_\gamma$	$[10\bar{1}]_{\alpha'}$	B_2
P2	$(\bar{1}01)_\gamma$	$(\bar{r}\bar{r}2)_{\alpha'}$	$[010]_\gamma$	$[\bar{1}10]_{\alpha'}$	B_3
P3	$(1\bar{1}0)_\gamma$	$(2\bar{r}\bar{r})_{\alpha'}$	$[001]_\gamma$	$[0\bar{1}1]_{\alpha'}$	B_1
P4	$(110)_\gamma$	$(r2\bar{r})_{\alpha'}$	$[001]_\gamma$	$[101]_{\alpha'}$	B_2
P5	$(0\bar{1}1)_\gamma$	$(r\bar{r}2)_{\alpha'}$	$[\bar{1}00]_\gamma$	$[\bar{1}\bar{1}0]_{\alpha'}$	B_3
P6	$(\bar{1}0\bar{1})_\gamma$	$(\bar{2}\bar{r}\bar{r})_{\alpha'}$	$[010]_\gamma$	$[01\bar{1}]_{\alpha'}$	B_1
P7	$(\bar{1}\bar{1}0)_\gamma$	$(\bar{r}\bar{2}\bar{r})_{\alpha'}$	$[001]_\gamma$	$[\bar{1}01]_{\alpha'}$	B_2
P8	$(011)_\gamma$	$(\bar{r}r2)_{\alpha'}$	$[100]_\gamma$	$[110]_{\alpha'}$	B_3
P9	$(10\bar{1})_\gamma$	$(2r\bar{r})_{\alpha'}$	$[0\bar{1}0]_\gamma$	$[0\bar{1}\bar{1}]_{\alpha'}$	B_1
P10	$(\bar{1}10)_\gamma$	$(\bar{r}2r)_{\alpha'}$	$[00\bar{1}]_\gamma$	$[\bar{1}0\bar{1}]_{\alpha'}$	B_2
P11	$(0\bar{1}\bar{1})_\gamma$	$(\bar{r}\bar{r}\bar{2})_{\alpha'}$	$[100]_\gamma$	$[1\bar{1}0]_{\alpha'}$	B_3
P12	$(101)_\gamma$	$(2\bar{r}r)_{\alpha'}$	$[010]_\gamma$	$[011]_{\alpha'}$	B_1

^a P_j ^b $P_{2j-1}(01\bar{1})_\gamma$ ^c $P_{2j-1}(\bar{r}2\bar{r})_{\alpha'}$ ^d $P_{2j-1}[100]_\gamma$ ^e $P_{2j-1}(10\bar{1})_{\alpha'}$

^f $B_j = P_{2j-1}B_2P_{2j-1}^T$

A.4. Greninger-Troiano (GT)

The transformation T_{GT1} is uniquely defined through our unified approach (cf. Section 2) as the transformation that:

- leaves the normal $\mathbf{n} = (111)_\gamma$ and the direction $\mathbf{v} = [\bar{5}17\bar{1}2]_\gamma$ unrotated,
- has pure stretch component B_3 .

The resulting transformation strain is

$$T_{GT1} = R[\xi(r), [111]] R[\phi(r), [\bar{1}10]] B_3,$$

where $\xi(r) = \arccos\left(\frac{7^2+17^2\sqrt{3}\sqrt{1+r^2}}{\sqrt{2}\sqrt{5^2+12^2+17^2}\sqrt{7^2+17^2+17^2r^2}}\right)$. The corresponding OR matrix is

$$O_{GT1} = R[45^\circ, \mathbf{e}_3] R[-\phi(r), [\bar{1}10]] R[-\xi(r), [111]]$$

which yields the OR

$$(111)_\gamma \parallel (0r1)_{\alpha'} \text{ and } [\bar{1}2\bar{5}17]_\gamma \parallel [\bar{7}\bar{1}\bar{7}17r]_{\alpha'}.$$

The application of \mathcal{P}^{24} yields the remaining 23 GT ORs (cf. Table A4).

Example

Let $r = 1.045$ (as in [GT49]) then $(111) : (011) \approx 1.26^\circ$, $[11\bar{2}] : [01\bar{1}] \approx 2.82^\circ$, $[10\bar{1}] : [11\bar{1}] \approx 2.94^\circ$ and $[0\bar{1}1] : [1\bar{1}1] \approx 7.86^\circ$.

Table A4: The GT orientation relationships. The corresponding transformation strain in each row is given by $T_{GTj} = R[\xi(r), P_j[111]] R[\phi(r), P_j[\bar{1}10]] B_j$.

OR ^a	fcc plane ^b	bcc plane ^c	fcc direction ^d	bcc direction ^e	Bain Variant ^f
GT1	$(111)_\gamma$	$(0r1)_{\alpha'}$	$[\bar{1}2\bar{5}17]_\gamma$	$[\bar{7}\bar{1}\bar{7}17r]_{\alpha'}$	B_3
GT2	$(\bar{1}\bar{1}\bar{1})_\gamma$	$(\bar{1}\bar{r}0)_{\alpha'}$	$[\bar{1}7512]_\gamma$	$[\bar{1}7r177]_{\alpha'}$	B_1
GT3	$(111)_\gamma$	$(10r)_{\alpha'}$	$[17\bar{1}2\bar{5}]_\gamma$	$[17r\bar{7}\bar{1}7]_{\alpha'}$	B_1
GT4	$(\bar{1}\bar{1}\bar{1})_\gamma$	$(0\bar{1}\bar{r})_{\alpha'}$	$[12\cdot17]5_\gamma$	$[7\bar{1}7r17]_{\alpha'}$	B_2
GT5	$(111)_\gamma$	$(r10)_{\alpha'}$	$[\bar{5}17\bar{1}2]_\gamma$	$[\bar{1}717r\bar{7}]_{\alpha'}$	B_2
GT6	$(\bar{1}\bar{1}\bar{1})_\gamma$	$(\bar{r}0\bar{1})_{\alpha'}$	$[512\bar{1}7]_\gamma$	$[177\bar{1}7r]_{\alpha'}$	B_3
GT7	$(\bar{1}\bar{1}1)_\gamma$	$(\bar{1}r0)_{\alpha'}$	$[\bar{1}7\bar{5}\bar{1}2]_\gamma$	$[\bar{1}7r\bar{1}7\bar{7}]_{\alpha'}$	B_1
GT8	$(1\bar{1}\bar{1})_\gamma$	$(0\bar{r}\bar{1})_{\alpha'}$	$[\bar{1}25\bar{1}7]_\gamma$	$[\bar{7}17\bar{1}7r]_{\alpha'}$	B_3
GT9	$(\bar{1}\bar{1}1)_\gamma$	$(01r)_{\alpha'}$	$[1217\bar{5}]_\gamma$	$[717r\bar{1}7]_{\alpha'}$	B_2
GT10	$(1\bar{1}\bar{1})_\gamma$	$(10\bar{r})_{\alpha'}$	$[17125]_\gamma$	$[17r717]_{\alpha'}$	B_1
GT11	$(\bar{1}\bar{1}1)_\gamma$	$(\bar{r}01)_{\alpha'}$	$[\bar{5}12\bar{1}7]_\gamma$	$[17\bar{7}17r]_{\alpha'}$	B_3
GT12	$(1\bar{1}\bar{1})_\gamma$	$(r\bar{1}0)_{\alpha'}$	$[517\bar{1}2]_\gamma$	$[\bar{1}7\bar{1}7r7]_{\alpha'}$	B_2
GT13	$(1\bar{1}1)_\gamma$	$(1\bar{r}0)_{\alpha'}$	$[175\bar{1}2]_\gamma$	$[17r17\bar{7}]_{\alpha'}$	B_1
GT14	$(\bar{1}\bar{1}1)_\gamma$	$(0r\bar{1})_{\alpha'}$	$[12\bar{5}\bar{1}7]_\gamma$	$[7\bar{1}7\bar{1}7r]_{\alpha'}$	B_3
GT15	$(1\bar{1}1)_\gamma$	$(0\bar{1}r)_{\alpha'}$	$[\bar{1}2\bar{1}7\bar{5}]_\gamma$	$[\bar{7}\bar{1}7r\bar{1}7]_{\alpha'}$	B_2
GT16	$(\bar{1}\bar{1}1)_\gamma$	$(\bar{1}0r)_{\alpha'}$	$[17\bar{1}25]_\gamma$	$[17r\bar{7}17]_{\alpha'}$	B_1
GT17	$(1\bar{1}1)_\gamma$	$(r01)_{\alpha'}$	$[\bar{5}1217]_\gamma$	$[\bar{1}7717r]_{\alpha'}$	B_3
GT18	$(\bar{1}\bar{1}1)_\gamma$	$(\bar{r}10)_{\alpha'}$	$[51712]_\gamma$	$[1717r7]_{\alpha'}$	B_2
GT19	$(11\bar{1})_\gamma$	$(1r0)_{\alpha'}$	$[17\bar{5}12]_\gamma$	$[17r\bar{1}7\bar{7}]_{\alpha'}$	B_1
GT20	$(\bar{1}\bar{1}\bar{1})_\gamma$	$(0\bar{r}1)_{\alpha'}$	$[12517]_\gamma$	$[71717r]_{\alpha'}$	B_3
GT21	$(11\bar{1})_\gamma$	$(01\bar{r})_{\alpha'}$	$[\bar{1}2175]_\gamma$	$[\bar{7}17r17]_{\alpha'}$	B_2
GT22	$(\bar{1}\bar{1}\bar{1})_\gamma$	$(\bar{1}0r)_{\alpha'}$	$[\bar{1}712\bar{5}]_\gamma$	$[\bar{1}7r7\bar{1}7]_{\alpha'}$	B_1
GT23	$(11\bar{1})_\gamma$	$(r0\bar{1})_{\alpha'}$	$[\bar{5}\bar{1}2\bar{1}7]_\gamma$	$[\bar{1}7\bar{7}\bar{1}7r]_{\alpha'}$	B_3
GT24	$(\bar{1}\bar{1}\bar{1})_\gamma$	$(\bar{r}\bar{1}0)_{\alpha'}$	$[5\bar{1}7\bar{1}2]_\gamma$	$[17\bar{1}7r\bar{7}]_{\alpha'}$	B_2
^a GT _j	^b P _j (111) _γ	^c P _j (0r1) _{α'}	^d P _j [$\bar{1}2\bar{5}17$] _γ	^e P _j [$\bar{7}\bar{1}\bar{7}17r$] _{α'}	^f B _j = P _j B ₃ P _j ^T

A.5. Inverse Greninger-Troiano (GT')

The transformation $T_{GT'1}$ is uniquely defined through our unified approach (cf. Section 2) as the transformation that:

- leaves the normal $\mathbf{n} = (\bar{1}\bar{7}\bar{7}17)_\gamma$ and the direction $\mathbf{v} = [101]_\gamma$ unrotated,
- has pure stretch component B_3 .

The resulting transformation strain is

$$T_{\text{GT}'1} = R[\iota(r), [101]] R[-\psi(r), [010]] B_3 = R[\iota(r), [101]] R_{\text{P2}} B_3$$

where $\iota(r) = \arccos\left(\frac{17^2\sqrt{2}\sqrt{2+r^2}+7^2r}{\sqrt{17^2+17^2+7^2}\sqrt{2\cdot 17^2+7^2r^2+17^2r^2}}\right)$. The corresponding OR matrix is

$$O_{\text{GT}'1} = R[45^\circ, [001]] R[\psi(r), [010]] R[-\iota(r), [101]]$$

which yields the OR

$$(\bar{1}\bar{7}\bar{7}17)_\gamma \parallel (\bar{5}r\bar{1}2r17)_{\alpha'} \text{ and } [101]_\gamma \parallel [11r]_{\alpha'}.$$

The application of \mathcal{P}^{24} yields the remaining 23 GT' ORs (cf. Table A5).

Table A5: The GT' orientation relationships. The corresponding transformation strain in each row is given by $T_{GT'j} = R[\iota(r), P_j[101]] R[-\psi(r), P_j[010]] B_j$.

OR ^a	fcc plane ^b	bcc plane ^c	fcc direction ^d	bcc direction ^e	Bain Variant ^f
GT'1	$(\bar{1}\bar{7}\bar{7}17)_\gamma$	$(\bar{5}r\bar{1}2r17)_{\alpha'}$	$[101]_\gamma$	$[11r]_{\alpha'}$	B_3
GT'2	$(\bar{1}\bar{7}\bar{7}17)_\gamma$	$(\bar{1}\bar{7}12r5r)_{\alpha'}$	$[\bar{1}0\bar{1}]_\gamma$	$[\bar{r}\bar{1}\bar{1}]_{\alpha'}$	B_1
GT'3	$(17\bar{1}\bar{7}\bar{7})_\gamma$	$(17\bar{5}r\bar{1}2r)_{\alpha'}$	$[110]_\gamma$	$[r11]_{\alpha'}$	B_1
GT'4	$(17\bar{1}\bar{7}\bar{7})_\gamma$	$(5\bar{1}\bar{7}r12r)_{\alpha'}$	$[\bar{1}\bar{1}0]_\gamma$	$[\bar{1}\bar{r}\bar{1}]_{\alpha'}$	B_2
GT'5	$(\bar{7}17\bar{1}\bar{7})_\gamma$	$(\bar{1}2r17\bar{5}r)_{\alpha'}$	$[011]_\gamma$	$[1r1]_{\alpha'}$	B_2
GT'6	$(717\bar{1}\bar{7})_\gamma$	$(12r5r\bar{1}\bar{7})_{\alpha'}$	$[0\bar{1}\bar{1}]_\gamma$	$[\bar{1}\bar{1}\bar{r}]_{\alpha'}$	B_3
GT'7	$(\bar{1}\bar{7}\bar{7}\bar{1}\bar{7})_\gamma$	$(\bar{1}\bar{7}\bar{1}2r\bar{5}r)_{\alpha'}$	$[\bar{1}01]_\gamma$	$[\bar{r}11]_{\alpha'}$	B_1
GT'8	$(\bar{1}\bar{7}\bar{7}\bar{1}\bar{7})_\gamma$	$(\bar{5}r12r\bar{1}\bar{7})_{\alpha'}$	$[10\bar{1}]_\gamma$	$[1\bar{1}r]_{\alpha'}$	B_3
GT'9	$(1717\bar{7})_\gamma$	$(5r17\bar{1}2r)_{\alpha'}$	$[\bar{1}10]_\gamma$	$[\bar{1}r1]_{\alpha'}$	B_2
GT'10	$(17177)_\gamma$	$(175r12r)_{\alpha'}$	$[1\bar{1}0]_\gamma$	$[r\bar{1}\bar{1}]_{\alpha'}$	B_1
GT'11	$(7\bar{1}\bar{7}17)_\gamma$	$(12r\bar{5}r17)_{\alpha'}$	$[011]_\gamma$	$[\bar{1}1r]_{\alpha'}$	B_3
GT'12	$(\bar{7}\bar{1}\bar{7}17)_\gamma$	$(\bar{1}2r\bar{1}\bar{7}5r)_{\alpha'}$	$[0\bar{1}\bar{1}]_\gamma$	$[1\bar{r}\bar{1}]_{\alpha'}$	B_2
GT'13	$(177\bar{1}\bar{7})_\gamma$	$(1712r\bar{5}r)_{\alpha'}$	$[101]_\gamma$	$[r\bar{1}1]_{\alpha'}$	B_1
GT'14	$(17\bar{7}\bar{1}\bar{7})_\gamma$	$(5r\bar{1}2r\bar{1}\bar{7})_{\alpha'}$	$[\bar{1}0\bar{1}]_\gamma$	$[\bar{1}\bar{1}\bar{r}]_{\alpha'}$	B_3
GT'15	$(\bar{1}\bar{7}\bar{1}\bar{7}\bar{7})_\gamma$	$(\bar{5}r\bar{1}\bar{7}\bar{1}2r)_{\alpha'}$	$[1\bar{1}0]_\gamma$	$[1\bar{r}1]_{\alpha'}$	B_2
GT'16	$(\bar{1}\bar{7}\bar{1}\bar{7}7)_\gamma$	$(\bar{1}\bar{7}\bar{5}r12r)_{\alpha'}$	$[\bar{1}10]_\gamma$	$[\bar{r}1\bar{1}]_{\alpha'}$	B_1
GT'17	$(\bar{7}1717)_\gamma$	$(\bar{1}2r5r17)_{\alpha'}$	$[0\bar{1}1]_\gamma$	$[1\bar{1}r]_{\alpha'}$	B_3
GT'18	$(71717)_\gamma$	$(12r175r)_{\alpha'}$	$[01\bar{1}]_\gamma$	$[\bar{1}r\bar{1}]_{\alpha'}$	B_2
GT'19	$(17\bar{7}17)_\gamma$	$(17\bar{1}2r5r)_{\alpha'}$	$[\bar{1}01]_\gamma$	$[r1\bar{1}]_{\alpha'}$	B_1
GT'20	$(17717)_\gamma$	$(5r12r17)_{\alpha'}$	$[10\bar{1}]_\gamma$	$[\bar{1}\bar{1}r]_{\alpha'}$	B_3
GT'21	$(\bar{1}\bar{7}177)_\gamma$	$(\bar{5}r1712r)_{\alpha'}$	$[\bar{1}\bar{1}0]_\gamma$	$[1r\bar{1}]_{\alpha'}$	B_2
GT'22	$(\bar{1}\bar{7}17\bar{7})_\gamma$	$(\bar{1}\bar{7}5r\bar{1}2r)_{\alpha'}$	$[110]_\gamma$	$[\bar{r}\bar{1}\bar{1}]_{\alpha'}$	B_1
GT'23	$(\bar{7}\bar{1}\bar{7}\bar{1}\bar{7})_\gamma$	$(\bar{1}2r\bar{5}r\bar{1}\bar{7})_{\alpha'}$	$[0\bar{1}1]_\gamma$	$[11\bar{r}]_{\alpha'}$	B_3
GT'24	$(7\bar{1}\bar{7}\bar{1}\bar{7})_\gamma$	$(12r\bar{1}\bar{7}\bar{5}r)_{\alpha'}$	$[01\bar{1}]_\gamma$	$[\bar{1}\bar{1}\bar{1}]_{\alpha'}$	B_2
^a GT'j	^b $P_j(\bar{1}\bar{7}\bar{7}17)_\gamma$	^c $P_j(\bar{5}r\bar{1}2r17)_{\alpha'}$	^d $P_j[101]_\gamma$	^e $P_j[11r]_{\alpha'}$	^f $B_j = P_j B_3 P_j^T$

B. The group \mathcal{P}^{24}

The elements of \mathcal{P}^{24} in the standard basis $\{\mathbf{e}_1, \mathbf{e}_2, \mathbf{e}_3\}$ are given by

$$\begin{aligned}
P_1 = \mathbf{1} &= \begin{pmatrix} 1 & 0 & 0 \\ 0 & 1 & 0 \\ 0 & 0 & 1 \end{pmatrix}, & P_2 = R[180^\circ, \mathbf{e}_1 - \mathbf{e}_3] &= \begin{pmatrix} 0 & 0 & -1 \\ 0 & -1 & 0 \\ -1 & 0 & 0 \end{pmatrix}, \\
P_3 = R[120^\circ, \mathbf{e}_1 + \mathbf{e}_2 + \mathbf{e}_3] &= \begin{pmatrix} 0 & 0 & 1 \\ 1 & 0 & 0 \\ 0 & 1 & 0 \end{pmatrix}, & P_4 = R[180^\circ, \mathbf{e}_2 - \mathbf{e}_3] &= \begin{pmatrix} -1 & 0 & 0 \\ 0 & 0 & -1 \\ 0 & -1 & 0 \end{pmatrix}, \\
P_5 = R[-120^\circ, \mathbf{e}_1 + \mathbf{e}_2 + \mathbf{e}_3] &= \begin{pmatrix} 0 & 1 & 0 \\ 0 & 0 & 1 \\ 1 & 0 & 0 \end{pmatrix}, & P_6 = R[180^\circ, \mathbf{e}_1 - \mathbf{e}_2] &= \begin{pmatrix} 0 & -1 & 0 \\ -1 & 0 & 0 \\ 0 & 0 & -1 \end{pmatrix}, \\
P_7 = R[-90^\circ, \mathbf{e}_2] &= \begin{pmatrix} 0 & 0 & -1 \\ 0 & 1 & 0 \\ 1 & 0 & 0 \end{pmatrix}, & P_8 = R[180^\circ, \mathbf{e}_1] &= \begin{pmatrix} 1 & 0 & 0 \\ 0 & -1 & 0 \\ 0 & 0 & -1 \end{pmatrix}, \\
P_9 = R[180^\circ, \mathbf{e}_2 + \mathbf{e}_3] &= \begin{pmatrix} -1 & 0 & 0 \\ 0 & 0 & 1 \\ 0 & 1 & 0 \end{pmatrix}, & P_{10} = R[-120^\circ, \mathbf{e}_1 - \mathbf{e}_2 + \mathbf{e}_3] &= \begin{pmatrix} 0 & 0 & 1 \\ -1 & 0 & 0 \\ 0 & -1 & 0 \end{pmatrix}, \\
P_{11} = R[90^\circ, \mathbf{e}_3] &= \begin{pmatrix} 0 & -1 & 0 \\ 1 & 0 & 0 \\ 0 & 0 & 1 \end{pmatrix}, & P_{12} = R[120^\circ, \mathbf{e}_1 + \mathbf{e}_2 - \mathbf{e}_3] &= \begin{pmatrix} 0 & 1 & 0 \\ 0 & 0 & -1 \\ -1 & 0 & 0 \end{pmatrix}, \\
P_{13} = R[180^\circ, \mathbf{e}_1 + \mathbf{e}_3] &= \begin{pmatrix} 0 & 0 & 1 \\ 0 & -1 & 0 \\ 1 & 0 & 0 \end{pmatrix}, & P_{14} = R[180^\circ, \mathbf{e}_2] &= \begin{pmatrix} -1 & 0 & 0 \\ 0 & 1 & 0 \\ 0 & 0 & -1 \end{pmatrix}, \\
P_{15} = R[90^\circ, \mathbf{e}_1] &= \begin{pmatrix} 1 & 0 & 0 \\ 0 & 0 & -1 \\ 0 & 1 & 0 \end{pmatrix}, & P_{16} = R[-120^\circ, \mathbf{e}_1 + \mathbf{e}_2 - \mathbf{e}_3] &= \begin{pmatrix} 0 & 0 & -1 \\ 1 & 0 & 0 \\ 0 & -1 & 0 \end{pmatrix}, \\
P_{17} = R[-90^\circ, \mathbf{e}_3] &= \begin{pmatrix} 0 & 1 & 0 \\ -1 & 0 & 0 \\ 0 & 0 & 1 \end{pmatrix}, & P_{18} = R[120^\circ, -\mathbf{e}_1 + \mathbf{e}_2 + \mathbf{e}_3] &= \begin{pmatrix} 0 & -1 & 0 \\ 0 & 0 & 1 \\ -1 & 0 & 0 \end{pmatrix}, \\
P_{19} = R[90^\circ, \mathbf{e}_2] &= \begin{pmatrix} 0 & 0 & 1 \\ 0 & 1 & 0 \\ -1 & 0 & 0 \end{pmatrix}, & P_{20} = R[180^\circ, \mathbf{e}_3] &= \begin{pmatrix} -1 & 0 & 0 \\ 0 & -1 & 0 \\ 0 & 0 & 1 \end{pmatrix}, \\
P_{21} = R[-90^\circ, \mathbf{e}_1] &= \begin{pmatrix} 1 & 0 & 0 \\ 0 & 0 & 1 \\ 0 & -1 & 0 \end{pmatrix}, & P_{22} = R[-120^\circ, -\mathbf{e}_1 + \mathbf{e}_2 + \mathbf{e}_3] &= \begin{pmatrix} 0 & 0 & -1 \\ -1 & 0 & 0 \\ 0 & 1 & 0 \end{pmatrix}, \\
P_{23} = R[180^\circ, \mathbf{e}_1 + \mathbf{e}_2] &= \begin{pmatrix} 0 & 1 & 0 \\ 1 & 0 & 0 \\ 0 & 0 & -1 \end{pmatrix}, & P_{24} = R[120^\circ, \mathbf{e}_1 - \mathbf{e}_2 + \mathbf{e}_3] &= \begin{pmatrix} 0 & -1 & 0 \\ 0 & 0 & -1 \\ 1 & 0 & 0 \end{pmatrix}.
\end{aligned}$$

References

- [Bai24] E.C. Bain. The nature of martensite. *Transactions of the Metallurgical Society of AIME*, 70(1):25–47, 1924.
- [BH11] H. Bhadeshia and R. Honeycombe. *Steels: Microstructure and Properties*. Elsevier Science, 2011.

- [Bha03] K. Bhattacharya. *Microstructure of martensite*. OUP Oxford, 2003.
- [Bun13] H.J. Bunge. *Texture Analysis in Materials Science: Mathematical Methods*. Elsevier Science, 2013.
- [CBdC10] C. Cayron, F. Barcelo, and Y. de Carlan. The mechanisms of the fcc-bcc martensitic transformation revealed by pole figures. *Acta Materialia*, 58(4):1395–1402, 2010.
- [GLMJ04] Z. Guo, C.S. Lee, and J.W. Morris Jr. On coherent transformations in steel. *Acta Materialia*, 52(19):5511–5518, 2004.
- [GT49] A.B. Greninger and A.R. Troiano. The mechanism of martensite formation. *Transactions of the Metallurgical Society of AIME*, 185(9):590–598, 1949.
- [HGJ05] Y. He, S. Godet, and J.J. Jonas. Representation of misorientations in Rodrigues-Frank space: Application to the Bain, Kurdjumov-Sachs, Nishiyama-Wassermann and Pitsch orientation relationships in the Gibeon meteorite. *Acta Materialia*, 53(4):1179–1190, 2005.
- [HGJ06] Y. He, S. Godet, and J.J. Jonas. Observations of the Gibeon meteorite and the inverse Greninger-Troiano orientation relationship. *Journal of Applied Crystallography*, 39(1):72–81, 2006.
- [KM15] K. Koumatos and A. Muehleman. The morphology of lath martensite: a new perspective. *MATEC Web of Conferences: Proceedings of the 10th European Symposium on Martensitic Transformations*, 33:07003, 2015.
- [KM16] K. Koumatos and A. Muehleman. Optimality of general lattice transformations with applications to the Bain strain in steel. *Proceedings of the Royal Society A: Mathematical, Physical & Engineering Sciences*, 2016.
- [KMD76] J.S. Kallend, P.P. Morris, and G.J. Davies. Texture transformations - the misorientation distribution function. *Acta Metallurgica*, 24(4):361–370, 1976.
- [KS30] G.V. Kurdjumov and G. Sachs. Über den Mechanismus der Stahlhärtung. *Zeitschrift für Physik*, 64:325–343, 1930.
- [Nis34] Z. Nishiyama. X-ray investigation of the mechanism of the transformation from face-centred cubic lattice to body-centred cubic. *Science Reports of the Tohoku Imperial University, Series 1: Mathematics, Physics, Chemistry*, 23:637–664, 1934.
- [Nis78] Z. Nishiyama. *Martensitic Transformation*. Elsevier Science, 1978.

-
- [Nol04] G. Nolze. Determination of orientation relationships between fcc/bcc lattices by use of pole figure. In *Proceedings of Channel Users Meeting*, pages 37–45, 2004.
- [Ott60] H.M. Otte. The orientation of martensite in austenite. *Acta Metallurgica*, 8(12):892–896, 1960.
- [Pit59] W. Pitsch. The martensite transformation in thin foils of iron-nitrogen alloys. *Philosophical Magazine*, 4(41):577–584, 1959.
- [Pit62] W. Pitsch. Der Orientierungszusammenhang zwischen Zementit und Austenit. *Acta Metallurgica*, 10(9):897 – 900, 1962.
- [RJ90] R.K. Ray and J.J. Jonas. Transformation textures in steels. *International Materials Reviews*, 35(1):1–36, 1990.
- [Rob53] C.S. Roberts. Effect of carbon on the volume fractions and lattice parameters of retained austenite and martensite. *Trans. AIME*, 197(2):203–204, 1953.
- [TCDY02] M.C. Tsai, C.S. Chiou, J.S. Du, and J.R. Yang. Phase transformation in AISI 410 stainless steel. *Materials Science and Engineering: A*, 332(12):1–10, 2002.
- [Was35] G. Wassermann. *Über den Mechanismus der α - γ Umwandlung des Eisens*. Mitteilungen aus dem Kaiser-Wilhelm-Institut für Eisenforschung zu Düsseldorf. Verlag Stahleisen, 1935.
- [WC62] P.G. Winchell and M. Cohen. The strength of martensite. Technical report, DTIC Document, 1962.
- [WW71] M. Watanabe and C.M. Wayman. The morphology and substructure of highly tetragonal martensites in Fe-7%Al-C steels. *Metallurgical and Materials Transactions B*, 2(8):2221–2227, 1971.