

A Note on Tesla's Revised Safety Report Crash Rates

Noah Goodall, Ph.D., P.E.

CET Research, USA, noah@cetresearch.com

ORCID: 0000-0002-3576-9886

November 10, 2023

Preprint version, under review.

Abstract

Between June 2018 and December 2022, Tesla released quarterly safety reports citing average miles between crashes for Tesla vehicles. Prior to March 2021, crash rates were categorized as 1) with their SAE Level 2 automated driving system Autopilot engaged, 2) without Autopilot but with active safety features such as automatic emergency braking, and 3) without Autopilot and without active safety features. In January 2022, Tesla revised past reports to reflect their new categories of with and without Autopilot engaged, in addition to making small adjustments based on recently discovered double counting of reports and excluding previously recorded crashes that did not meet their thresholds of airbag or active safety restraint activation. The revisions are heavily biased towards no-active-safety-features—a surprising result given prior research showing that drivers predominantly keep most active safety features enabled. As Tesla's safety reports represent the only national source of Level 2 advanced driver assistance system crash rates, clarification of their methods is essential for researchers and regulators. This note describes the changes and considers possible explanations for the discrepancies.

1 Background

The safety of automated driving systems (ADSs) is a major research focus. Automated driving systems are generally classified based on the amount of assistance provided using SAE's taxonomy of levels of automation (SAE International, 2021). Level 2 refers to automated driving systems that combine both latitudinal and longitudinal control but require continuous oversight by a human driver. An example of Level 2 automation is simultaneous use of lane centering technology and adaptive cruise control, such as Tesla's Autopilot feature. Levels 3–5 differ in that they do not require continuous human oversight in at least certain scenarios.

There have been multiple studies evaluating the crash rates of both Level 2 systems (Goodall, 2023a; Highway Loss Data Institute, 2017; Leslie et al., 2022; Quality Control Systems Corporation, 2019) and Level 3 systems (Blanco et al., 2016; Dixit et al., 2016; Goodall, 2021; Schoettle and Sivak, 2015; Teoh and Kidd, 2017). A significant challenge in determining crash rates of ADS is a lack of data, as police crash records do not report whether vehicles were running ADS at the time of the crash. In an attempt to generate additional crash data, the National Highway Traffic Safety Administration (NHTSA) in June 2021 issued a Standing General Order requiring vehicle manufacturers to report all known severe Level 2 crashes and all known crashes at Levels 3–5, but did not require manufacturers to report automated mileages (National Highway Traffic Safety Administration, 2021). In the absence of exposure data such as miles traveled or hours of operation, researchers cannot calculate or compare crash rates from NHTSA data (Goodall, 2023b).

In the absence of independent or government data, researchers are forced to rely on manufacturers' voluntarily-reported crash rates when evaluating ADS safety. As these figures are often aggregated over time, space, and vehicle model-year, it is essential that researchers carefully consider data quality as well as contextual clues that may help normalize crash rates to the general driving population (Goodall, 2023a).

1.1 Tesla Safety Reports

Tesla Inc. is one of the largest manufacturers of electric vehicles in the world, with 1.3 million vehicles delivered in 2022 (Tesla, Inc., 2023a, p. 3). Their SAE Level 2 ADS, Autopilot, has been offered as a feature since 2015 and has accumulated over 3 billion miles of on-road driving (Karpathy, 2020).

Tesla has issued quarterly safety reports since the third quarter of 2018. Tesla uses a standard calendar, with Q3 corresponding to July 1 to September 30. Initially, crashes were reported as average million miles between crashes for three conditions (Tesla, Inc., 2022):

1. “Autopilot engaged”
2. “without Autopilot but with our active safety features”

3. “without Autopilot and without our active safety features”

Beginning in Q2 2021, Tesla began using different categories (Tesla, Inc., 2022):

1. “Autopilot technology (Autosteering and active safety features)”
2. “not using Autopilot technology (no Autosteering and active safety features)”

Initially, Tesla used these new categories for Q2 2021 and later, while keeping the old categories for Q1 2021 and prior. According to the Internet Archive’s Wayback Machine (Ogden et al., 2023), sometime between January 5 (Tesla, Inc., 2023b) and January 8, 2023 (Tesla, Inc., 2023c), Tesla revised all safety reports to match the new 2-category system, but changed the category wordings slightly:

1. “using Autopilot technology”
2. “not using Autopilot technology”

In addition to changing the category names, Tesla also revised their crash rates, even for those with identical definitions, *i.e.*, “Autopilot engaged” and “using Autopilot technology.” In the footnotes, Tesla clarified that they had “discovered reports of certain events where no airbag or other active restraint deployed, single events that were counted more than once, and reports of invalid or duplicated mileage records rates” (Tesla, Inc., 2023c).

While the original crash rates are no longer listed on Tesla’s website, rates between Q3 2018 and Q1 2021 were recorded in the literature (Goodall, 2023a), and all rates were recorded by the Internet Archive’s Wayback Machine (Tesla, Inc., 2023c), a digital archive of web content (Ogden et al., 2023). The remainder of this note investigates how the crash rates changed as a result of the January 2023 revision.

2 Analysis

2.1 Autopilot Crash Rates

Many quarters showed substantially different Autopilot crash rates postrevision, from a 10.8% reduction in crashes per mile in Q2 2020 to a 12.7% increase in Q3 2019 compared to crash rates prior to the revision. The average change was a 3.6% reduction in Autopilot crashes. Prerevision and postrevision Autopilot crash rates are shown in Table 1.

Table 1. Autopilot Crash Rates from Tesla Safety Reports

Quarter	Crashes per 100 million miles		Difference
	Prerevision	Postrevision	
Q3 2018	29.9	29.9	-0.3%
Q4 2018	34.4	35.2	2.5%
Q1 2019	34.8	34.7	-0.3%
Q2 2019	30.6	30.9	0.9%
Q3 2019	23.0	26.0	12.7%
Q4 2019	32.6	32.2	-1.3%
Q1 2020	21.4	20.6	-3.7%
Q2 2020	22.1	19.7	-10.8%
Q3 2020	21.8	19.6	-9.8%
Q4 2020	29.0	26.6	-8.2%
Q1 2021	23.9	21.6	-9.7%
Q2 2021	22.7	20.2	-10.7%
Q3 2021	20.1	18.1	-10.3%
Q4 2021	23.2	23.0	-0.9%
Average	26.4	25.6	-3.6%

2.2 Non-Autopilot Crash Rates

The second category, “not using Autopilot technology” (hereafter referred to as “non-AP”) implies that any crash not in the first category must be in the second category. An analysis of the data, however, raises several questions.

Table 2 and Figure 1 show crash rates for all non-Autopilot categories visible on Tesla’s website on December 28, 2022 (prior to the revision) and September 6, 2023 (after the revision).

Table 2. Non-Autopilot Crash Rates from Tesla Safety Reports

Non-Autopilot crashes per 100 million miles				
Quarter	“not using Autopilot technology (no Autosteer and active safety features)” (prerevision)	“with our active safety features” (prerevision)	“without our active safety features” (prerevision)	“not using Autopilot technology” (postrevision)
Q3 2018	-	52.1	49.5	52.1
Q4 2018	-	63.3	80.0	81.3
Q1 2019	-	56.8	79.4	80.6
Q2 2019	-	45.7	70.9	71.4
Q3 2019	-	37.0	54.9	64.1
Q4 2019	-	47.6	61.0	67.6
Q2 2020	-	44.1	64.1	61.3
Q1 2020	-	50.3	70.4	69.0
Q3 2020	-	41.3	55.9	56.2
Q4 2020	-	48.8	78.7	79.4
Q1 2021	-	48.8	102.2	101.6
Q2 2021	83.3	-	-	73.5
Q3 2021	62.5	-	-	63.3
Q4 2021	62.9	-	-	65.8
Q1 2022	-	-	-	82.6
Q2 2022	-	-	-	64.9
Q3 2022	-	-	-	58.5
Q4 2022	-	-	-	71.4
Mean	69.6	48.7	69.7	71.3
Std. Dev.	11.9	7.2	15.1	13.9
Coeff. of Variation	17.1%	14.7%	21.6%	19.5%

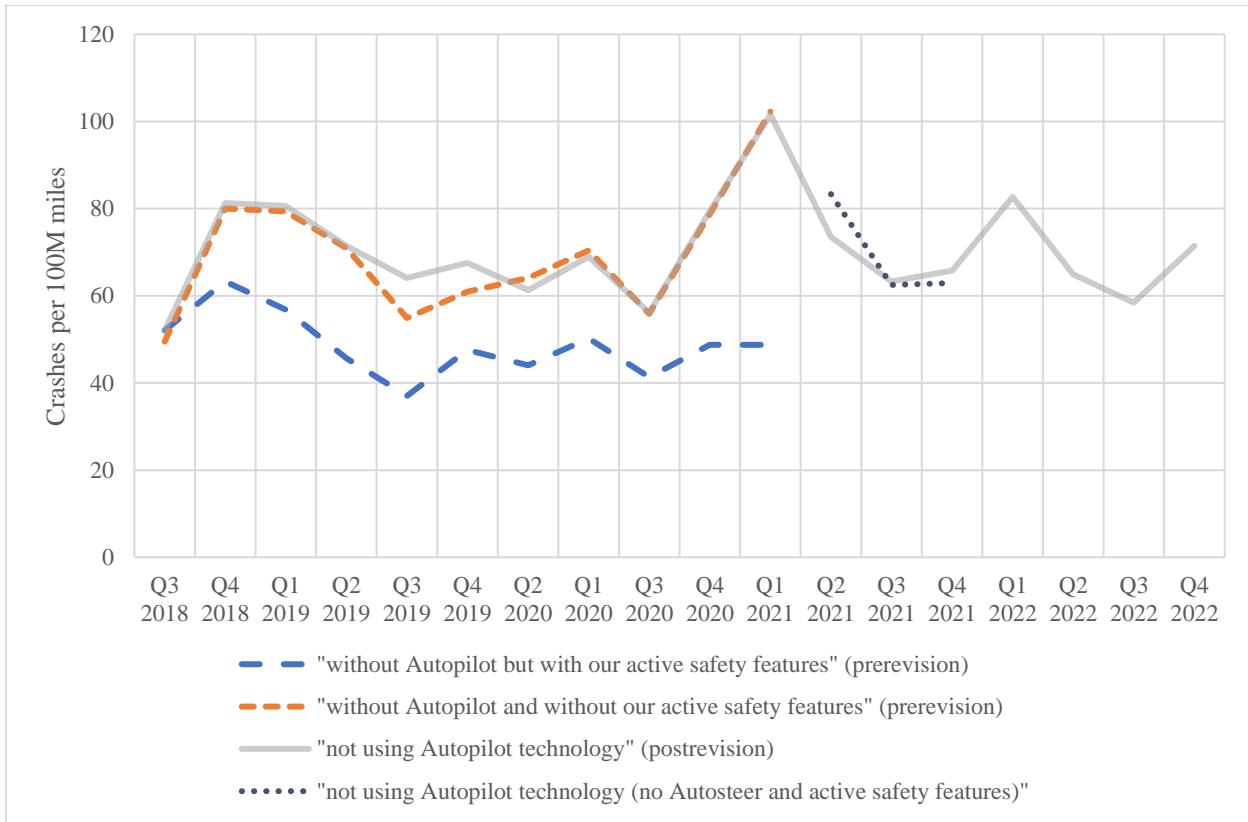


Figure 1. Non-Autopilot Crash Rates from Tesla Safety Reports

Note that “not using Autopilot technology” tracks closely with the two categories “without Autopilot and without our active safety features” and “not using Autopilot technology (no Autosteer and active safety features).” This suggests that the new revised category is heavily weighted towards crashes and miles where active safety systems were not running.

This is surprising, as studies have shown that drivers generally leave most active safety features running. The Highway Loss Data Institute (HLDI) conducted a study in 2016 at vehicle service departments (Reagan et al., 2018). Vehicles arriving for service were checked to see if various driver assistance systems were activated. The authors found that 93% of the 659 front crash prevention systems that maintain their setting at the next ignition were turned on. These results indicate that a high percentage of drivers use active safety features such as front crash prevention.

Many Tesla vehicles are equipped with four active safety features: lane assist, collision avoidance assist, speed assist, and cabin camera. Collision avoidance assist consists of several sub-features, one of which is automatic emergency braking. According to the most recent owner’s manuals of the Model S, X, Y, and 3 (software version 2023.32), automatic emergency braking is activated by default at the beginning of every ignition cycle, and operates

continuously when the vehicle travels at speeds between approximately 3 mi/hr (5 km/hr) and 124 mi/hr (200 km/hr)” (Tesla, Inc., 2023d, p. 136, 2023e, p. 154, 2023f, p. 141, 2023g, p. 128) Automatic emergency braking can only be deactivated by shifting the vehicle into park and selecting Controls > Autopilot > Automatic Emergency Braking from the vehicle’s menu. This procedure must be repeated at the beginning of each drive, as automatic emergency braking is active by default.

Tesla vehicles appear to have at least one form of active safety systems, automatic emergency braking, running by default across nearly all speeds and driving conditions. Even though drivers can deactivate this feature at the beginning of every drive by pushing three or four buttons from the menu, studies show that only 7% actually do so (Reagan et al., 2018), even when their cars remember their selection trip-to-trip (Teslas do not). This suggests that for nearly all non-Autopilot miles, an active safety feature is running.

If active safety features are active on nearly all Tesla vehicle miles, then one would expect the non-AP crash rate to be very close to the “without Autopilot but with our active safety features” crash rate from the prerevision reports, as these would represent the vast majority of all non-AP mileage. Analysis shows that this is in fact not the case, as the revised non-AP crash rate is much closer to the “without Autopilot and without our active safety features” crash rate. The next section discusses potential reasons for this discrepancy.

3 Discussion

There are at least three reasons why Tesla’s non-AP crash rate more closely matches the “without Autopilot and without our active safety features” crash rate despite evidence that active safety features run for the majority of driving. This section evaluates the likelihood of each explanation.

3.1 Universal Quantification

In predicate logic, universal quantification asserts that a property must hold true for *all* members of its domain (Shapiro and Kouri Kissel, 2022). When Tesla stated that crash rates were for vehicles “without Autopilot but with our active safety features” (Tesla, Inc., 2022a), they may have been using a universal quantification with regards to active safety features, and thereby including crashes and miles that occurred only when *all* active safety feature were engaged. If the vast majority of crashes and miles occurred when at least one active safety system was either disabled by the driver or outside of the system’s design domain, then the postrevision crash rates would be biased towards “without active safety feature” crash rates, as was observed in the revised data.

The evidence suggests that, while it is possible to travel and crash with no operational active safety features, it is in fact impossible for all active safety features to run simultaneously. For

example, Obstacle-Aware Acceleration, a sub-feature of Collision Avoidance Assist, is designed only to work at speeds between 0 and 10 mi/hr (16 km/hr) (Tesla, Inc., 2023d, p. 137), while Lane Departure Avoidance, a sub-feature of Lane Assist, is only operational when driving between 40 and 90 mi/hr (64 and 145 km/hr) “on roads with clearly visible lane markings” (Tesla, Inc., 2023d, p. 132). It is unclear how Obstacle-Aware Acceleration could ever operate at the same time as Lane Departure Avoidance, as neither runs between 11 mi/hr (18 km/hr) and 39 mi/hr (63 km/hr). Figure 2 shows the operational speeds of various Tesla active safety features in Software version 2023.32, with additional detail in Table 3.

There is no speed at which all systems can be simultaneously operational. Up to twelve features can operate simultaneously on major roads with clear lane markings between 40 and 85 mi/hr, but Obstacle-Aware Acceleration is limited to speeds below 10 mi/hr.

If this is in fact how Tesla classifies crashes “without active safety features,” then there should be no crashes or miles occurring both without Autopilot and *with* active safety features, as there is no way for all active safety features to operate simultaneously. Yet Tesla was able to report “with active safety features” crash rates between Q3 2018 and Q1 2021 as shown in Table 2, suggesting that this is not how Tesla classifies active safety feature activation.

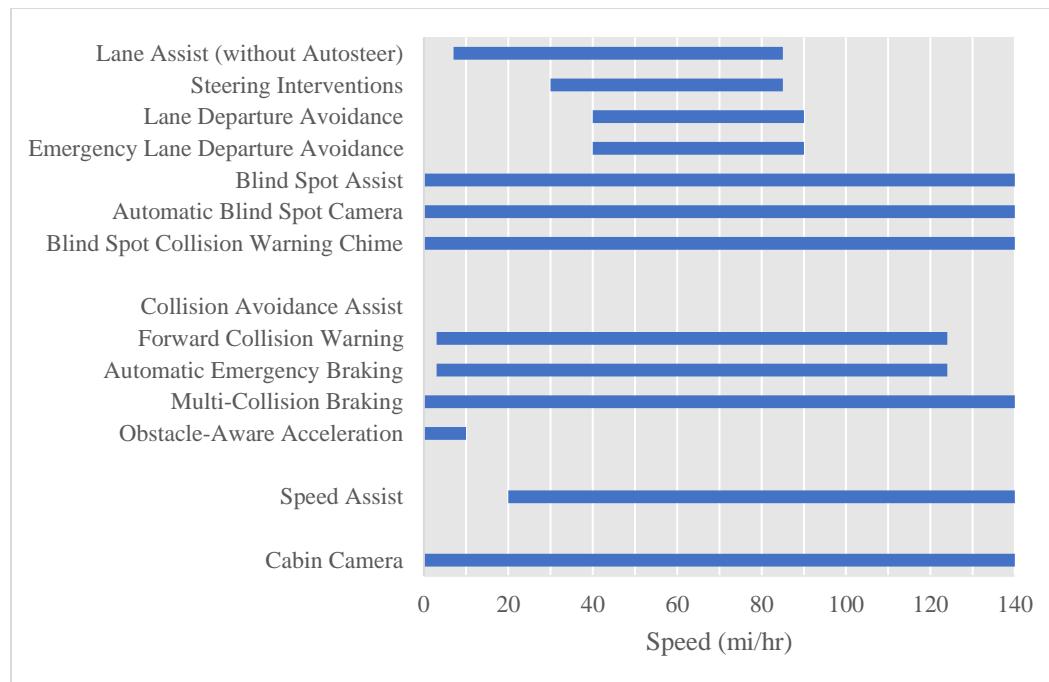


Figure 2. Operational Speeds of Tesla Active Safety Features, software version 2023.32

Table 3. Tesla Safety Features, software version 2023.32

Active Safety Feature	Speed Range	Notes
Lane Assist (without Autosteer)	7–85 mi/hr (12–140 km/hr)	Approximate
Steering Interventions	30–85 mi/hr (48–140 km/hr)	“on major roads with clearly visible lane markings.”
Lane Departure Avoidance	40–90 mi/hr (64–145 km/hr)	“on roads with clearly visible lane markings.”
Emergency Lane Departure Avoidance	40–90 mi/hr (64–145 km/hr)	“on a road with clearly visible lane markings, curbs, etc.”
Blind Spot Assist	0–140 mi/hr (0–240 km/hr)	Inferred from manuals
Automatic Blind Spot Camera	0–140 mi/hr (0–240 km/hr)	Inferred from manuals
Blind Spot Collision Warning Chime	0–140 mi/hr (0–240 km/hr)	Inferred from manuals
Collision Avoidance Assist		
Forward Collision Warning	3–124 mi/hr (5–200 km/hr)	Approximate
Automatic Emergency Braking	3–124 mi/hr (5–200 km/hr)	Approximate
Multi-Collision Braking	0–140 mi/hr (0–240 km/hr)	Inferred from manuals
Obstacle-Aware Acceleration	0–10 mi/hr (0–16 km/hr)	
Speed Assist	0–140 mi/hr (0–240 km/hr)	Inferred from manuals
Cabin Camera	0–140 mi/hr (0–240 km/hr)	Inferred from manuals

3.2 Other Classification Schemes

Tesla may be using a different method to classify non-AP crashes as either with or without *applicable* active safety features. Although there is no way to determine this from the available data, some possible schemes are:

1. **Exclusion of certain applicable active safety features.** Tesla may be using a universal quantification but excluding specific features, such as Obstacle Aware Acceleration. This would permit all other active safety features to be running in certain instances, thereby classifying them as a small sample of “with active safety features” crashes and miles.
2. **Different minimum feature thresholds.** Tesla may instead consider a crash to be “with active safety features” if two, three, four, etc. features are running simultaneously.
3. **Differences in model-year vehicles.** Active safety features were reviewed for the most recent software version of all four Tesla models. There may be earlier versions of Tesla vehicles with fewer active safety features or with different operational speed or other characteristics that may result in a large percentage of vehicles operating without active safety features per Tesla’s definition. Given the numerous software versions, possible variants in crash classification schemes, and uncertainty in crash/mileage sample size, a detailed review of vehicle specifications is unlikely to resolve these questions and was considered outside the scope of this note.

There may be other classifications schemes with consistent logic and utilization at play. Additional context would benefit researchers.

3.3 Unreported Data

It is possible that some data was not included in the revised crash rates, either as part of the exclusions mentioned in the January 2023 update (Tesla, Inc., 2023c) or by some other means. This interpretation has some support under the terminology used for the Q2–Q4 2021 reports, where “not using Autopilot technology (no Autosteer and active safety features)” could be read as “no Autosteer *and* no active safety features.”

There is also some statistical evidence to support this interpretation. After the revisions, the average non-Autopilot crash rate between Q3 2018 and Q1 2021 was 71.3 crashes per 100 million miles, higher than both the prerevision with (48.7) and without (69.7) active safety features. Although precise mileage and crash counts are unavailable, the relative weights of the two prerevision crash rates in combined postrevision crash rate can be calculated using the formula for averages of averages.

$$\mu = \frac{\sum \mu_i n_i}{\sum n_i}$$
$$\mu = \frac{n_1 \mu_1 + n_2 \mu_2}{n_1 + n_2}$$

Substituting $n_2 = 1 - n_1$ yields:

$$n_1 = \frac{\mu - \mu_2}{\mu_1 - \mu_2}$$

The sample sizes n_1 and n_2 represent the relative sample sizes of prerevision crash rates in the postrevision crash rate μ .

In most of the reported quarters, the revised crash rate is higher than both of the prerevision crash rates, resulting in negative weights. This is due to reclassification of crashes by Tesla in the revision. Instead, this analysis focused on Q2 2020 where the revised crash rate was between the prerevision rates. For Q2 2020, “without active safety features” represented 86% of the revised crash rate, while “with active safety features” represented 14%. As crash rate is defined as crashes per vehicle-miles traveled (and assuming insignificant changes to the number of crashes and miles as part of the revision), then non-Autopilot mileage without active safety features was approximately 6.3 times greater than with active safety features for that quarter. This is a conservative estimate of the most evenly balanced quarter and does not attempt to estimate the

number of exclusions discussed in Tesla’s 2023 update. For comparison, Autopilot quarterly crash rates increased by an average of 4.7% on a quarterly basis, while non-Autopilot crash rates decreased by 2% over Q2–Q4 2021 based solely on revisions.

If vehicles without active safety features traveled 6.3 times further than vehicles with active safety features, this would be expected to result in more consistent quarter-to-quarter crash rates. According to the central limit theorem, as the sample size of a population of means increases, the sample mean variance will decrease (Kwak and Kim, 2017). A visual inspection of Figure 1 does not show an observable difference in variation. The sample standard deviation of “without active safety features” is 7.2 (14.7% coefficient of variation), lower than “with active safety features” at 15.1 (21.6% coefficient of variation). This is a counterintuitive result, given that “without active safety features” was expected to have a larger sample size.

Because the quarterly crash reports represent different Tesla software versions in a continuously evolving vehicle fleet, these cannot be considered means from the same population, and so there are limited statistical tools available to analyze these results. Still, a cursory analysis raises several questions about sample size, crash classifications, and data transparency that require additional context before any conclusions can be drawn regarding the safety and crash rates of Tesla vehicles.

Conclusions

This note examined Tesla’s revised safety reports covering the period from July 2018 to December 2022, which document the average miles between crashes for Tesla vehicles. Crash rates were reported as three categories prior to March 2021: Autopilot, active safety features only, and neither. In January 2023, Tesla revised all historical crash rates to a two-category system: “using Autopilot technology” and “not using Autopilot technology.” Tesla further updated crash rates to reflect recently discovered instances of double counting and false positives.

The analysis presented as part of this note revealed unintuitive discrepancies in the crash rate data, particularly in the “not using Autopilot technology” category, which suggests that crashes without active safety features were heavily weighted in the postrevision reports. This finding is surprising, as prior research suggests that drivers usually keep active safety features enabled.

Several potential explanations for this discrepancy were discussed, including the possibility that Tesla used a universal quantification approach, which includes all crashes and miles that occurred when all active safety features were engaged. However, analysis showed that it is impossible for all active safety features to run simultaneously due to differing operational speeds and conditions. Thus, this explanation is unlikely to account for the observed results.

Another possibility is that Tesla employed an alternate classification scheme that excluded specific features or applied different minimum feature thresholds when categorizing crashes. While this is plausible, more context and information are needed to verify this hypothesis.

Finally, the possibility of unreported data or exclusions in the revised crash rates was considered. Some evidence suggests that certain data might not have been included in the revised rates, potentially affecting the overall results. Specifically, the smaller sample sizes of “with active safety features” needed to produce the revised non-AP crash rates do not exhibit smaller variances as would be expected.

In conclusion, Tesla’s revisions to its safety reports raise questions and warrant further investigation. The discrepancies observed in the crash rate data, especially in the “not using Autopilot technology” category, highlight the need for greater transparency and clarity in reporting methodologies. Given the limited data on automated driving system crash rates, a clearer understanding of the data sources and classifications used by manufacturers like Tesla is essential for researchers, regulators, and consumers.

Funding

This work did not receive external funding.

Acknowledgements

Justice Appiah, Geoff Keeling, and Michael Fontaine reviewed draft sections of this paper.

CRediT Authorship Contribution Statement

Noah Goodall: Conceptualization, Formal analysis, Investigation, Methodology, Visualization, Writing – original draft preparation, Writing – review & editing.

Declaration of Competing Interests

The author has served as a paid expert witness for the plaintiffs in litigation filed against Tesla.

REFERENCES

Blanco, M., Atwood, J., Russell, S., Trimble, T., McClafferty, J., Perez, M., 2016. Automated Vehicle Crash Rate Comparison Using Naturalistic Data. Virginia Tech Transportation Institute.

Dixit, V.V., Chand, S., Nair, D.J., 2016. Autonomous Vehicles: Disengagements, Accidents and Reaction Times. PLOS ONE 11 12 , e0168054. doi:10.1371/journal.pone.0168054

Goodall, N., 2023a. Normalizing crash risk of partially automated vehicles under sparse data. J. Transp. Saf. Secur. doi:10.1080/19439962.2023.2178566

Goodall, N., 2023b. Comparability of Automated Vehicle Crash Databases. doi:10.48550/arXiv.2308.00645

Goodall, N.J., 2021. Comparison of automated vehicle struck-from-behind crash rates with national rates using naturalistic data. *Accid. Anal. Prev.* 154, 106056. doi:10.1016/j.aap.2021.106056

Highway Loss Data Institute, 2017. Tesla Model S Driver Assistance Technologies (No. Bulletin Vol. 34, No. 30). Highway Loss Data Institute.

Karpathy, A., 2020. AI for Full-Self Driving at Tesla. Presented at the Scaled Machine Learning Conference.

Kwak, S.G., Kim, J.H., 2017. Central limit theorem: the cornerstone of modern statistics. *Korean J. Anesthesiol.* 70 2 , 144–156. doi:10.4097/kjae.2017.70.2.144

Leslie, A.J., Kiefer, R.J., Flannagan, C.A., Schoettle, B.A., Owen, S.H., 2022. Analysis of Field Effects Associated with the GM Super Cruise System (No. UMTRI-2022-3). University of Michigan Transportation Research Institute, Ann Arbor, MI.

National Highway Traffic Safety Administration, 2021. Standing General Order 2021-01: Incident Reporting for Automated Driving Systems and Level 2 Advanced Driver Assistance Systems [WWW Document]. URL https://www.nhtsa.gov/sites/nhtsa.gov/files/2021-06/Standing_General_Order_2021_01-digital-06292021.pdf (accessed 8.1.21).

Ogden, J., Summers, E., Walker, S., 2023. Know(ing) Infrastructure: The Wayback Machine as object and instrument of digital research. *Convergence* 13548565231164759. doi:10.1177/13548565231164759

Quality Control Systems Corporation, 2019. NHTSA's Implausible Safety Claim for Tesla's Autosteer Driver Assistance System. Quality Control Systems Corporation, Crownsville, Maryland.

Reagan, I.J., Cicchino, J.B., Kerfoot, L.B., Weast, R.A., 2018. Crash avoidance and driver assistance technologies – Are they used? *Transp. Res. Part F Traffic Psychol. Behav.* 52, 176–190. doi:10.1016/j.trf.2017.11.015

SAE International, 2021. Taxonomy and Definitions for Terms Related to Driving Automation Systems for On-Road Motor Vehicles (No. J3016_202104).

Schoettle, B., Sivak, M., 2015. A Preliminary Analysis of Real-World Crashes Involving Self-Driving Vehicles (No. UMTRI-2015-34). University of Michigan Transportation Research Institute, Ann Arbor, MI.

Teoh, E.R., Kidd, D.G., 2017. Rage against the machine? Google's self-driving cars versus human drivers. *J. Safety Res.* 63, 57–60. doi:10.1016/j.jsr.2017.08.008

Tesla, Inc., 2023a. Q4 and FY 2022 Update [WWW Document]. Tesla Invest. Relat. URL <https://digitalassets.tesla.com/tesla-contents/image/upload/IR/TSLA-Q4-2022-Update> (accessed 10.24.23).

Tesla, Inc., 2023b. Tesla Vehicle Safety Report [WWW Document]. Internet Arch. Wayback Mach. URL <https://web.archive.org/web/20230108161818/https://www.tesla.com/VehicleSafetyReport> (accessed 10.4.23).

Tesla, Inc., 2023c. Tesla Vehicle Safety Report [WWW Document]. Internet Arch. Wayback Mach. URL <https://web.archive.org/web/20230105180059/https://www.tesla.com/VehicleSafetyReport> (accessed 10.4.23).

Tesla, Inc., 2023d. Tesla Model S Owner's Manual [WWW Document]. Tesla. URL
https://www.tesla.com/ownersmanual/models/en_us/Owners_Manual.pdf (accessed 10.5.23).

Tesla, Inc., 2023e. Tesla Model X Owner's Manual [WWW Document]. Tesla. URL
https://www.tesla.com/ownersmanual/modelx/en_us/Owners_Manual.pdf (accessed 10.5.23).

Tesla, Inc., 2023f. Tesla Model Y Owner's Manual [WWW Document]. Tesla. URL
https://www.tesla.com/ownersmanual/modely/en_us/Owners_Manual.pdf (accessed 10.5.23).

Tesla, Inc., 2023g. Tesla Model 3 Owner's Manual [WWW Document]. Tesla. URL
https://www.tesla.com/ownersmanual/model3/en_us/Owners_Manual.pdf (accessed 10.5.23).

Tesla, Inc., 2022. Tesla Vehicle Safety Report [WWW Document]. Internet Arch. Wayback Mach. URL
<https://web.archive.org/web/20220121034623/https://www.tesla.com/VehicleSafetyReport> (accessed 10.4.23).